

## Appendix E

---

Phase One Environmental Site Assessment,  
APNS 377-190-002, 377-190-003,  
377-190-004, Collier Avenue

**S & S Commercial Environmental Services, Inc.**  
**Phone (949)650-4994 714-337-4323 Fax (909)498-0302 e-mail [s.quart@verizon.net](mailto:s.quart@verizon.net)**



**TOP: APN Map Parcels 377-190-002, 377-190-003, 377-190-004**

**BOTTOM: View Across Subject Property SW to NE**

**PHASE ONE ENVIRONMENTAL SITE ASSESSMENT**  
**APNS 377-190-002, 377-190-003, 377-190-004 COLLIER AVENUE**  
**LAKE ELSINORE, CALIFORNIA 92530**

**24732 Overlook Drive Corona, CA 92882**

## TABLE OF CONTENTS

<b>1.0</b>	<b>INTRODUCTION .....</b>	<b>4</b>
1.1	Purpose and Scope of Work.....	7
1.2	Involved Parties/Information Sources.....	7
1.3	Limitations and Exceptions.....	10
<b>2.0</b>	<b>PRINCIPAL FINDINGS .....</b>	<b>11</b>
2.1	Summary of Operations and Environmental Discrepancies .....	11
2.2	Summary of Building Materials and Environmental Discrepancies.....	12
2.2.1	Asbestos.....	12
2.2.1.1	Building Materials Presumed to Contain Friable Asbestos .....	13
2.2.1.2	Building Materials Presumed to Contain Non-Friable Asbestos.....	14
2.2.2	Radon .....	14
2.2.3	Lead Paint.....	14
2.2.4	Poly-Chlorinated Biphenyl (Pcb).....	14
2.2.5	Lead In Water .....	14
2.2.6	Mold .....	14
2.2.7	Flood Plain.....	14
2.2.8	Wetlands .....	15
2.2.9	Indoor Air .....	15
2.2.10	Underground Tank .....	15
2.2.11	Vapor Intrusion.....	15
2.2.12	Vapor Encroachment Condition .....	15
<b>3.0</b>	<b>SITE OVERVIEW .....</b>	<b>16</b>
3.1	Location.....	16
3.2	Adjacent Properties .....	16
3.3	Site Description .....	16
<b>4.0</b>	<b>SITE HISTORY AND OPERATIONS .....</b>	<b>17</b>
4.1	Building Permit History .....	17
4.2	Operations .....	17
4.3	Operational Permits, Manifests, MSDS .....	17
<b>5.0</b>	<b>ENVIRONMENTAL SETTING .....</b>	<b>17</b>
5.1	Regional Physiographic .....	17
5.2	Soil Conditions.....	18
5.3	Groundwater Conditions .....	18
<b>6.0</b>	<b>RESULTS OF INVESTIGATIONS.....</b>	<b>18</b>
6.1	Site Inspection Observations.....	18
6.2	Regulatory Agency Contacts.....	20

## **TABLE OF CONTENTS**

<b>6.3</b>	<b>Personal Interviews, Site Records Review .....</b>	<b>20</b>
<b>6.4</b>	<b>Historical Aerial Photograph Review.....</b>	<b>20</b>
<b>6.5</b>	<b>Synopsis of Previous Environmental Investigations .....</b>	<b>21</b>
<b>6.6</b>	<b>Summary of Government Records Search.....</b>	<b>22</b>
<b>7.0</b>	<b>DISCUSSION OF INVESTIGATION .....</b>	<b>23</b>
<b>8.0</b>	<b>CONCLUSIONS.....</b>	<b>25</b>
<b>8.1</b>	<b>Areas of No Apparent Concern.....</b>	<b>25</b>
<b>8.2</b>	<b>Areas of Further Concern.....</b>	<b>25</b>
<b>9.0</b>	<b>RECOMMENDATIONS .....</b>	<b>25</b>
<b>9.1</b>	<b>Areas of No Action .....</b>	<b>25</b>
<b>9.2</b>	<b>Further Investigation.....</b>	<b>25</b>
<b>9.3</b>	<b>Performance Statement 1527-21 12.8.1.....</b>	<b>25</b>
<b>10.0</b>	<b>LIMITATIONS .....</b>	<b>25</b>
<b>11.0</b>	<b>REFERENCES.....</b>	<b>27</b>
<b>11.1</b>	<b>Published References .....</b>	<b>27</b>
<b>11.2</b>	<b>Record of Personal Communications .....</b>	<b>27</b>
<b>12.0</b>	<b>APPENDICES .....</b>	<b>29</b>
<b>12.1</b>	<b>Site Location Map.....</b>	<b>30</b>
<b>12.2</b>	<b>Historical Aerial Photographs &amp; Sanborn Fire Insurance Maps.....</b>	<b>32</b>
<b>12.3</b>	<b>USGS Topographic Map of Site.....</b>	<b>47</b>
<b>12.4</b>	<b>Environmental Features.....</b>	<b>49</b>
<b>12.5</b>	<b>Building Permits .....</b>	<b>53</b>
<b>12.6</b>	<b>DTSC Envirostor Map and Geotracker .....</b>	<b>78</b>
<b>12.7</b>	<b>DOGGR Section .....</b>	<b>81</b>
<b>12.8</b>	<b>SCAQMD.....</b>	<b>84</b>
<b>12.9</b>	<b>Letter from Magnetek .....</b>	<b>86</b>
<b>12.10</b>	<b>Certification .....</b>	<b>89</b>
<b>12.11</b>	<b>Resume .....</b>	<b>91</b>
<b>12.12</b>	<b>Environmental First Search Report.....</b>	<b>98</b>

**October 28, 2024**

**S & S Job #OC24012**

**Lender - Client Privilege Work Product**

**ATTN: COLLIER COMMERCIAL PROPERTIES, LLC**  
**43 Golfview Drive**  
**Dove Canyon, CA 92679**

**N 33-40-55, W 117-19-49 (NAD 83)**  
**33.681843, -117.330313**

**RE: Phase I Environmental Site Assessment**  
**Undeveloped Property on Collier Avenue**  
**APNS 377-190-002, 377-190-003, 377-190-004**  
**Lake Elsinore, CA 92530**

**Township: 06S Range: 04W Section: 06**  
**Baseline: San Bernardino**

**1.0 INTRODUCTION**

This report presents the results of our Phase I Environmental Site Assessment performed on the subject property known as APNS 377-190-002, 377-190-003, 377-190-004 in the City of Lake Elsinore in the County of Riverside, California. The Intended User for this Report is the Addressee above and the financial institution for which is intended.

This Phase I Site Assessment updates and relies on in part a Phase I Site Assessment performed in April 20th, 2021 by SoCal Engineers per ASTM 1527-13 on the property.

That Phase I did not identify any long term issues for the subject property. (see below)

“Based upon the site reconnaissance, historical review, regulatory records review, and other information detailed within this report, this Assessment identified no obvious evidence of Recognized Environmental Conditions (RECs), Controlled RECs or Historic RECs in connection with the subject property. No further investigation is recommended.”

The purpose of this Phase I Site Assessment is for Due Diligence to identify any historical or current environmental issues which might affect the subject property during due diligence for a loan where the subject property is collateral.

The following Phase I Site Assessment is intended to meet the Scope of Work requirements and procedures included within 40 CFR §312 et al and ASTM E 1527-21 for the transfer, new finance or a refinance of an existing loan on the above property.

The purpose of this report is to provide an AAI- Compliant Phase I Environmental Site Assessment to evaluate the risks associated with providing financing and/or accepting the Property as collateral. “innocent landowner, contiguous property owner, or bona fide prospective purchaser limitations on CERCLA liability” (42 U.S.C. §9601 et seq). Qualification for these limitations is predicated on the assumption that “...the defendant must have undertaken, at the time of acquisition, all appropriate inquiry into the previous

**Subject Property : APNS 377-190-002, 377-190-003, 377-190-004 Lake Elsinore, CA 92530**

ownership and uses of the property consistent with good commercial or customary practice in an effort to minimize liability....” However, no warranty is made so that this report constitutes all appropriate inquiry since numerous other factors, including user responsibilities, are required.

There were no Special Conditions for this Phase I Site Assessment Environmental Report.

The site inspection was performed on Monday October 28, 2024. This Phase I is valid per ASTM 1527 -21 Section 4.6 for 180 days from that date or March 28, 2024.

All appropriate inquiry into the previous ownership and uses of the Property was conducted to identify all potential environmental conditions that may have a material impact on the Property and to minimize the liability both on-site and from adjoining and adjacent properties which may have environmental issues germane to the subject

**Current State of California & Federal Agency Web Data Reviewed For This Report**

* Cal-EPA	Envirostor
* Regional Water Quality Control Board	Geotracker
* Dept of Conservation (DOGGR)	Div. of Oil & Gas
* SCAQMD	Find
* SoCal Professional Engineers	Phase I

The 2006 EPA “All Appropriate Inquires” provides for determination by the Environmental Professional CFR Title 40 Section 312.22 as to what records are necessary to understand a subject property history. The ASTM 1527-2021 Standard provides a list of possible sources of information for the Environmental Professional to use to determine that history and the potential for Environmental Problems.

Property tax records (ASTM §8.3.4.3) and Zoning/Land use records (ASTM §8.3.4.8) were not considered significant sources for information due to the known history of the individual parcels making up the subject property, the known current and former occupants and the building permit history for the parcel. ASTM §8.3.4.7)

Recorded land title records (ASTM §8.3.4.4) are part of a Title Report which was requested as part of the contract and is the Clients Responsibility per ASTM 1527-2013 Standard. The new standard states in summary that in order to satisfy AAI, a user must conduct a search for the existence of environmental liens or AULs that are filed or recorded against the property.

While not provided, a Title Report was not deemed necessary by this Environmental Professional to evaluate the environmental status of the property based upon the information identified in the research for this report.

No Significant Data Gaps were identified. Greatest reliance was on Historical Aerial Photographs, SoCal Professional Engineers, and Envirostor.

---

***Subject Property : APNS 377-190-002, 377-190-003, 377-190-004 Lake Elsinore, CA 92530***

A Google search was the only Other Historical Source used (ASTM §8.3.4.9) due to the nature of the parcel and the other information available to determine the history. There were no unusual or environmentally sensitive uses noted.

Cross Streets Directories were not considered necessary based upon the history of the subject property and properties adjoining and adjacent.

Sanborn Fire Insurance Maps showed the area of the subject property in 1933 the last year that they were drawn for Elsinore. The maps were not site specific. (See 12.2 Historical Aerial Photographs and Sanborn Fire Insurance Maps in the appendix)

An Underground Tank Research Request was not submitted due to the known activities on the subject property, prior research and availability of records.

An Environmental Records Search was purchased to identify any CERCLIS, NPL, SPL, RCRA-CORRACTS, CERCLIS/NFRAP, RCRA-TSD, SCL, SWLF Sites within a significant distance of the subject property.

This list was also checked for Leaking Underground Tank Sites within a significant distance of the subject property. Those closest to the subject property have all been closed and are not considered an issue. (see 12. 6 DTSC Envirostor Map and Geotracker in appendix)

No potential leaking underground tanks, RCRA Generators or other environmentally sensitive activities were identified within a significant distance of the subject property

There are 3 Geothermal Wells within an approximate mile of the subject property. These are not expected to be an issue.

*Current State of California Agency Information Reviewed For This Report*

*	Cal-EPA	Envirostor
*	Regional Water Quality Control Board	Geotracker
*	Dept of Conservation (DOGGR)	Div of Oil & Gas
*	South Coast Air Quality Management District	SCAQMD

No Significant *Data Gaps* were identified. The subject property has been shown to be undeveloped and vacant over the years. Development south as a Towing Yard. West across W. Minthorn Street as a portable and toilet rental and piping contractor with Flood Control Basin monitoring and operations building. North the construction of a Flood Control Stormwater Retention Basis. Across Collier Avenue to the east State Highway 395 then completion of Interstate 15.

A *Title Report* was not provided for research for *Environmental Liens*. Based on the research for this report, a *Google Internet Search*, *CAL-EPA Envirostor* and known history, no environmental liens are expected.

## **Report Organization**

This report is divided into sections which discuss the field investigation, government records search, regulatory agency contacts and recommendations. Appendices follow the text.

### **1.1 Purpose and Scope of Work**

The purpose of a Phase I Environmental Site Assessment is to discover any past or present environmentally related events which may negatively impact the subject property. This includes a search of all available records concerning the property and the performance of an on-site inspection. Procedures followed in the performance of a Phase I Environmental Site Assessment include executing a government records search, researching permits for the site where prudent, interviewing the tenants of the subject property or neighbors in close proximity, studying aerial photographs, interviewing personnel at the appropriate regulatory agencies and conducting a physical survey of the subject property.

### **1.2 Involved Parties/Information Sources**

This *S & S Commercial Environmental Services, Inc.*, Phase I Environmental Site Assessment is produced through the efforts of a California Registered Environmental Assessor working in conjunction with Federal, State and county regulatory agencies. Track Info Services L.L.C. maintains a comprehensive, computerized data base of pertinent, environmentally related records, referred to as an *Environmental First Search Report*, which is updated on a regular basis. This database is researched for Category I, II, III and IV sites within a mile of the subject property and a report is generated based upon the available regulatory records. The report is reviewed for sites which might impact the subject property, and an inquiry is directed toward those sites within the 2,000-foot hazardous waste disclosure zone.

The field investigation includes a site assessment, observations of the neighboring facilities and verification of permits and building records, as necessary. This review and inspection was performed by Stephen A. Quartararo, California Registered Environmental Assessor, California General Engineering Contractor, Hazardous Materials Certified, California Asbestos Contractor, CA Drilling Contractor and ASPE Professional Estimator.

Definitions modified and added in the ASTM-1527 2013/21 Revision as approved by the EPA include:

a. Simplified Recognized Environmental Condition (REC) definition to “the presence or likely presence of any hazardous substances or petroleum products in, on, or at a property: (1) due to any release to the environment; (2) under conditions indicative of a release to the environment; or (3) under conditions that pose a material threat of a future release to the environment.”

b. Stated a Limitation on the definition of an HREC (historical REC) to closed RECs that have been completely resolved (“clean closure”) with no restrictions. Those

undergoing continued maintenance or monitoring should be discussed.

Also, for HREC's, if there has been a change in the regulatory criteria and if the Environmental Professional (EP) considers this past release to now be an REC at the time the Phase I ESA investigation is conducted,"... the condition shall be included in the conclusions section of the report as a REC."

c. Review of Title and Judicial Records for Environmental Liens or Activity and Use Limitations (AULs) continues to be a User (Client) requirement that is to be conducted by a Title professional, not the EP or Phase I Professional. Buyer or Lender needs to ensure that Title companies are searching for judicial records.

d. (VES) Vapor Encroachment Screening under E2600-22 is a referenced document in ASTM E1527 2021 under Section 2.1. Under this Standard Vapor migration should be treated no differently than the way contaminated groundwater migration is considered in a Phase I ESA and should be discussed using the CERCLA definition of "release" and "environment" which includes vapor.

### **BACKGROUND OF CALIFORNIA VAPOR REGULATIONS**

During the early 2000's the EPA and DTSC formulated guidelines for soil vapor including Volatile Organic Compounds known as VOC. This was because while VOCs are sinkers with a heavy center of gravity, remnants of chlorinated hydrocarbons, including Benzene in Gasoline and any cleaners for engines such as PCE left residual amounts of VOC in the soil which later became airborne and were related to future cancers.

In 2009 the EPA Published Regional Screening levels (RSLs) which included Vapor and PCE also known as VOCs or Volatile Organic Compounds.

In 2010 California (CAL EPA-DTSC) Published California Human Health Screening Levels (CHHSLs) which included vapor and VOCs/PCE.

In 2011 DTSC required that vapor intrusion into buildings be assessed at sites where VOCs are present in soil vapor...[if regulated compounds are found in soil then testing of the vapor should be performed]

... Assessment of the indoor air exposure pathway involves characterizing subsurface VOC vapor plumes, obtaining appropriate environmental data, using an attenuation factor to predict indoor air concentrations from vapor intrusion, and conducting a human health risk assessment for the inhalation pathway to estimate cancer risk and noncancer hazard.

DTSC provides guidance for assessing potential for health risks from the indoor air exposure pathway [DTSC, 2011].

In 2013 ASTM 1527-2013 was published and CERCLIS (Comprehensive Environmental Response, Compensation, and Liability Information System) was expanded to include vapor along with soil and water as potential sources of contamination and human health risk.

In 2015 ASTM 2600-15 was modified from the previous version as a model for soil vapor investigation where regulated soil contaminants were known or suspected in soil or vapor.

2019 saw the publication of ASTM E 1903 : 2019 Standard Practice for Environmental Site Assessments: Phase II Environmental Site Assessment Process.

In 2022 ASTM 2600-15 was modified from the previous version as a model for soil vapor investigation where regulated soil contaminants were known or suspected in soil or vapor. To ASTM 2600 – 22.

The most current version of the CA CHHSLs are included in HHRA Note 3 (DTSC 2023). HHRA Note 3 which lists the recommended DTSC modified screening levels for soil, tap water, and ambient air. The DTSC-SLs along with the U.S. EPA

Regional Screening Levels (RSLs) are to be used when conducting a screening level risk assessment.

Section 2.1 of ASTM E1527 - 2021 Standard - Vapor Encroachment Screening - 42 U.S.C. § 9601(22) defines a “release” as “any spilling, leaking, pumping, pouring, emitting, emptying, discharging, injecting, escaping, leaching, dumping, or disposing into the environment (including the abandonment or discharging of barrels, containers, and other closed receptacles containing any hazardous substances or pollutant or contaminant”

This includes solid, liquid and the ensuing migration of vapor into soil and water or from water upwards through soil in occupied areas

e. Controlled Recognized Environmental Condition (CREC) is a new term introduced in the ASTM E1527 -13 standard for Phase I Environmental Site Assessments (ESAs). The Controlled REC concept was introduced to address contaminated sites that have received risk-based regulatory closure, where no further remediation is required but residual contamination still exists at a site and the property is subject to some sort of control or use restriction. These sites, where contamination is controlled but could still pose ongoing or future obligations on the owner (such as special precautions during construction or grading activities), have been a source of some confusion to the environmental due diligence industry with regards to how they should be classified.

The CREC, as subset of the Recognized Environmental Condition (REC) category and a distinct category from Historical Recognized Environmental Condition (HREC), is intended to clarify the level of risk these sites represent. The environmental professional is required to list any CRECs (as well as RECs) identified in the findings and conclusions section of the Phase I Environmental Site Assessment report.

The ASTM definition of CREC in the E1527-21 standard is as follows: “a recognized environmental condition resulting from a past release of hazardous substances or petroleum products that has been addressed to the satisfaction of the applicable regulatory authority (for example, as evidenced by the issuance of a no further action letter or equivalent, or meeting risk-based criteria established by regulatory authority), with hazardous substances or petroleum products allowed to remain in place subject to the implementation of required controls (for example, property use restrictions, activity and use limitations, institutional controls, or engineering controls).”

There were no CREC's noted in the records researched.

f. Adjoining Property Research

In the updated ASTM 1527 -21 standard, the section governing review of prior uses on the subject property specifically enumerates four standard historical resources that must be reviewed if, based on the judgment of the environmental consultant, they are reasonably ascertainable, likely to be useful, and applicable to the subject property: (1) aerial photographs, (2) fire insurance maps, (3) local street directories, and (4) historical topographic maps. ASTM E1527-21 also requires review of these four standard historical resources for properties adjoining the subject property if they have been researched for the subject property, provide coverage of one or more adjoining properties, and are likely to be useful.

Online information regarding underground tanks leaks and closures on adjacent properties were identified in the records researched and further investigated with no underground tanks.

There are no significant other changes to the ASTM 1527-21 Standard that was given final approval by the EPA.

### **1.3 Limitations and Exceptions**

This Phase I ESA does not address whether requirements in addition to AAI have been met in order to qualify for the LLPs under CERCLA of 1980. Nor does it address requirements of any state or local laws, or of any federal laws other than the AAI provisions of the LLPs. There may be other local, state, and/or federal laws which impose environmental assessment obligations that are beyond the scope of the ASTM Standard for a Phase I ESA. There may also be other legal obligations regarding hazardous substances or petroleum products that are not addressed in the

ASTM Standard and that may pose risk of civil and/or criminal sanctions for non-compliance.

There may be environmental conditions or issues at the subject property which are not covered under the scope of the Phase I ESA. Assessment of such non-scope considerations is not required for the AAI defined in the ASTM Standard. Examples of non-scope considerations which may be assessed in addition to the scope of the Phase I ESA include (in no particular order of importance): asbestos-containing materials, biological agents, cultural and historic resources, ecological resources, endangered species, health and safety, indoor air quality, industrial hygiene, lead-based paint, lead in drinking water, mold, radon, regulatory compliance, wetlands, or other non-scope considerations.

No ESA can wholly eliminate uncertainty regarding the potential for RECs in connection with a property. Completion of this ESA was intended to reduce, but not eliminate, uncertainty regarding this potential within the limits of reasonable time and cost.

## **2.0 PRINCIPAL FINDINGS**

### **2.1 Summary of Operations and Environmental Discrepancies**

The subject property has always been vacant land southwest of former Highway 395/15 Freeway.

With the exception of grading in 2021/23 and parking of some vehicles there have been no known activities on the subject property.

#### **Adjoining and Adjacent Properties**

Over the years the free flowing creek to the west was redirected into a concrete lined flood channel, a monitoring station was constructed to the west and a retention basin to control flooding and conserve stormwater to the north.

A towing service started to the south with Laidlaw Transit having an oil leak in an underground tank south in 1989 that was closed.

Beyond the retention basin to the north operates Right Way Toilets which is the site of an underground tank leak of gasoline that was closed in 1989.

Neither of those underground tank leaks is expected to be an issue for the subject property.

**Current Adjoining Property Uses.**

North is a Flood Control/Stormwater Retention Basin.

South is Brothers Towing and Steve's Towing.

West is W. Minthorn and a construction materials rental yard and the monitoring building for the flood control system.

East is a vacant parcel then the 15 Freeway.

There were no problems noted adjoining or adjacent to the subject property discovered through the site inspection or noted in the agency scan which would indicate a potential problem for the subject property.

The closed former underground tank leaks noted were not within 100 feet of the subject property and did not appear to be significant.

**2.2 Summary of Building Materials and Environmental Discrepancies**

There are no buildings on the subject property, only gravel base installed three years ago. As such, there are no friable or non-friable asbestos building materials presumed on the subject property, no lead paint or lead in water and no Pcb containing fluorescent light fixtures.

A summary of the current regulatory status of asbestos precedes further description as non-friable asbestos is still sold in the United States.

**2.2.1 Asbestos**

Background - Asbestos is a natural occurring mineral fiber utilized in a multitude of building material products due to its high tensile strength and excellent fire-resistant properties. The *EPA* has defined asbestos materials as being either *friable* or *non-friable* materials. *Friable* material is defined as being easily broken or crushed by hand pressure (e.g., soft acoustical ceilings or blown-on fireproofing).

*Non-friable* asbestos is generally found in pre-manufactured products that bind the asbestos in an adhesive material, such as roofing felts, floor tile, transite pipe and mastics. This is significant, due to the ability to create a fiber release and cause human exposure during normal activities. The *EPA* currently does not require the removal of asbestos-containing materials that do not present a problem for human exposure. Most *friable* asbestos-containing materials were banned in building materials by 1978.

In October 1995, a new *FED-OSHA* ruling became effective which redefined building materials perceived as asbestos-containing into four classes of work and modified the way in which these asbestos-containing materials are handled.

Under this ruling, "thermal system insulation and sprayed-on or troweled on or otherwise applied surfacing materials" installed before 1980 are considered PACM (presumed asbestos-containing material) unless sampled and identified by a certified individual as to asbestos content. These materials are considered high risk materials for abatement and their removal is classified under Class I removal activities.

Other building materials such as "floor or ceiling tiles, siding, roofing, transite panels [floor sheeting, floor or roof mastics]" are also considered PACM (presumed asbestos-containing material) unless sampled and identified by a certified individual as to asbestos content but are considered low risk materials for abatement and their removal is classified under Class II, III and IV removal and repair and maintenance operations.

Significant under these new regulations is the deletion of the category of "Small-Scale Short-Term Duration" removal activities which regularly allowed Class I, II, III and IV activities to proceed with less regulatory oversight.

In July 1996, *CAL-OSHA* adopted the *FED-OSHA* guidelines as part of California law subject to some of the more stringent requirements pre-existing in California under Prop 65, the Connelly Bill and various other requirements or legislation passed by the California legislature.

Under the *NESHAPS* laws of 1976 and as later amended, asbestos does not have to be removed from a facility until such time as it undergoes major renovations or is demolished. Until that time, the present emphasis by the *EPA* is to recommend repair of any damaged areas and management of the asbestos-containing materials.

Prior to any renovation work being done involving asbestos-containing materials of 260 lineal feet or 160 square feet in area, the local branch of the *EPA* must be notified.

Prior to the demolition of any building or house, mandatory bulk sampling must be accomplished and, if asbestos is present, notification must be made to the local branch of the *EPA* and *Air Quality Management District*.

In California, for the removal of any asbestos-containing materials greater than 0.1% by weight, notifications must also be made to *CAL-OSHA* and a licensed contractor with an asbestos certification is required for any work which exceeds 100 square feet.

## **2.2.1 Asbestos De Minimis Condition**

### **2.2.1.1 Building Materials Presumed to Contain Friable Asbestos**

There are no presumed friable asbestos-containing materials.

**2.2.1.2 Building Materials Presumed to Contain Non-Friable Asbestos**

There are no presumed friable asbestos-containing materials.

**2.2.2 Radon**

APNS 377-190-002, 377-190-003, 377-190-004 Lake Elsinore, CA 92530 is in Radon Zone "2" and no Radon Exposure Issues are expected.

**2.2.3. Lead Paint**

Paint containing more than 0.06% (by weight of dried product) lead was banned for residential use in the United States in 1978 by the U.S. Consumer Product Safety Commission (16 Code of Federal Regulations CFR 1303).

EPA Regulations for maintenance, renovation and handling are contained in 40 CFR 745.225, 40 CFR 745.226, 40 CFR 745.324

There are no buildings and no lead paint.

**2.2.4. PCB Poly Chlorinated Bi Phenyl**

Pcb was outlawed for use in Transformers and Florescent Light Fixture ballasts in 1978. There are no buildings and no Florescent Light Fixture ballasts with Pcb.

There is no Pcb is expected in transformers supplying the subject property based upon Federal Regulations in 1978 requiring removal of Pcb in transformers within 30 feet of occupied areas.

Discussions with Southern California Edison Company found that all of the pad and pole-mounted transformers in the City of Elsinore had been checked. There is no threat of pcb-containing transformers in the area.

**2.2.5. Lead In Water**

A prohibition on lead in plumbing materials has been in effect since 1986. There are no building improvements and no lead water valves.

**2.2.6. Mold**

Mold results from rainwater intrusion and from leaking plumbing pipes.

A mold survey was not conducted.

**2.2.7 Flood Plain**

Panel: 06065C2037G, Effective Date: 8/28/2008

Zone X - Area of minimal flood hazard, usually depicted on FIRMs as above the 500-year flood level.

**2.2.8. Wetlands**

The subject property is not part of any National Wetlands Inventory, and no Wetlands were noted on the subject property during the site inspection.

**2.2.9. Indoor Air Quality - Subjective**

Unsatisfactory indoor air quality was not identified via Olfaction (smell) and there is a Pro Active Management Style regarding sanitation. There were no areas identified in this research of concern for Unsatisfactory Indoor Air Quality from chemicals, gases or regulated materials being used on or off site, present from past activities or building construction

**2.2.10 Underground Tanks**

There is no history of underground tanks on the subject property and no operations requiring underground tanks. No further research was deemed necessary.

**2.2.11 Vapor Intrusion**

Vapor intrusion is a potential human exposure pathway that people may come into contact with hazardous vapors while performing their day-to-day indoor activities.

Vapor intrusion occurs when vapor-forming chemicals migrate from any subsurface source into an overlying building which can occur in ways similar to that of radon gas seeping into homes.

Vapor screening levels were established in 2009 by the EPA in a Regional Screening Levels (RSLs) Table and are part of CA Codes known as CHHSLs and were last updated in 2020 under the CA Health Environmental Risk program HERO, note 3.

The purpose of the RSLs and CHHSLs was to define levels of soil vapor that could cause cancer in long term human exposure to air in confined spaces where carcinogens can become concentrated. The most significant threat is for residents in single and multi-family housing that may be inside for a period of many years.

**2.2.12 Vapor Encroachment Condition**

ASTM E2600 - 22 : ASTM defines the term "Vapor Encroachment Condition" - presence or likely presence of "chemical of concern" vapors in the subsurface of the Target Property caused by the release of vapors from contaminated soil or groundwater or both either on or near the Target Property as identified by the Tier 1 or Tier 2 procedure.

The EPA has defined a potential Vapor Encroachment Zone as current or historical vapor sites within 100 feet. A Tier I Vapor Encroachment Screening was performed which did not identify any sources of regulated vapor within 100 feet (VEZ) of the subject property.

### **3.0 SITE OVERVIEW**

#### **3.1 Location**

The subject property is north of the intersection of W. Collier Avenue and Minthorn Street and abutting both W. Collier Avenue and Minthorn Street on the north and south sides, respectively. The site is located west of Interstate Freeway 16 and north of Central Avenue in the City of Lake Elsinore, County of Riverside, California.

The land use in the general area is commercial and vacant.

#### **3.2 Adjacent Properties**

North is a Flood Control/Stormwater Retention Basin operated by the Riverside County Flood Control and Water Conservation. Next is Rightway Site Services Inc. at 653 W. Minthorn Street, which had a former underground tank leak closed in 1989.

South is Brothers Towing and Steve's Towing then Aggregate Crushing. That site was the Laidlaw site which had an underground tank leak that closed in 1989.

West is W. Minthorn and a construction materials rental yard by Rightway Rentals. Adjoining to the north of Rightway is a monitoring building for the Riverside County Flood Control and Water Conservation.

East is a vacant parcel then the 15 Freeway.

There were no environmentally unsafe emissions or discharges noted from any adjacent properties during the site visit. There was no suspicion of any unsafe emissions or discharges from any of the adjoining or adjacent properties.

#### **3.3 Site Description**

The subject property consists of a total of 2.64-acres of vacant commercial land. The subject property is comprised of three undeveloped lots. The subject property is located between Collier Avenue on the northeast and W. Minthorn Street on the southwest, within a commercial and light industrial area.

The surface is covered with crushed aggregate or gravel.

There is a piece of construction equipment on the northeast next to containers with expected construction equipment inside.

There were no significant discolorations to indicate chemical spills. There were no significant stains. There was no indication of current improper storage or handling of hazardous or corrosive materials on the day of the site visit.

## **4.0 SITE HISTORY AND OPERATIONS**

### **4.1 Building Permit History**

There were no buildings or building permits for the subject property.

There was no indication that the subject property was ever a gas station or had underground tanks.

### **4.2 Operations**

Former Operations - The subject property was an agricultural or vacant parcel of land east of the body of water referred to as Lake Elsinore, then a 2.64 parcel of vacant land between Collier Avenue and W. Minthorn Street west of the 15 Freeway adjoining a Flood Control Basin. The property was rough graded in 2021/3 and covered with a layer of rock base also referred to as aggregate.

#### Current Operations

The subject property remains a 2.64 acre parcel of vacant land covered with a rock base and fenced with locking gate on the Collier Avenue side.

### **4.3 Operational Permits, Manifests and Material Safety Data Sheets**

EPA ID Number - An EPA ID number is used by a facility to dispose of hazardous chemicals over a certain specified quantity. There have been no known regulated materials used on the subject property and no RCRA or CA EPA numbers.

Hazardous Waste Manifests - Hazardous waste manifests are used to transport regulated hazardous wastes for legal disposal. There are no regulated hazardous materials being generated on-site and disposed of and no manifests.

Air Emissions - According to the *South Coast Air Quality Management District* online service named FIND permits are only issued by address and there are no known addresses or permits.

Safety Data Sheets (SDS) - Safety Data Sheets are required for hazardous materials being used on-site. There are no operations on the subject property which require SDS.

## **5.0 ENVIRONMENTAL SETTING**

### **5.1 Regional Physiographic**

The subject property is at an elevation approximately 1,280 feet above sea level, according to the US Geological Survey. The land around the subject property is composed of flat land with a general slope to the southwest towards Lake Elsinore to the west.

The general area of the subject property is located within the Peninsular Ranges geomorphic province of southern California. The Santa Ana Mountains to the west are separated from the Perris Block to the east by the Elsinore Fault zone. The

subsurface features of the alluvial fans are related to erosion of the surrounding hills and mountains, resulting in the deposition of deep layers of alluvial deposits.

### **5.2 Soil Conditions**

Soil conditions can only be accurately assessed with soil borings which are outside the scope of this report. Based upon the research and lack of known operations on the site soil contamination does not appear to be a concern.

### **5.3 Groundwater Conditions**

There were no tests found of the groundwater directly under the subject property. Hydrogeologically, the site is located in the Elsinore Basin which lies in the valley between the Santa Ana Mountains and the low plateau of the Perris area.

Site-specific groundwater information for the subject property was unavailable. According to State Water Resources Control Board's on-line Geotracker database ([www.geotracker.swrcb.ca.gov](http://www.geotracker.swrcb.ca.gov)), the closest LUST site with available online groundwater data was the Raj Ultramar Service Station at 301 N. Main Street, located approximately 0.67-mile southeast of the subject property. This site indicates a reported depth to first groundwater of approximately 22.7 feet below ground surface. The available on-line data also indicates a general north-northwesterly direction of groundwater flow at that site.

The first water is from surface runoff which has percolated through the soil. This water is not used for drinking water.

Groundwater sampling is outside the scope of this investigation.

## **6.0 RESULTS OF INVESTIGATION**

### **6.1 Site Inspection Observations**

The subject property is a flat rough graded parcel covered with crushed aggregate or gravel.

There is a piece of construction equipment on the northeast side with storage containers in the shape of a U and compartments for tools.

There were no current operations, which would be considered a potential problem for the subject property.

The surrounding properties appear to be free of any problems which would be a significant source of migratory contamination to the subject property.

## **6.2 Regulatory Agency Contacts**

### **6.2.1 Elsinore Valley Municipal Water District**

Mr. Julius Ma with the district formerly stated that water supply for the area comes from local deep Elsinore Aquifer groundwater sources during the winter months and is mostly imported from the *MWD* and treated at *Skinner Lake Treatment Plant* during the summer.

This water is chlorinated at the wellhead or treatment plant per State regulation, and it is provided to the water company's customers through a system of pipelines. Mr. Ma stated that all of the water meets State and Federal drinking water standards.

### **6.2.2 California Department of Conservation, Division of Mines and Geology**

The *California Department of Conservation, Division of Mines and Geology*, was contacted regarding the proximity of active earthquake faults. According to Mr. Jerry Tremain, Geologist, the subject property is not part of any special studies zone pursuant to the Alquist-Priolo Earthquake Fault Rupture Hazard Zones Act of 1972, which mandated studies of active faults in California. An active fault zone is described by the *State Mining and Geology Board* as "one which had surface displacement within the Holocene time (about the last 10,000 years)".

### **6.2.3 California Division of Oil and Gas**

A review of the *State of California Division of Oil and Gas Maps* do not indicate that there were ever any oil well surface-drilled into the subject property. (See appendix). There are 3 Geo Thermal Wells for steam within a mile of the subject property. These are of no concern due to the soil and drill muds expected to be non hydrocarbon.

### **6.2.4 Southern California Edison Company**

*Southern California Edison* supplies electrical power to the area. According to Mr. Barry Guimond, Service Planner, there is no *pcb* in any of the transformers owned by *Southern California Edison*. He said that they were never specified for the equipment. A check of the transformers has not revealed any *pcb* in any cooling oils.

### **6.2.5 City of Lake Elsinore Building Department**

There are no building permits for the subject property.

### **6.2.6 Department of Health Services, State Department of Radon**

Mr. David Quinton, Environmental Health Specialist with the *State Department of Radon*, was contacted regarding the presence of radon in the area. He said that the most recent studies done predicted less than 2.4% of homes and less than 0.04% of the schools in the State of California would be over the *EPA*'s action level of four picocuries/liter. He stated that this study was performed in existing homes and that there was no effective methodology of correlating soil samples to houses. Mr. Quinton explained that much is dependent upon the soil under a residence and the type of foundation a house is built upon. Additionally, the standard is based

upon exposure of 18 hours per day for 70 years, which would not correlate to a business exposure. Mr. Quinton said that, with the exception of Madera County in Northern California, the *State of California* has nearly concluded all radon testing in the State and has found that there is little likelihood of a significant radon exposure in California.

Mr. Quinton said that business exposures had not been within the parameters of any of these studies due to the limited time most businesspeople are in one location. He also said that the State does not plan to study businesses based upon the previous studies and that there is no standard for a commercial enterprise being conducted outside of a home.

#### **6.2.7 South Coast Air Quality Management District (SCAQMD)**

FIND was researched regarding permits or violations for the subject property. Permits are by address and there are no addresses or permits for the subject property.

### **6.3 Personal Interviews, Site Records Review**

#### **6.3.1 Personal Interviews**

Mr. Troy Chislock, Property Representative - Mr. Chislock provided access to the subject property and a copy of the 2021 Phase I Environmental Site Assessment.

#### **6.3.2 Site Records Review**

The property is vacant and there were no records regarding regulated materials or operations to review.

### **6.4 Historical Aerial Photograph & Sanborn Fire Insurance Map Review**

A *USGS* topographic map from 1953, and aerial photographs dated 1938, 1953, 1967, 1978, 1986, 1992, 1997, 2002, 2005, 2008, 2014, 2024 from the 2021 Phase I and *Rupp Aerial* formerly in Corona, California and *historicaerials.com* and with the *USGS* were reviewed to establish the history of the property.

The photographs, interviews and quadrangle map were specifically examined for evidence of hazardous materials, as well as on and off-site features that may affect the environmental quality of the property. These features include sumps, pits, ponds, lagoons, aboveground tanks, landfills, outside storage of hazardous materials and general land use.

None of the above anomalies were noted to be *on* or within a problematic distance of the subject property in the photographs reviewed regarding the historical significance of adjacent properties.

*Sanborn Fire Insurance Maps* were not available for this property as it has never been developed and *Sanborn Fire Insurance Maps* were discontinued in 1950. There was a Sanborn Fire Insurance Map for downtown Lake Elsinore first drawn in 1925

**Subject Property : APNS 377-190-002, 377-190-003, 377-190-004 Lake Elsinore, CA 92530**

and updated in 1933. That map covered an area further southwest than the subject property. (see appendix)

1938 - The subject property is land east of a free flowing stream between a road on the north and a road on the south. There are trees to the north. A road exists further east.

1953 - There are no significant changes to the subject or adjoining properties.

1967 - There are no significant changes to the subject or adjoining properties. There is now a building further south and a highway north.

1978 - This aerial photo is provided with streets drawn in to show San Jacinto to the northwest, the property vacant, Interstate 15 being developed and supporting operations adjacent to the freeway.

1986 - There are no significant changes. Further development is in progress and new buildings further south and northeast. The free flowing stream to the west has now been concrete channelized.

1992 - There are no significant changes to the subject or adjoining properties. The retention basin to the north is being developed. Additional buildings are in area.

1997 - There are no significant changes to the subject or adjoining properties.

2002 - There are no significant changes to the subject or adjoining properties.

2005 - There are no significant changes to the subject or adjoining properties.

2014 - There are no significant changes to the subject or adjoining properties.

2019 - There are no significant changes to the subject or adjoining properties.

2021 - There are no significant changes to the subject or adjoining properties.

2024 - There are no significant changes to the subject or adjoining properties.

A copy of the *USGS* map along with relevant aerial photographs are in the Appendix.

## **6.5 Synopsis of Previous Environmental Investigations**

There was a Phase I performed by SoCal Professional Engineers in 2021 based upon ASTM 1527 – 2013. That “...Assessment identified no obvious evidence of Recognized Environmental Conditions (RECs), Controlled RECs or Historic RECs in connection with the subject property...”

No further investigation was recommended.

**6.6 Summary of Government Records Search (Environmental First Search Report)**

NOTE: This government records summary is based, in part, on investigating critical or "border zone" properties near the subject property. The *State of California, Department of Health Services* has defined these sites as being within 2,000 feet (or approximately 0.4 mile) of the subject property. Other sites more distant in proximity may be listed but not considered critical and, therefore, not further investigated. For this report, a search of agency listings of properties within one mile was made. Because of the property address and the width of the subject property, some sites will show as being within .1 or .2 miles of the subject property when they are actually on the subject property.

The subject property is not listed.

The following is a summarized form of the detail provided in the Environmental First Search Report in the Appendix.

**CATEGORY ONE: NPL, SPL, RCRA-CORRACTS, RCRA-TSD, SWLF, SCL, CERCLIS/NVRAP, TRIBAL LANDS**

This category is composed of lists compiled by the *US Environmental Protection Agency* and the *State of California Equivalency* lists. This category includes National Priority List sites, RCRA Corrective Actions by the *EPA* and *USEPA* permitted treatment, storage and disposal facilities within a one-mile radius of the subject property. This includes sites for designation under the Federal SUPERFUND Program, permitted solid waste landfills, incinerator sites or transfer stations and the State Bond Program for sites representing an environmental concern for the discharge of hazardous wastes.

There are no Category One sites listed as being within a one-mile radius of the subject property as of the date of this report.

**CATEGORY TWO: (½ mile) LUST, DEED RSTR, TOXIC PITS, CORTESE**

The sites within this category include sites selected for possible placement on the Federal NPL list or the State risks to human health and the environment. This category also includes leaking underground tank sites from both the *Regional Water Quality Control Board* and the State mandated CORTESE lists of properties with hazardous wastes, sites with DEED restrictions and Toxic Pits Cleanup facilities. Sites within this category are provided in this list within a mile as of the date of this report, with other DEED restrictions and Toxic Pits sites from 1994 and 1995.

There are six Category Two sites listed within one-half mile of the subject property. These sites are closed with the gradient away from the subject property. There are no problems noted. See appendix.

**CATEGORY THREE: (1/4 mile) RCRA VIOL, TRIS, UST/AST**

Sites in this list are the result of RCRA enforcement actions, the Toxic release inventory base and registered aboveground or underground tanks. The databases range from 1994 information for underground tanks to the date of this report for information concerning RCRA actions and registered aboveground storage tanks.

There are no Category Three sites listed within a one-quarter mile radius of the subject property.

**CATEGORY FOUR: (1/8 mile) ERNS, GNRTR, SPILLS**

Sites in this category include ERNS, RCRA and State Spill reports.

ERNS - ERNS is a national database retrieval system of Incident-Notification information as initially reported by any party regarding incidents of reported releases of oil and hazardous substances. The information in this report combines data from the *United States Coast Guard National Response Center* data base with data from the 10 *EPA* Regions. ERNS supports the release notification requirements of Section 103 of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA), as amended; Section 311 of the Clean Water Act; and Sections 300.51 and 300.65 of the National Oil and Hazardous Substances Contingency Plan. This database is current as of the date of this report . There are no ERNS sites listed within a one-eighth mile radius of the subject.

RCRA - Sites which generate regulated hazardous waste above a certain quantity are required to use *EPA* identification numbers and are called RCRA sites. An *EPA* identification number does not indicate a problem with a site, but merely that they use or dispose of a minimum quantity of a hazardous waste. There are nine RCRA sites listed within a one-eighth mile radius of the subject property as of the date of this report. None are close enough to be of concern.

SPILLS - These sites are on the State of California lists as having had spills of regulated hazardous waste as of the date of this report. There are no SPILLS sites listed within a one-eighth mile radius of the subject property.

## **7.0 DISCUSSION OF INVESTIGATION**

Asbestos 1527-05 Section 13.1.5.1 - The site inspection revealed no buildings and no presumed asbestos-containing materials.

Pcb 1527-05 Section 9.4.1.10 - There should not be any pcb in any of the utility transformers on or near the site, according to *Southern California Edison*. There are no fluorescent light fixtures on-site which are suspected of having ballasts that could contain a small quantity of pcb.

Aboveground Storage Tanks 1527-05 - The physical site survey did not evidence the existence of aboveground storage tanks on the subject property.

**Subject Property : APNS 377-190-002, 377-190-003, 377-190-004 Lake Elsinore, CA 92530**

---

Underground Storage Tanks 1527-05 Section 9.4.1.3 9.4.1.4 & .5 - The physical site survey and record survey did not evidence current or former underground storage tanks on the subject property.

Air Emissions - There are no regulated air emissions from the subject property.

Water Supplies 1527-05 Section 9.4.1.9 - Discussions with the *Elsinore Valley Municipal Water District* evidenced a potential water supply to the site which meets all of California's drinking water requirements.

Wastewater 1527-05 Section 9.4.1.10 & 9.4.4.7 - Site observations did not evidence any source for illegal disposal of toxic chemicals into the public sanitary sewer system.

Waste Generation, Storage and Disposal 1527-21 Section 9.4.1.4.4 & .5 & .6 & .7 - The physical site survey did not evidence current or former generation of regulated hazardous waste.

Pesticides, Herbicides - There was no current use of herbicides or pesticides noted beyond the normal residential and commercial insect and pest control.

Radon - Radon comes from the natural breakdown (radioactive decay) of uranium. The *Environmental Protection Agency (EPA)* estimates that the average soil in the United States contains only about one part per million of uranium. Uranium is found in about 150 minerals including granite, phosphate and shale. Granite is a major concern for the presence of radon, as some deposits have been found to contain extremely high levels of uranium. The area of the subject property does not indicate any large deposits of granite material which would be of concern to test for the presence of radon. Phosphorous is an essential ingredient in chemical fertilizers and comes from phosphate rock. There does not appear to ever have been much fertilizer used around the subject property. According to Mr. David Quinton of the *State Department of Radon*, the chance of radon being a hazard in Southern California is less than 1%.

Lead-Based Paint - Specific testing is required to determine if paint or other materials used in the construction of any building contains significant levels of lead. These tests are not within the scope of work for this report and no investigation for lead content was, or will be, performed unless agreed to by the property owner as an additional service, incurring additional costs. Buildings constructed after 1980 would not be expected to have lead in the paint.

Regulatory Actions - No evidence of regulatory actions on the subject property was found in any of the records checked.

Known Site Problems - There are no known site problems.

Regional or Adjacent Problems - There was no direct evidence of regional or adjacent problems found in the records checked that indicated a conclusive impact on the subject property during any of the time periods reviewed.

## **8.0 CONCLUSIONS**

### **8.1 Areas of No Apparent Concern**

There is no concern for migration of contaminants from off-site sources to the subject property. There is no concern for contamination on the subject property.

### **8.2 Areas of Further Concern**

There are no areas of further concern.

## **9.0 RECOMMENDATIONS**

### **9.1 Areas of No Action**

There are no areas of action recommended.

### **9.2 Further Investigation**

In this Assessors Opinion, there is no need for further investigation.

### **9.3 Performance Statement 1527-21 12.8.1-** We have performed a Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM Practice E1527 - 21 of APNS 377-190-002, 377-190-003, 377-190-004 Lake Elsinore, CA 92530. Any exceptions to, or deletions from, this practice are described in Section 1 of this report. This assessment has revealed no evidence of a REC Recognized Environmental Concerns or Historical Recognized Environmental Concern (HREC).

## **10.0 LIMITATIONS**

This report is intended to satisfy the requirements of a Phase I Environmental Site Audit as outlined in the ASTM 1527-21 & EPA "All Appropriate Inquiry" November 2006 standards. These are intended to define the scope of due diligence necessary in a real estate transaction to provide for the "innocent buyer's defense" under the SARA amendments to CERCLA.

The findings set forth in this Phase I Environmental Site Assessment are strictly limited in time and scope to the date of evaluation(s). Government records searched are limited to the accuracy of the agency prepared lists. The conclusions presented in the report are based solely on the services described therein and not on scientific tasks or procedures beyond the scope of the agreed upon Phase I Environmental Site Assessment. It is hereby acknowledged that, within the scope of this survey, no level of assessment can ensure the real property is completely free of chemicals or toxic substances.

This public records search was conducted with available Federal, State, County and City agency departments, according to recognized procedures and current availability of records. Conclusions resulting from these searches are solely a result of the same. *S & S*

**Subject Property : APNS 377-190-002, 377-190-003, 377-190-004 Lake Elsinore, CA 92530**

***Commercial Environmental Services, Inc.*** assumes no responsibility for events that are not part of these public records.

**S&S Commercial Environmental Services, Inc.**



**Stephen A Quartararo, CEO  
Environmental Professional  
Title 40, Code of Federal  
Regulations CFR Part 312.22**

## 11.0 REFERENCES

### 11.1 Published References

- 11.1.1 Environmental First Search Report – October 2024
- 11.1.2 Aerial Photograph Review -*Rupp Aerial*, USGS <http://earth.google.com/>  
<http://www.terraserverusa.com/> <Http://historicalaerial.com>
- 11.1.3 Topographic Maps - *USGS*
- 11.1.4 *DOG* Maps/1992 Munger Map Book Division of Oil & Gas W-106  
<http://www.conservation.ca.gov/dog/Pages/Index.aspx>
- 11.1.5 Alquist-Priolo Earthquake Fault Rupture Hazard Special Study Zones
- 11.1.6 California Code of Regulations Title 22 Chapter 30, Regulations for Hazardous Waste Transport and Disposal, *California Highway Patrol*
- 11.1.7 FEDERAL, 29 CFR, Part 1910.120; 40 CFR Part 761, DOT; 49 CFR Parts 172.516; Toxic Substance Control Act
- 11.1.8 <http://www.lapl.org/> Los Angeles Public Library Sanborn Fire Insurance Map Collection
- 11.1.9 CAL EPA Envirostor With Links To Regional Water Quality Control Board <http://www.envirostor.dtsc.ca.gov/public/>
- 11.1.10 [http://www.epa.gov/sweroosp/bf/aai/aaifinal\\_factsheet.htm](http://www.epa.gov/sweroosp/bf/aai/aaifinal_factsheet.htm)  
All Appropriate Inquiries Final Rule

#### WHAT IS "ALL APPROPRIATE INQUIRIES?"

"All appropriate inquiries" is the process of evaluating a property's environmental conditions and assessing potential liability for any contamination.

#### WHY IS EPA ESTABLISHING STANDARDS FOR CONDUCTING ALL APPROPRIATE INQUIRIES?

The 2002 Brownfields Amendments to CERCLA require EPA to promulgate regulations establishing standards and practices for conducting all appropriate inquiries.

### 11.1.11 Internet Research <http://www.google.com>

### 11.2 Record of Personal Communications


11.2.1 <i>Elsinore Valley Municipal Water District</i>	October 2024
Mr. Julius Ma	(909)674-3146
11.2.2 <i>California Division of Mines and Geology</i>	October 2024
Mr. Jerry Tremain, Geologist	(213)620-3560
11.2.3 <i>California Division of Oil and Gas</i>	October 2024
Cerritos Office	(714)816-6847

<b>11.2 Record of Personal Communications (cont.)</b>	
11.2.4 <i>Southern California Edison Company</i> Mr. Barry Guimond, Service Planner	October 2024 (310)481-8801
11.2.5 <i>South Coast Air Quality Management District</i> <a href="http://www.aqmd.gov/webappl/fim/default.htm">http://www.aqmd.gov/webappl/fim/default.htm</a>	November 2022 (909)396-2900
11.2.6 <i>State Department of Radon</i> Mr. David Quinton, Environmental Health Specialist	February 1999 (916)324-2308
11.2.7 <i>Lake Elsinore Building Department</i>	October 2024 (951)674-3124

## **12.0 APPENDIX**


- 12.1 Site Location Map**
- 12.2 Historical Aerial Photographs**
- 12.3 USGS Topographic Map of Site**
- 12.4 Environmental Features**
- 12.5 Building Permits**
- 12.6 DTSC Envirostor Map and Geotracker**
- 12.7 DOGGR Section**
- 12.8 Letter from Magnetek**
- 12.9 Certification**
- 12.10 Resume**
- 12.11 Environmental First Search Report**

## **12.1 Site Location Map**

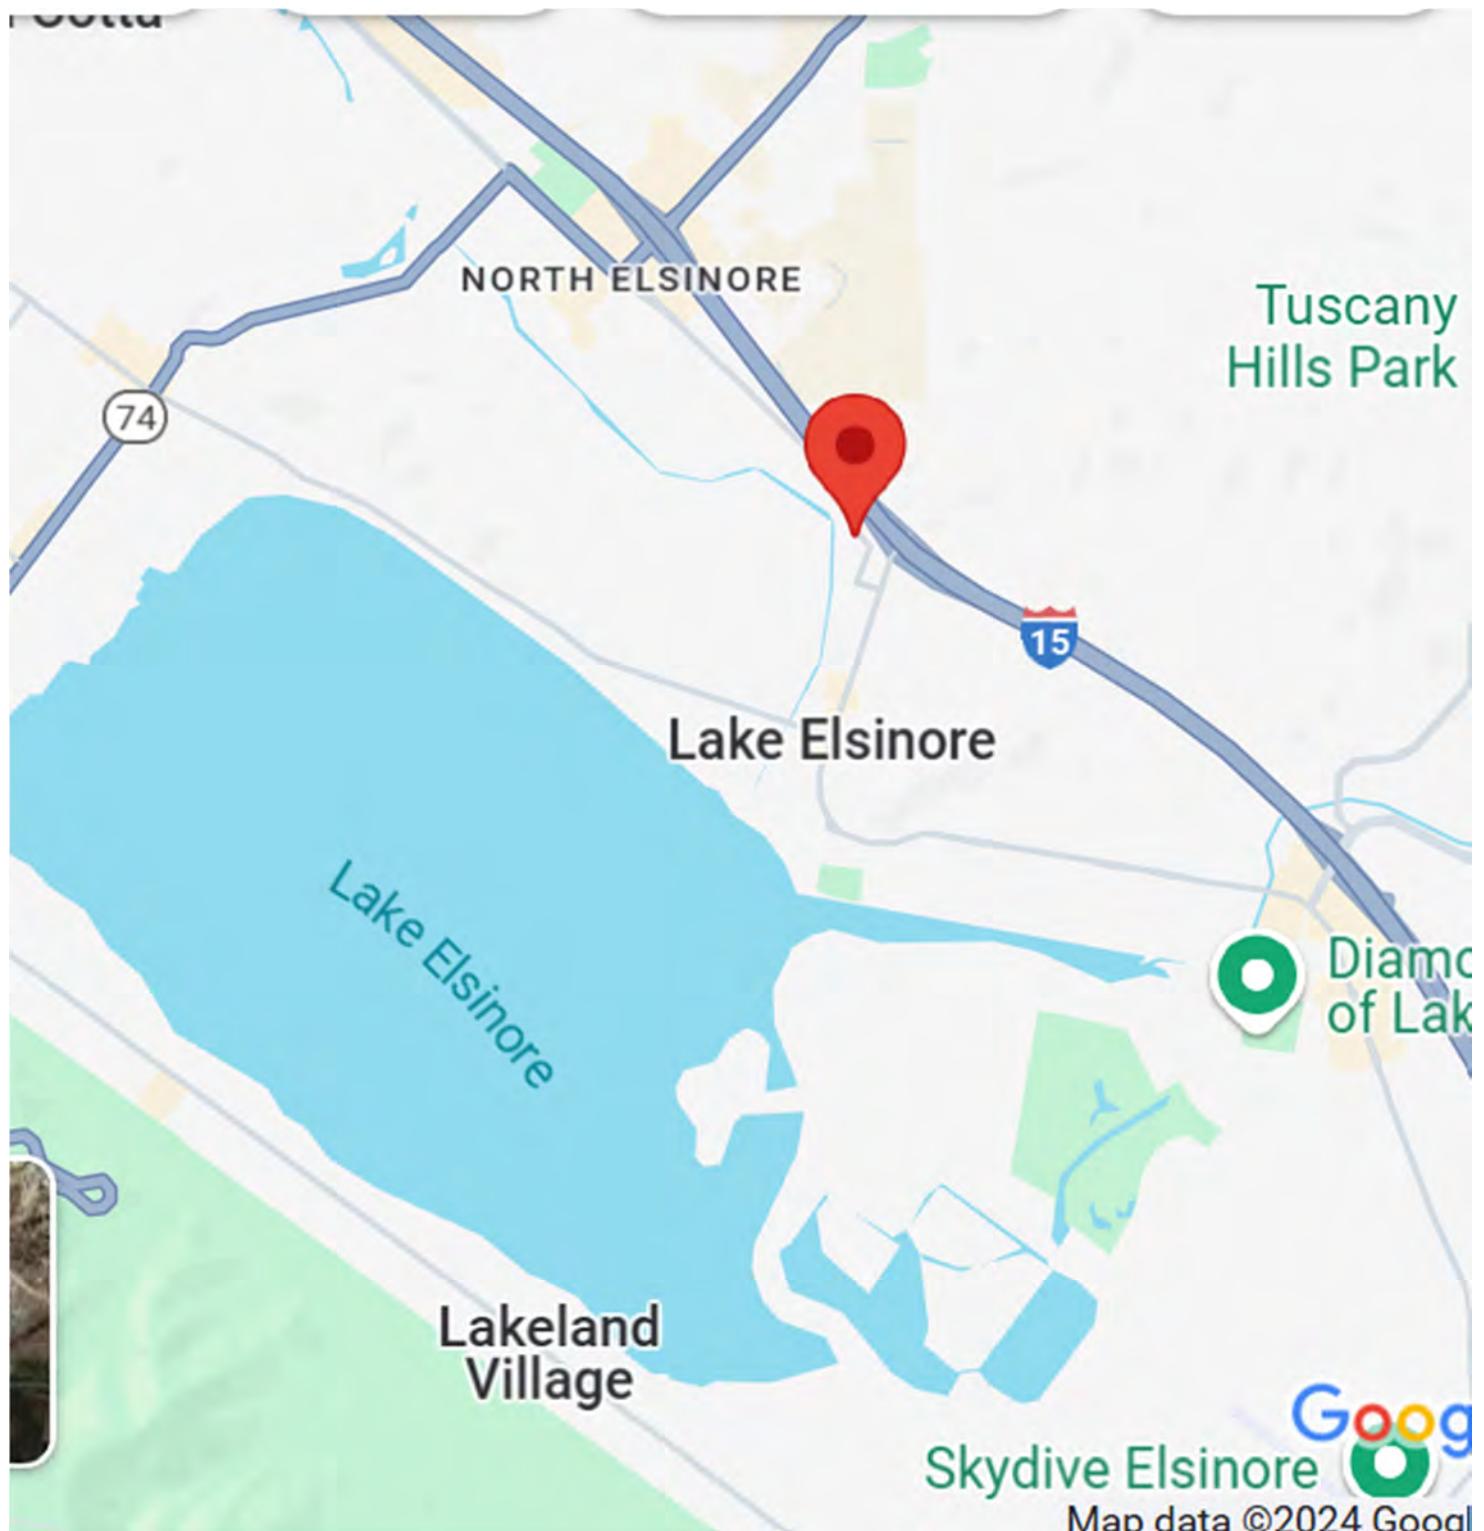

## **12.2 Historical Aerial Photographs**

Sanborn Map 1933

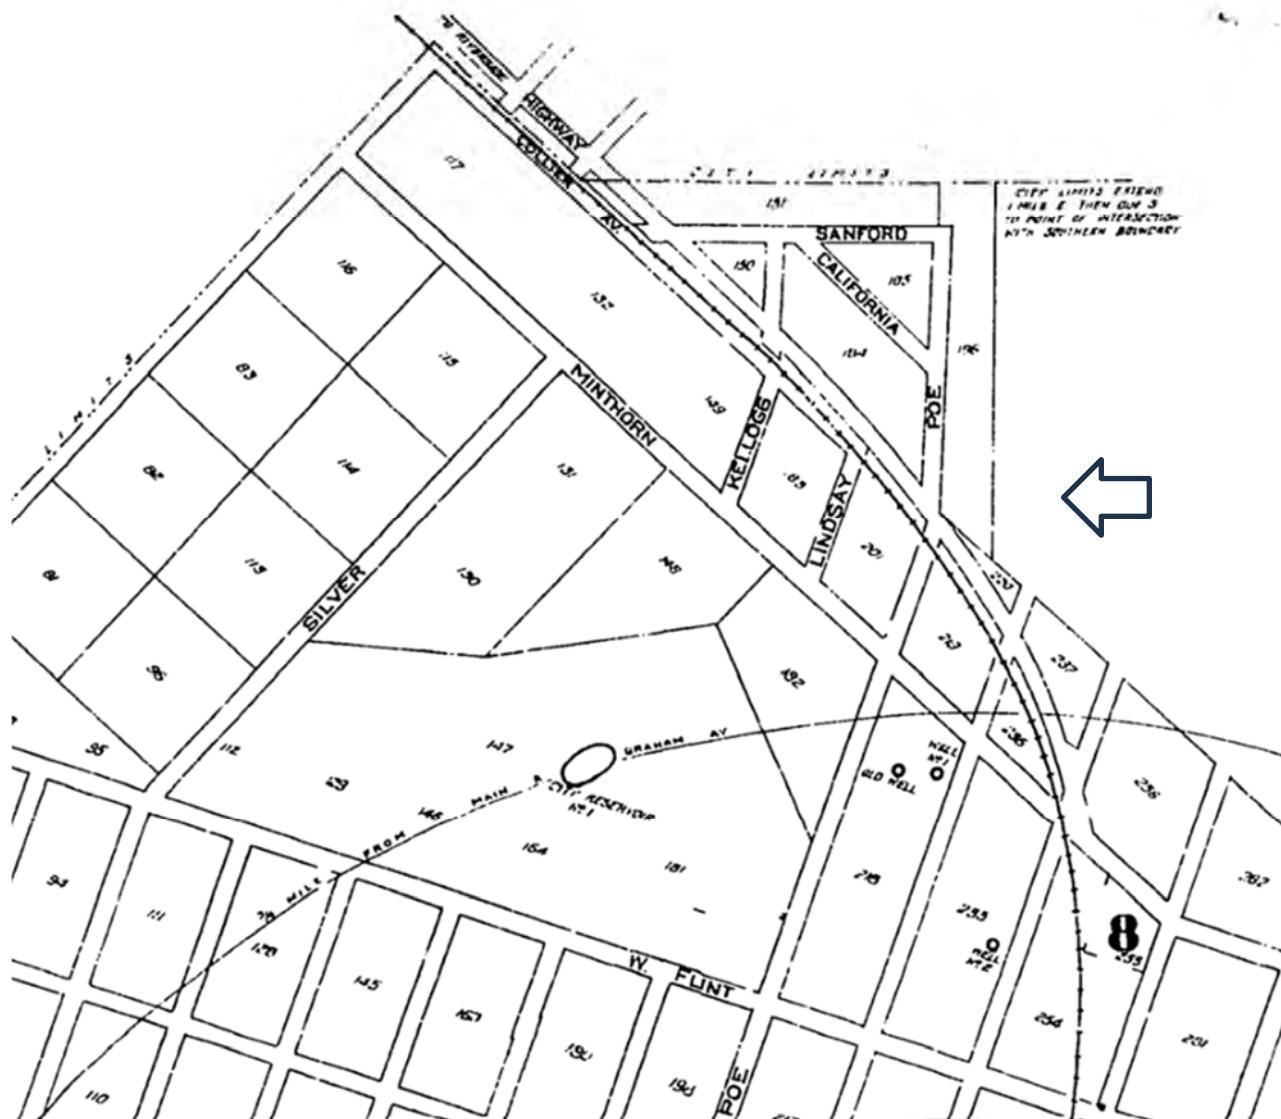




1938



1953

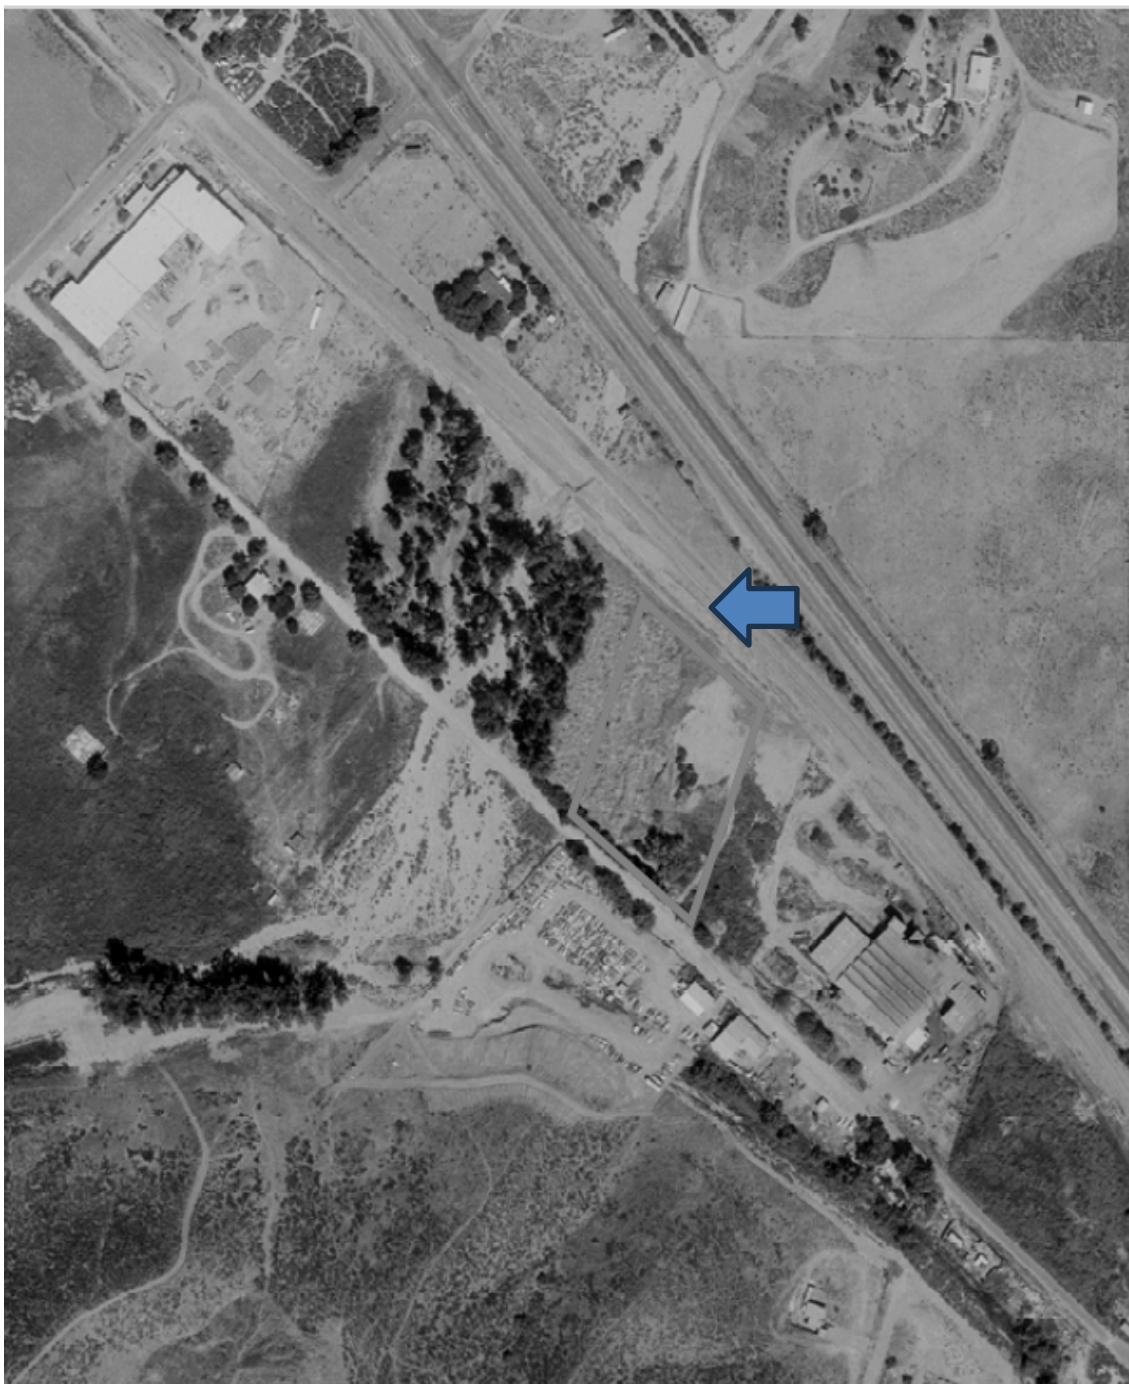

**1967**



1978




1986



1992




1997

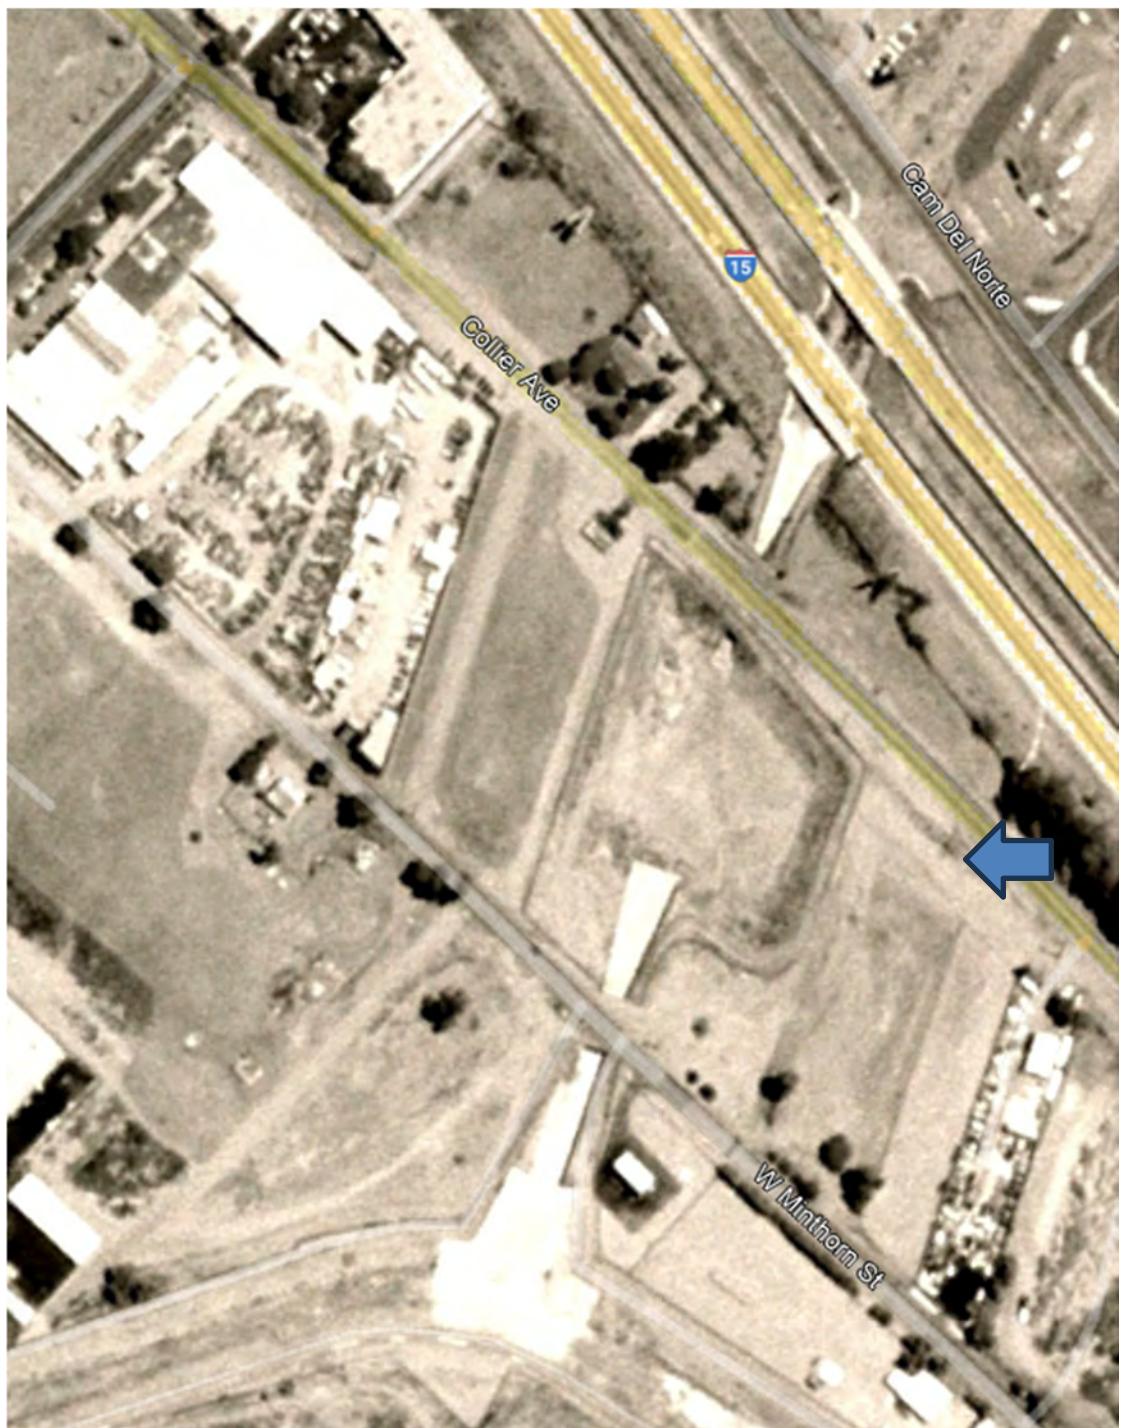

2002



2005

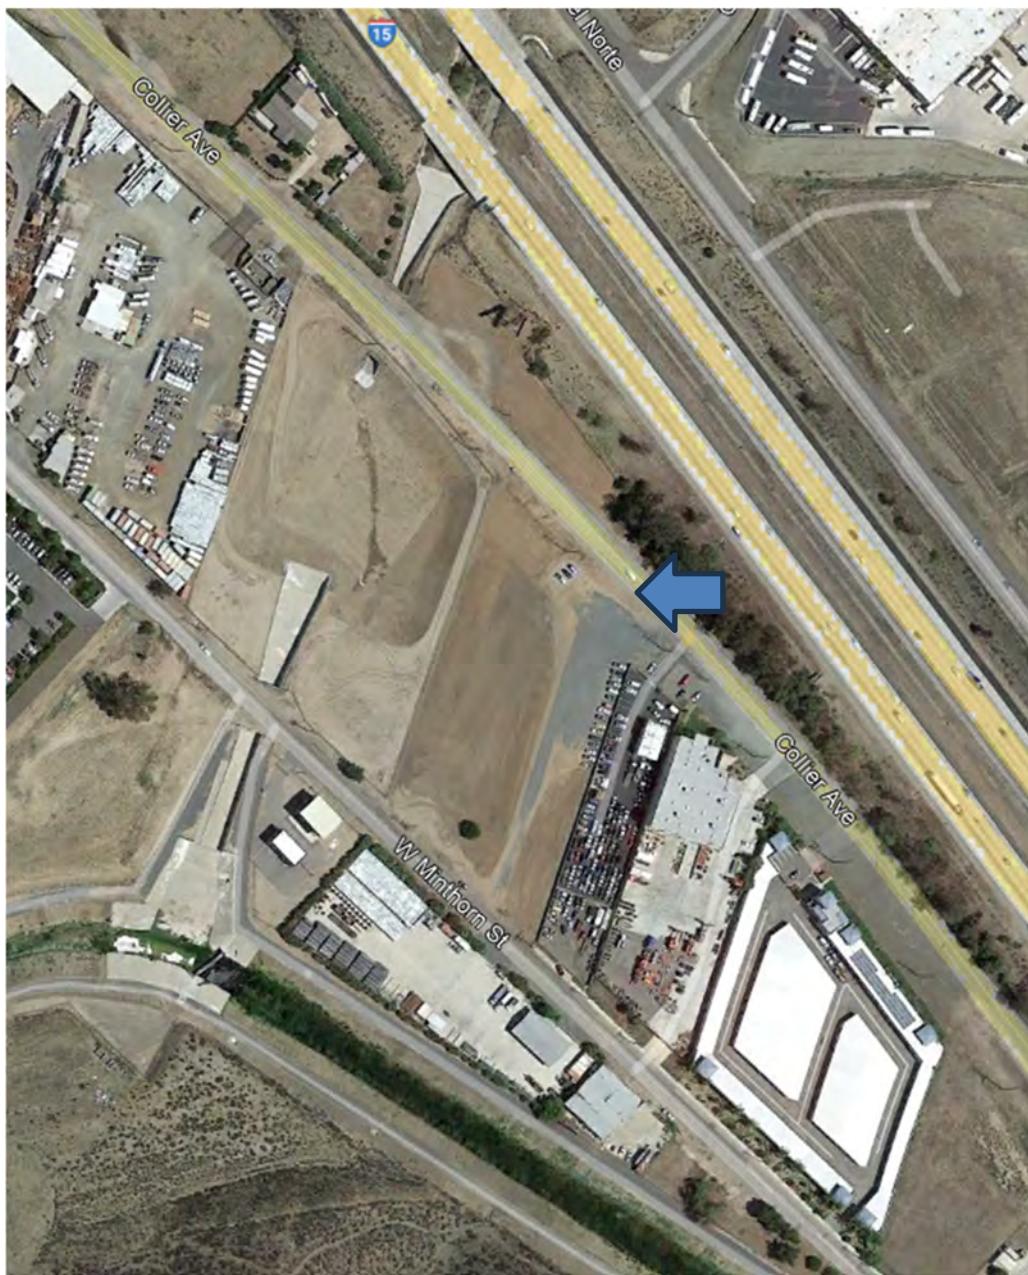

2014



**2019 East To West**




2021



2024

### **12.3 USGS Topographic Map of Site**

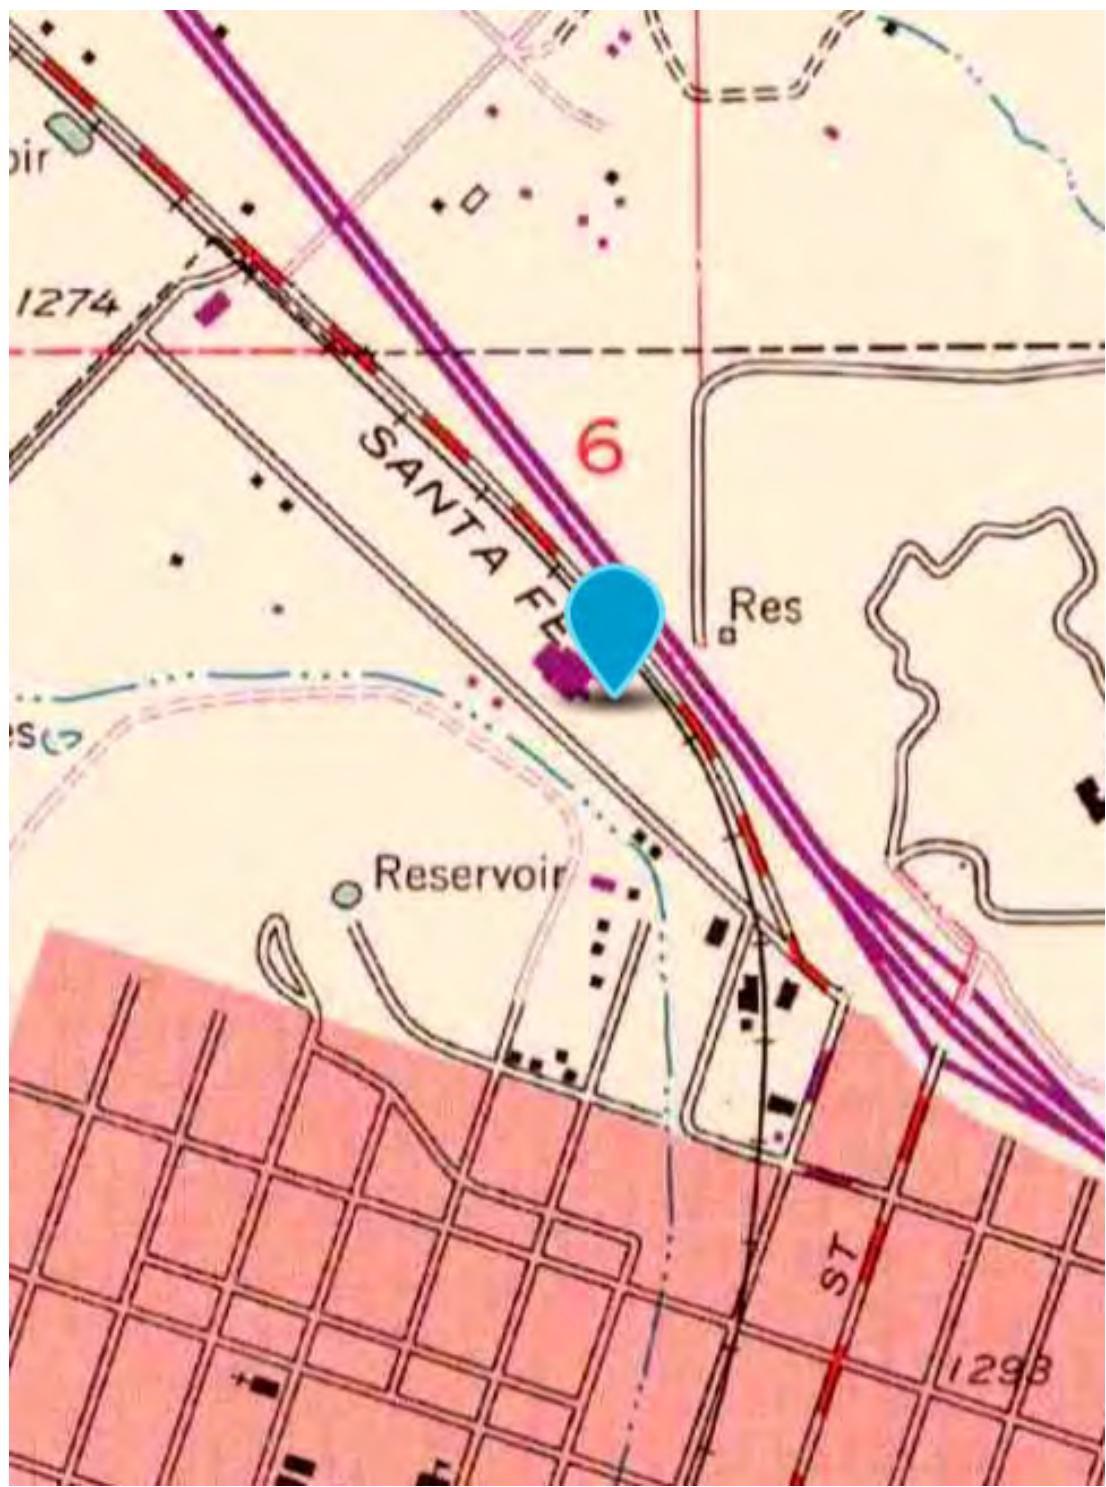

7.5 Minute Topographic Map Section Elsinore

## **12.4 Environmental Features**




**Construction Equipment and Container Storage**




**East To West**




February 2023

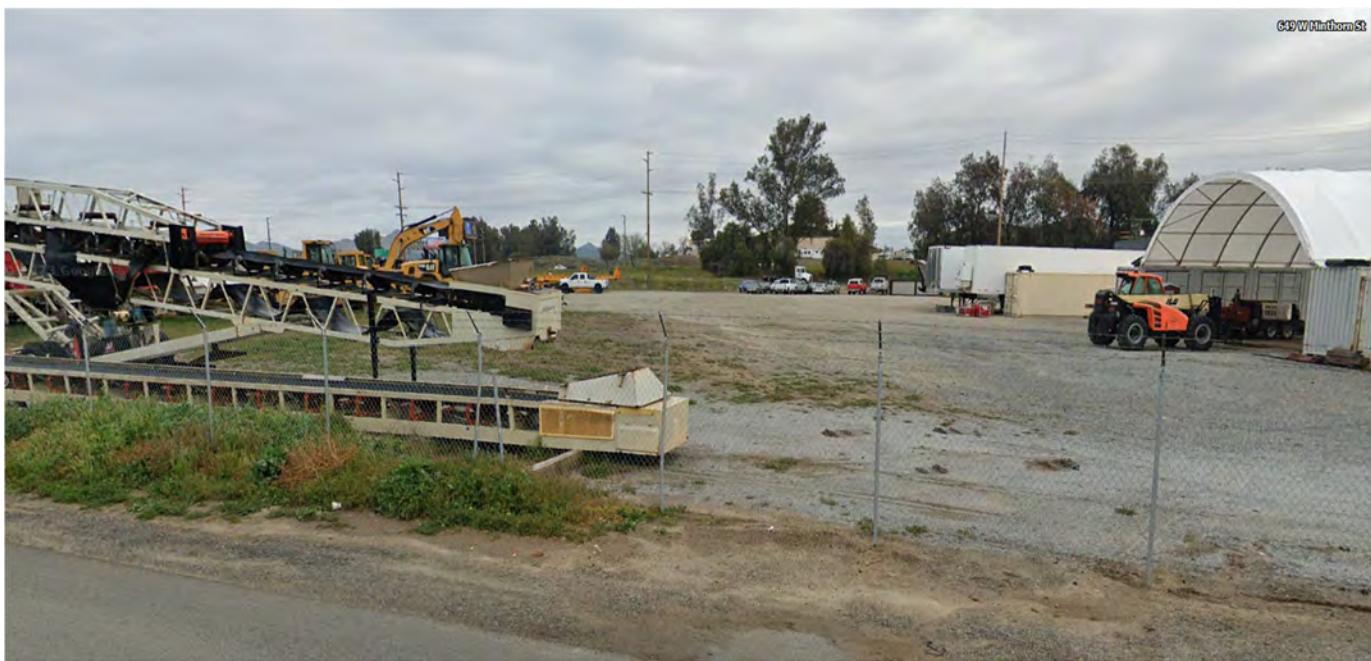

February 2023

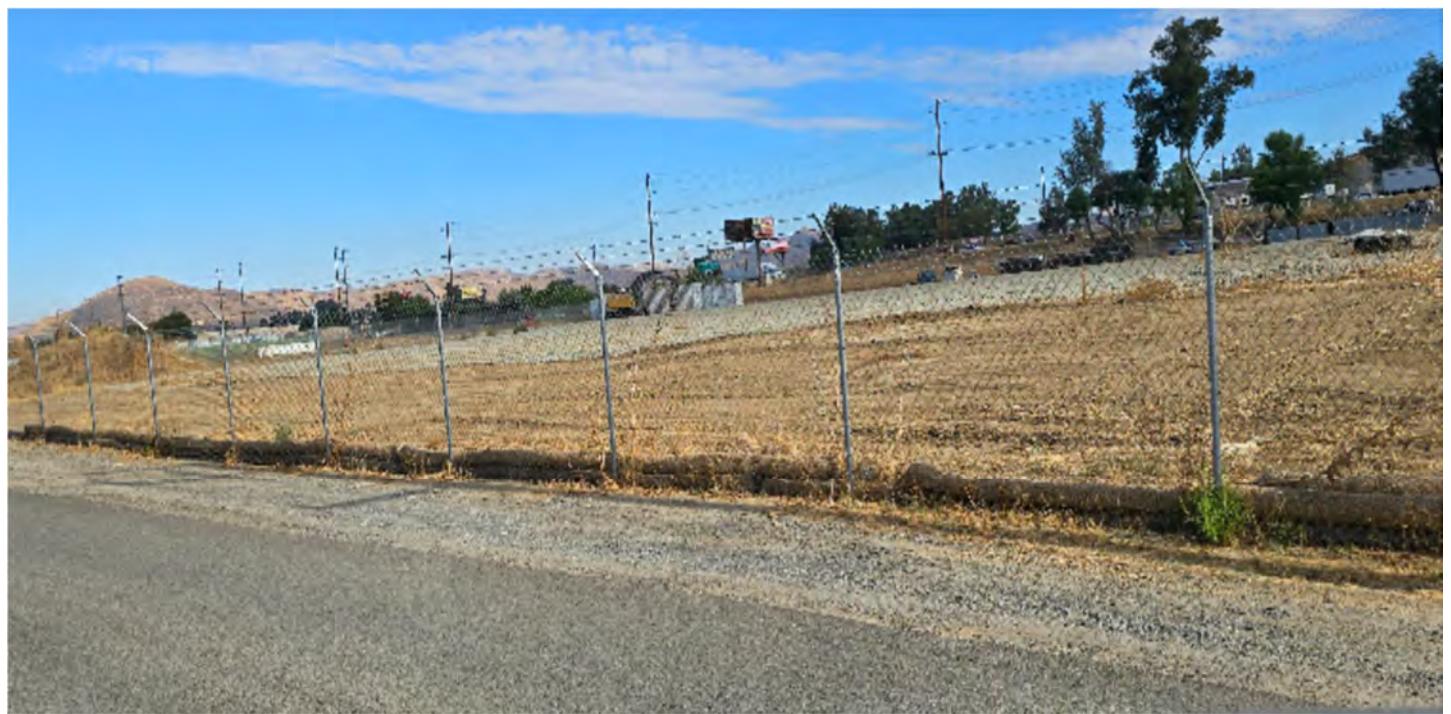

**East**

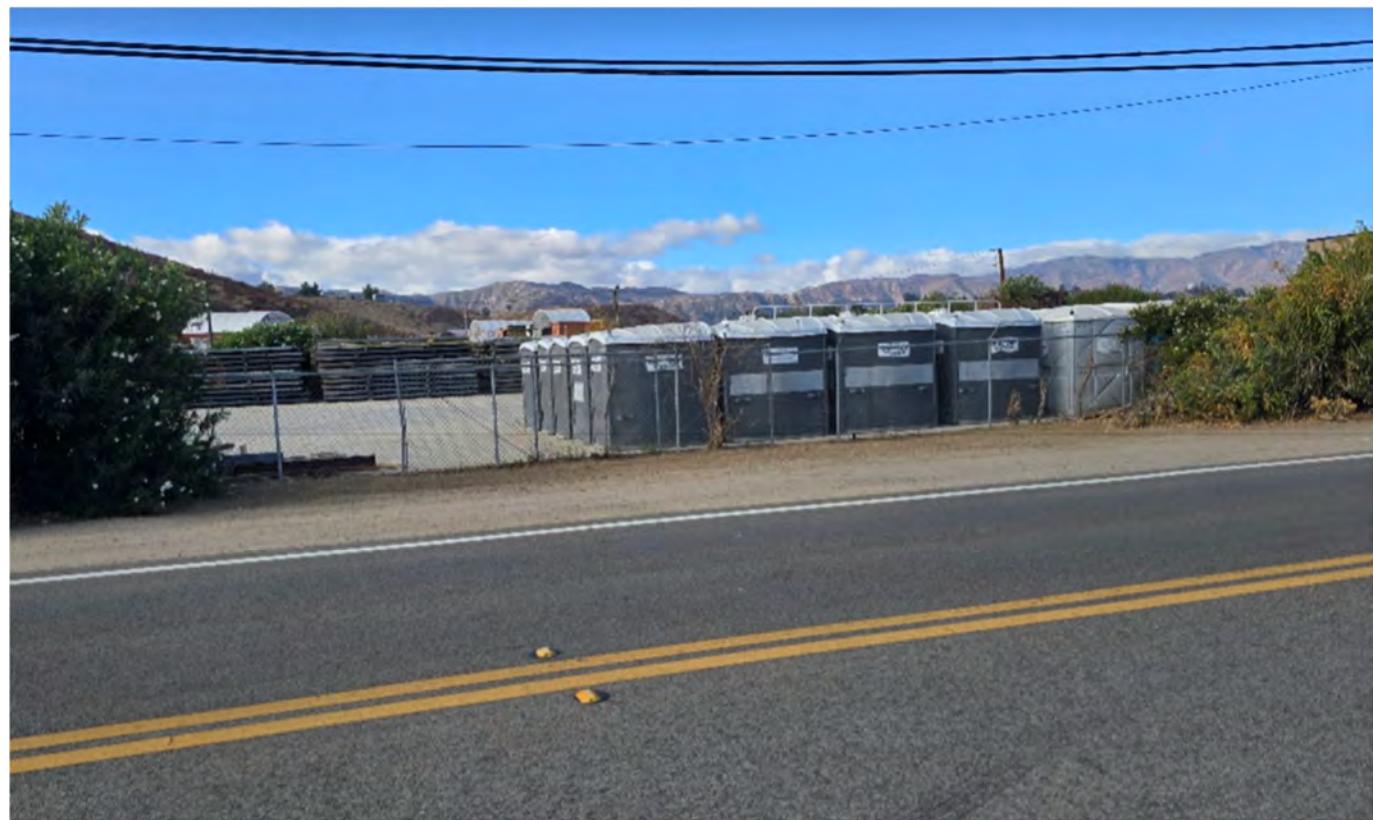

**West**



**North Flood Control**



**South Towing Services**

## **12.5 Building Permits**

THIS MAP WAS PREPARED FOR ASSESSMENT PURPOSES ONLY. NO LIABILITY IS ASSUMED FOR THE ACCURACY OF THE DATA SHOWN. ASSESSOR'S PARCEL MAY NOT COMPLY WITH LOCAL LOT-SPLIT OR BUILDING SITE ORDINANCES.


SEC. 6 T. 6S., R. 4W  
CITY OF LAKE ELSINORE

T.R.A. 005-017

377-19

17-9  
17-10

JUN 11 2005

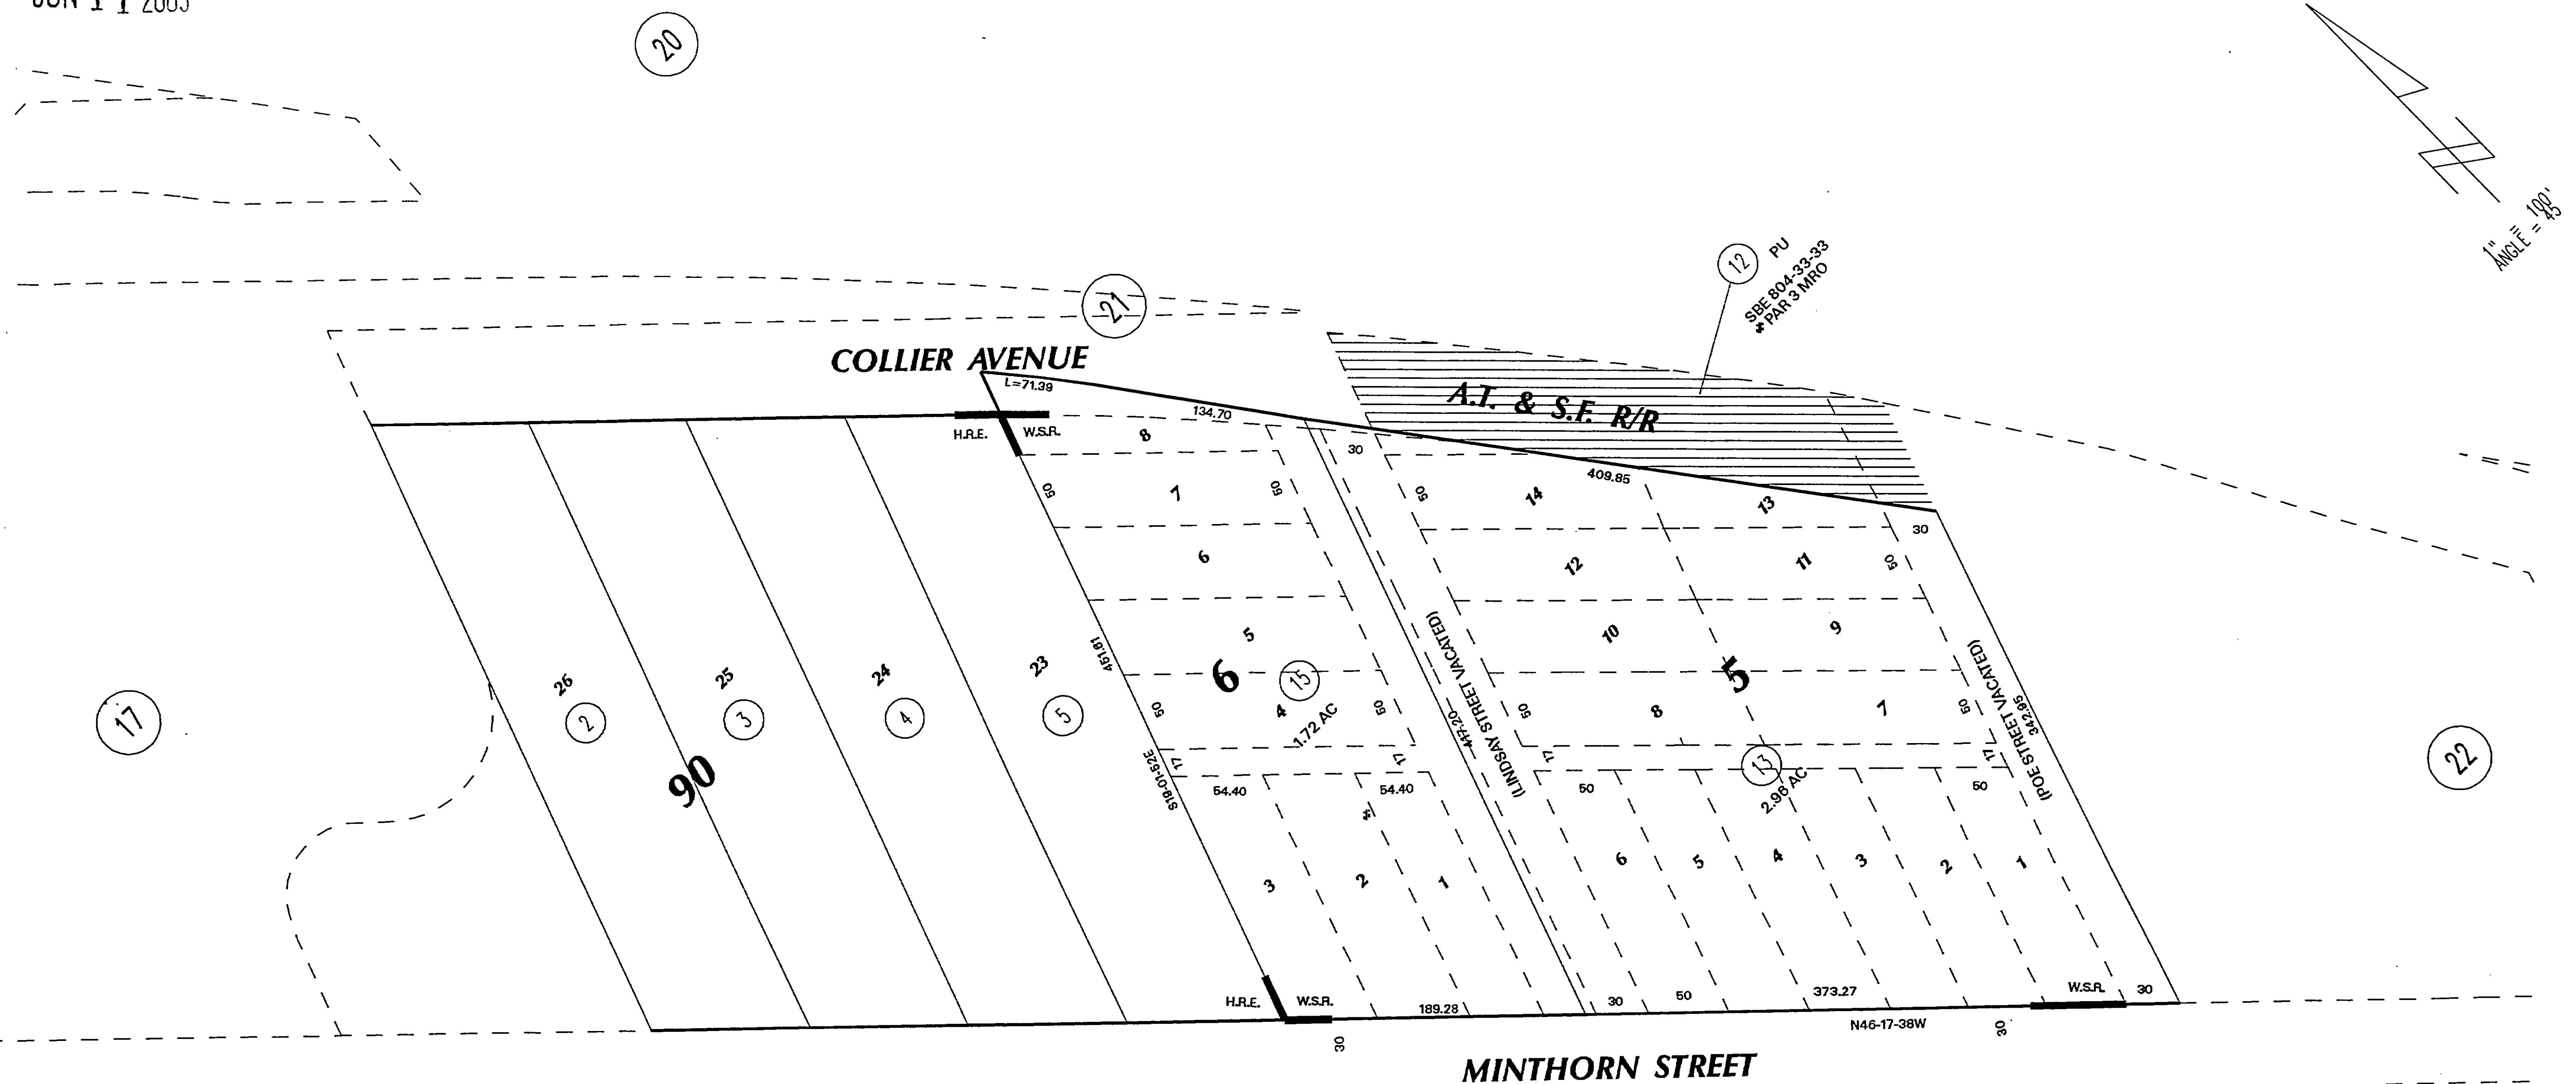

ASSESSOR'S MAP BK377 PG.19  
Riverside County, Calif.

8m8

MB 8/378 S.D. HEALD'S RESUB. ELSINORE  
MB 10/492 S.D. WALL & STARBIRD'S RESUB.

Jun 2005

DATE	OLD NUMBER	NEW NUMBER
02/79	908	9
05/82	7	10
05/82	9	11
04/86	ADD/ASMNT	12
10/04	10	13
10/04	ADD/ASMNT	14
10/04	6,14	15
06/05	11	ST

# Property Profile

## Property Data

**Site Address:**  
, CA  
**Mail Address:**  
43 GOLF VIEW DR  
TRABUCO CANYON, CA 92679-3802  
**Primary Owner (s):**  
COLLIER COMMERCIAL PROPERTIES

**APN:** 377-190-002  
**Census Tract:**  
**Housing Tract Number:**  
**Legal Block/Lot:** LOT:26 BLOCK:90  
**Legal Description:** LOT 26 BLK 90 MB 008/378 SD HEALDS RESUB  
**Subdivision:** HEALDS RESUB  
**Property County** RIVERSIDE COUNTY  
**Vesting:**

## Property Characteristics

**Bedrooms:** 0  
**Baths (F/H):** 0 / 0  
**Total Rooms:** 0  
**Zoning:** M1  
**Number of Stories:**

**Year Built:**  
**Use Code:** COMMERCIAL LOT  
**Number of Units:**  
**Building Style:**

**SQFT:**  
**Lot Size:** 38333  
**Garage:** ()  
**Coords:** 33.681922, -117.330491

## Sale & Loan Information

**Transfer Date:** 5/28/2021  
**Transfer Value:** \$975,000.00  
**First Loan Amt:** \$0.00

**Seller:** MILLER JOHNNY AL  
**Cost/Sq Feet:** \$0.00  
**Lender:**

**Document:** 2021.328778  
**Title Company:** TICOR TITLE COMPANY

## Assessed & Tax Information

**Assessed Value:** \$350,198.00  
**Land Value:** \$350,198.00  
**Improvement Value:** \$0.00

**Percent Improvement:** %  
**Tax Amount:** \$3,637.52  
**Delinquent Year:**

**Homeowner Exemption:**  
**Tax Rate Area:** 005-017  
**Tax Year:** 2024

# Property History

, CA

APN: 377-190-002

## Item 1 - Transaction Date: 5/28/2021

### SALE

**Buyer/Borrower:** Collier Commercial Properties Llc

**Seller:** Miller Johnny Al

**Title Company** TICOR TITLE COMPANY

**Transaction Value** \$975,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2021.328778

[View Doc](#)

## Item 2 - Transaction Date: 5/28/2021

### SALE

**Buyer/Borrower:** Miller Johnny Al

**Seller:** Miller Spring

**Title Company** TICOR TITLE COMPANY

**Transaction Value** \$0.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2021.328777

[View Doc](#)

## Item 3 - Transaction Date: 8/21/2012

### SALE

**Buyer/Borrower:** Miller Johnny A

**Seller:** First Citizens Bk & Trust Co

**Title Company** CHICAGO TITLE CO.

**Transaction Value** \$130,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2012.397216

[View Doc](#)

## Item 4 - Transaction Date: 7/8/2010

### ASSIGNMENT

**Buyer/Borrower:**

**Seller:**

**Title Company**

**Transaction Value** \$0.00

**Transaction Type:** ASSIGNMENT

**Deed Type:** Assignment

**Document Number:** 2010.321287

[View Doc](#)

## Item 5 - Transaction Date: 6/23/2010

### SALE

**Buyer/Borrower:** First Citizens Bk & Trust

**Seller:** Fidelity Natl Default

**Title Company** FIDELITY NATIONAL TITLE

**Transaction Value** \$422,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2010.288280

[View Doc](#)

## Item 6 - Transaction Date: 5/27/2010

### FORECLOSURE

**Buyer/Borrower:**

**Seller:**

**Title Company**

**Transaction Value** \$0.00

**Transaction Type:** FORECLOSURE

**Deed Type:** Notice Of Trustee Sale

**Document Number:** 2010.245759

[View Doc](#)



Notice Of Trustee Sale

## Item 7 - Transaction Date: 2/25/2010

### FORECLOSURE

**Buyer/Borrower:**

**Seller:**

**Title Company**

**Transaction Value** \$0.00

**Transaction Type:** FORECLOSURE

**Deed Type:** Notice Of Default

**Document Number:** 2010.86149

[View Doc](#)



Notice Of Default

## Item 8 - Transaction Date: 11/10/2008

### RELEASE

Buyer/Borrower:

Seller:

Title Company

Transaction Value \$0.00

Transaction Type: RELEASE

Deed Type: SUBST OF TRUSTEE / RECONVEYANCE

Document Number: 2008.595348

[View Doc](#)

## Item 9 - Transaction Date: 9/26/2008

### REFINANCE

Buyer/Borrower: Elsinore West Llc

Seller:

Title Company

Transaction Value \$550,000.00

Transaction Type: FINANCE

Deed Type: Trust Deed/Mortgage

Document Number: 2008.527044

[View Doc](#)

### MORTGAGE RECORD

Lender: TEMECULA VALLEY BANK NA

Loan Type: CONVENTIONAL

Interest Rate Type: VAR

Finance Type: REFINANCE

## Item 10 - Transaction Date: 10/18/2007

### RELEASE

Buyer/Borrower:

Seller:

Title Company

Transaction Value \$0.00

Transaction Type: RELEASE

Deed Type: SUBST OF TRUSTEE / RECONVEYANCE

Document Number: 2007.644217

[View Doc](#)

## Item 11 - Transaction Date: 8/20/2007

### REFINANCE

Buyer/Borrower: Elsinore West Llc

Seller:

Title Company

Transaction Value \$550,000.00

Transaction Type: FINANCE

Deed Type: Trust Deed/Mortgage

Document Number: 2007.535687

[View Doc](#)

### MORTGAGE RECORD

Lender: TEMECULA VALLEY BANK NA

Loan Type: CONVENTIONAL

Interest Rate Type: VAR

Finance Type: REFINANCE

## Item 12 - Transaction Date: 7/17/2007

### SALE

**Buyer/Borrower:** Elsinore West Llc

**Seller:** Quirk Family Trust

**Title Company**

**Transaction Value** \$1,550,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2007.463006

[View Doc](#)

## Item 13 - Transaction Date: 7/3/2006

### SALE

**Buyer/Borrower:** Elsinore West Llc

**Seller:** Elsinore Vly Municipal Water D

**Title Company**

**Transaction Value** \$0.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2006.481146

[View Doc](#)

## Item 14 - Transaction Date: 1/13/2006

### REFINANCE

**Buyer/Borrower:** Elsinore West Llc

**Seller:**

**Title Company**

**Transaction Value** \$150,000.00

**Transaction Type:** FINANCE

**Deed Type:** Trust Deed/Mortgage

**Document Number:** 2006.33274

[View Doc](#)

### MORTGAGE RECORD

**Lender:** TEMECULA VALLEY BANK NA

**Loan Type:** CONVENTIONAL

**Interest Rate Type:** VAR

**Finance Type:** REFINANCE

## Item 15 - Transaction Date: 10/31/2005

### SALE

**Buyer/Borrower:** Elsinore West Llc

**Seller:** Quirk Family Trust

**Title Company**

**Transaction Value** \$1,550,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2005.901205

[View Doc](#)

## Item 16 - Transaction Date: 9/30/2005

### SALE

**Buyer/Borrower:** Quirk Family Trust  
**Seller:** Laifornara,Chris  
**Title Company:** FIDELITY NATIONAL TITLE  
**Transaction Value:** \$1,000,000.00  
**Transaction Type:** SALE  
**Deed Type:** Deed Transfer  
**Document Number:** 2005.810903

[View Doc](#)

## Item 17 - Transaction Date: 9/30/2005

### SALE

**Buyer/Borrower:** Laifornara,Chris  
**Seller:** Lake Elsinore Collier Indl  
**Title Company:** FIDELITY NATIONAL TITLE  
**Transaction Value:** \$0.00  
**Transaction Type:** SALE  
**Deed Type:** Deed Transfer  
**Document Number:** 2005.810902

[View Doc](#)

## Item 18 - Transaction Date: 8/3/2005

### SALE

**Buyer/Borrower:** Lake Elsinore Collier Indl Co  
**Seller:** Laifornara,Chris  
**Title Company:**  
**Transaction Value:** \$0.00  
**Transaction Type:** SALE  
**Deed Type:** Deed Transfer  
**Document Number:** 2005.625252

[View Doc](#)

## Item 19 - Transaction Date: 11/30/2001

### SALE

**Buyer/Borrower:** Morris,Gary & Elena  
**Seller:** Rios,Martin & Christine  
**Title Company:** STEWART TITLE  
**Transaction Value:** \$125,000.00  
**Transaction Type:** SALE  
**Deed Type:** Deed Transfer  
**Document Number:** 2001.591223

[View Doc](#)

## Item 20 - Transaction Date: 8/11/1997

### SALE

**Buyer/Borrower:** Eastn Muni Wtr Dist

**Seller:** Rios,Martin Etal

**Title Company** UNKNOWN

**Transaction Value** \$0.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 1997.283899

[View Doc](#)

## Item 21 - Transaction Date: 1/24/1996

### SALE

**Buyer/Borrower:** Rios,Martin & Christine

**Seller:** Hardcastle,Jack E & Corinne M

**Title Company**

**Transaction Value** \$22,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 1996.27331

[View Doc](#)

# Property Profile

## Property Data

**Site Address:**  
, CA  
**Mail Address:**  
43 GOLF VIEW DR  
TRABUCO CANYON, CA 92679-3802  
**Primary Owner (s):**  
COLLIER COMMERCIAL PROPERTIES

**APN:** 377-190-003  
**Census Tract:**  
**Housing Tract Number:**  
**Legal Block/Lot:** LOT:25 BLOCK:90  
**Legal Description:** LOT 25 BLK 90 MB 008/378 SD HEALDS RESUB  
**Subdivision:** HEALDS RESUB  
**Property County** RIVERSIDE COUNTY  
**Vesting:**

## Property Characteristics

**Bedrooms:** 0  
**Baths (F/H):** 0 / 0  
**Total Rooms:** 0  
**Zoning:** M1  
**Number of Stories:**

**Year Built:**  
**Use Code:** COMMERCIAL LOT  
**Number of Units:**  
**Building Style:**

**SQFT:**  
**Lot Size:** 38333  
**Garage:** ()  
**Coords:** 33.681735, -117.330251

## Sale & Loan Information

**Transfer Date:** 5/28/2021  
**Transfer Value:** \$975,000.00  
**First Loan Amt:** \$0.00

**Seller:** MILLER JOHNNY AL  
**Cost/Sq Feet:** \$0.00  
**Lender:**

**Document:** 2021.328778  
**Title Company:** TICOR TITLE COMPANY

## Assessed & Tax Information

**Assessed Value:** \$350,198.00  
**Land Value:** \$350,198.00  
**Improvement Value:** \$0.00

**Percent Improvement:** %  
**Tax Amount:** \$3,637.52  
**Delinquent Year:**

**Homeowner Exemption:**  
**Tax Rate Area:** 005-017  
**Tax Year:** 2024

# Aerial Map

[View larger map](#)

29400

Google

Map data ©2024 Imagery ©2024 Airbus

# Street View

---



# Property History

, CA

APN: 377-190-003

## Item 1 - Transaction Date: 5/28/2021

### SALE

**Buyer/Borrower:** Collier Commercial Properties Llc

**Seller:** Miller Johnny Al

**Title Company** TICOR TITLE COMPANY

**Transaction Value** \$975,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2021.328778

[View Doc](#)

## Item 2 - Transaction Date: 5/28/2021

### SALE

**Buyer/Borrower:** Miller Johnny Al

**Seller:** Miller Spring

**Title Company** TICOR TITLE COMPANY

**Transaction Value** \$0.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2021.328777

[View Doc](#)

## Item 3 - Transaction Date: 7/8/2010

### ASSIGNMENT

**Buyer/Borrower:**

**Seller:**

**Title Company**

**Transaction Value** \$0.00

**Transaction Type:** ASSIGNMENT

**Deed Type:** Assignment

**Document Number:** 2010.321287

[View Doc](#)

## Item 4 - Transaction Date: 6/23/2010

### SALE

**Buyer/Borrower:** First Citizens Bk & Trust

**Seller:** Fidelity Natl Default

**Title Company** FIDELITY NATIONAL TITLE

**Transaction Value** \$422,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2010.288280

[View Doc](#)

## Item 5 - Transaction Date: 5/27/2010

### FORECLOSURE

**Buyer/Borrower:**

**Seller:**

**Title Company**

**Transaction Value** \$0.00

**Transaction Type:** FORECLOSURE

**Deed Type:** Notice Of Trustee Sale

**Document Number:** 2010.245759

[View Doc](#)



Notice Of Trustee Sale

## Item 6 - Transaction Date: 2/25/2010

### FORECLOSURE

**Buyer/Borrower:**

**Seller:**

**Title Company**

**Transaction Value** \$0.00

**Transaction Type:** FORECLOSURE

**Deed Type:** Notice Of Default

**Document Number:** 2010.86149

[View Doc](#)



Notice Of Default

## Item 7 - Transaction Date: 9/26/2008

### REFINANCE

**Buyer/Borrower:** Elsinore West Llc

**Seller:**

**Title Company**

**Transaction Value** \$550,000.00

**Transaction Type:** FINANCE

**Deed Type:** Trust Deed/Mortgage

**Document Number:** 2008.527044

[View Doc](#)

### MORTGAGE RECORD

**Lender:** TEMECULA VALLEY BANK NA

**Loan Type:** CONVENTIONAL

**Interest Rate Type:** VAR

**Finance Type:** REFINANCE

## Item 8 - Transaction Date: 7/17/2007

### SALE

**Buyer/Borrower:** Elsinore West Llc

**Seller:** Quirk Family Trust

**Title Company**

**Transaction Value** \$1,550,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2007.463006

[View Doc](#)

## Item 9 - Transaction Date: 10/31/2005

### SALE

**Buyer/Borrower:** Elsinore West Llc

**Seller:** Quirk Family Trust

**Title Company**

**Transaction Value** \$1,550,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2005.901205

[View Doc](#)

## Item 10 - Transaction Date: 9/30/2005

### SALE

**Buyer/Borrower:** Quirk Family Trust

**Seller:** Laifornara,Chris

**Title Company** FIDELITY NATIONAL TITLE

**Transaction Value** \$1,000,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2005.810903

[View Doc](#)

## Item 11 - Transaction Date: 9/30/2005

### SALE

**Buyer/Borrower:** Laifornara,Chris

**Seller:** Lake Elsinore Collier Indl

**Title Company** FIDELITY NATIONAL TITLE

**Transaction Value** \$0.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2005.810902

[View Doc](#)

## Item 12 - Transaction Date: 8/3/2005

### SALE

**Buyer/Borrower:** Lake Elsinore Collier Indl Co

**Seller:** Laifornara,Chris

**Title Company**

**Transaction Value** \$0.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2005.625252

[View Doc](#)

## Item 13 - Transaction Date: 3/26/2004

### SALE

**Buyer/Borrower:** Laifornara,Chris

**Seller:** Morris,Gary & Elena

**Title Company** STEWART TITLE

**Transaction Value** \$410,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2004.212181

[View Doc](#)

## Item 14 - Transaction Date: 11/30/2001

### SALE

**Buyer/Borrower:** Morris,Gary & Elena

**Seller:** Rios,Martin & Christine

**Title Company** STEWART TITLE

**Transaction Value** \$125,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2001.591223

[View Doc](#)

## Item 15 - Transaction Date: 1/24/1996

### SALE

**Buyer/Borrower:** Rios,Martin & Christine

**Seller:** Hardcastle,Jack E & Corinne M

**Title Company**

**Transaction Value** \$22,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 1996.27331

[View Doc](#)

## Item 16 - Transaction Date: 3/1/1990

### SALE

**Buyer/Borrower:** Gilson H Henry &

**Seller:** Hardcastle Jack

**Title Company:** QUALITY TITLE

**Transaction Value:** \$300,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 1990.109557

### MORTGAGE RECORD

**Lender:** HARDCASTLE JACK

**Finance Type:** RESALE

**Loan Type:** CONVENTIONAL

**Interest Rate Type:**

**Document Number:** [View Doc](#)

# Property Profile

## Property Data

**Site Address:**  
, CA  
**Mail Address:**  
43 GOLF VIEW DR  
TRABUCO CANYON, CA 92679-3802  
**Primary Owner (s):**  
COLLIER COMMERCIAL PROPERTIES

**APN:** 377-190-004  
**Census Tract:**  
**Housing Tract Number:**  
**Legal Block/Lot:** LOT:24 BLOCK:90  
**Legal Description:** LOT 24 BLK 90 MB 008/378 SD HEALDS RESUB  
**Subdivision:** HEALDS RESUB  
**Property County** RIVERSIDE COUNTY  
**Vesting:**

## Property Characteristics

**Bedrooms:** 0  
**Baths (F/H):** 0 / 0  
**Total Rooms:** 0  
**Zoning:** M1  
**Number of Stories:**

**Year Built:**  
**Use Code:** COMMERCIAL LOT  
**Number of Units:**  
**Building Style:**

**SQFT:**  
**Lot Size:** 38333  
**Garage:** ()  
**Coords:** 33.681547, -117.330011

## Sale & Loan Information

**Transfer Date:** 5/28/2021  
**Transfer Value:** \$975,000.00  
**First Loan Amt:** \$0.00

**Seller:** MILLER JOHNNY AL  
**Cost/Sq Feet:** \$0.00  
**Lender:**

**Document:** 2021.328778  
**Title Company:** TICOR TITLE COMPANY

## Assessed & Tax Information


**Assessed Value:** \$334,280.00  
**Land Value:** \$334,280.00  
**Improvement Value:** \$0.00

**Percent Improvement:** %  
**Tax Amount:** \$3,473.76  
**Delinquent Year:**

**Homeowner Exemption:**  
**Tax Rate Area:** 005-017  
**Tax Year:** 2024


# Aerial Map

[View larger map](#)

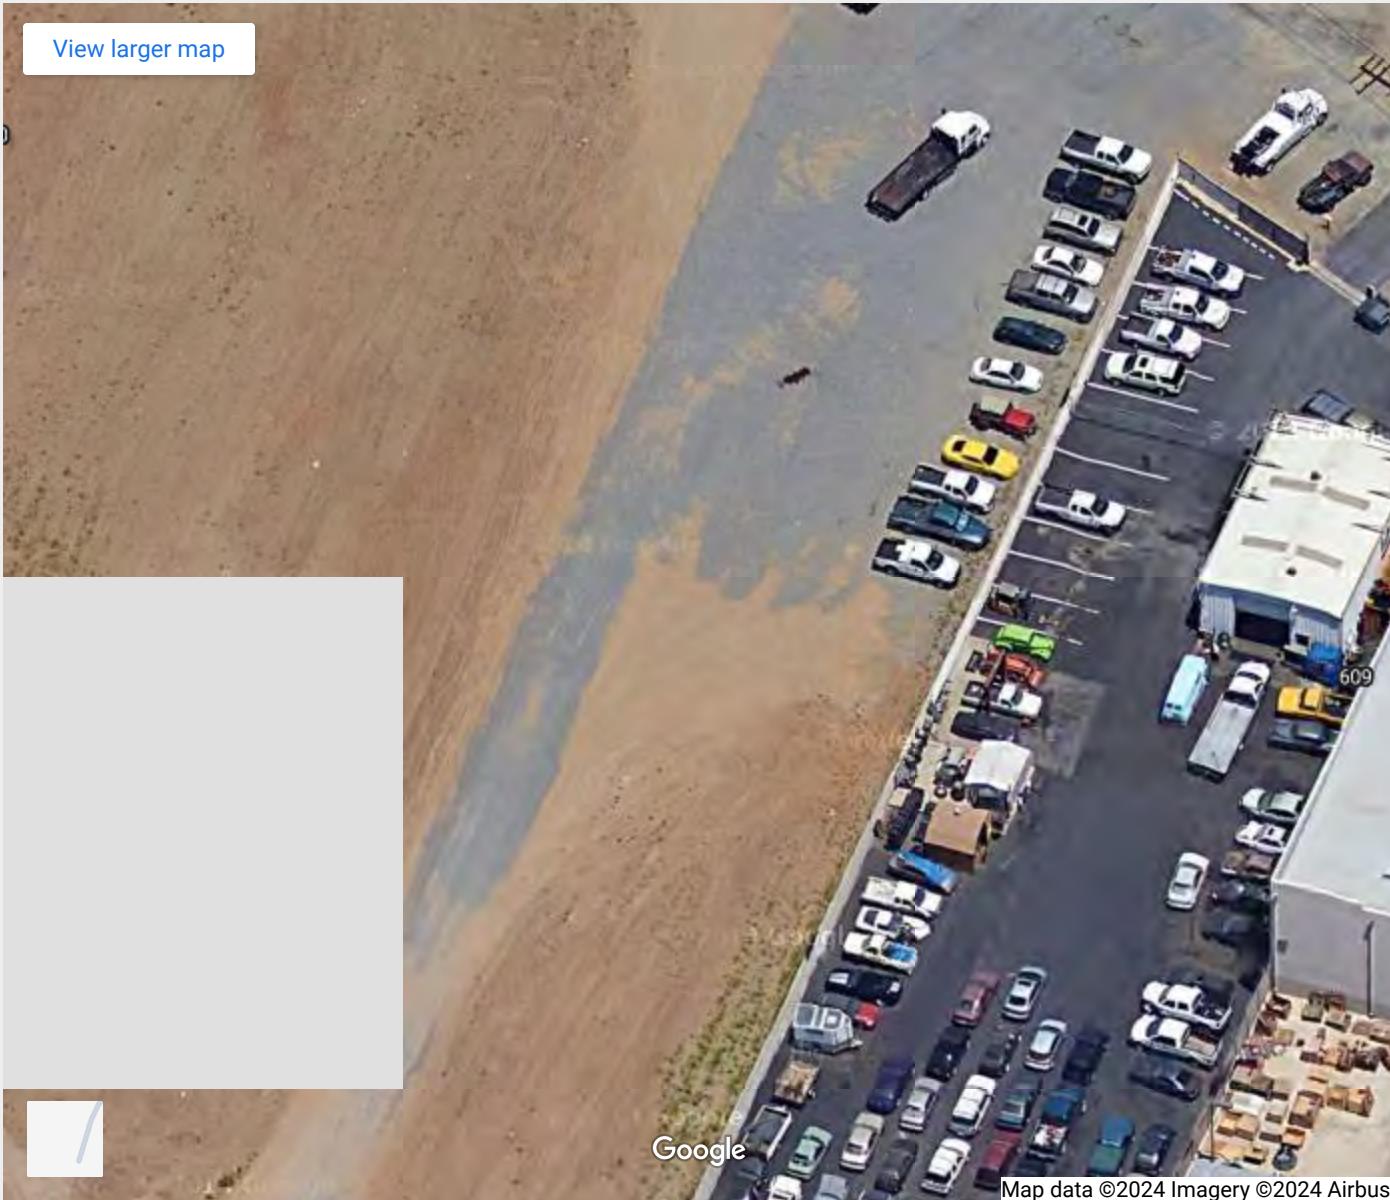

# Street View

---

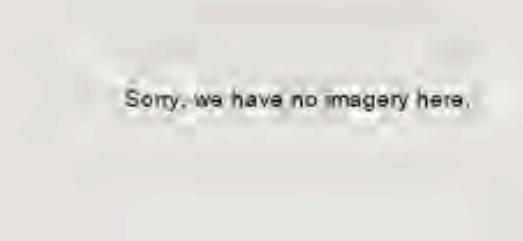

Sorry, we have no imagery here.

Google

©2024 Google

# Property History

, CA

APN: 377-190-004

## Item 1 - Transaction Date: 5/28/2021

### SALE

**Buyer/Borrower:** Collier Commercial Properties Llc

**Seller:** Miller Johnny Al

**Title Company** TICOR TITLE COMPANY

**Transaction Value** \$975,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2021.328778

[View Doc](#)

## Item 2 - Transaction Date: 5/28/2021

### SALE

**Buyer/Borrower:** Miller Johnny Al

**Seller:** Miller Spring

**Title Company** TICOR TITLE COMPANY

**Transaction Value** \$0.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2021.328777

[View Doc](#)

## Item 3 - Transaction Date: 7/8/2010

### ASSIGNMENT

**Buyer/Borrower:**

**Seller:**

**Title Company**

**Transaction Value** \$0.00

**Transaction Type:** ASSIGNMENT

**Deed Type:** Assignment

**Document Number:** 2010.321287

[View Doc](#)

## Item 4 - Transaction Date: 6/23/2010

### SALE

**Buyer/Borrower:** First Citizens Bk & Trust

**Seller:** Fidelity Natl Default

**Title Company** FIDELITY NATIONAL TITLE

**Transaction Value** \$422,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2010.288280

[View Doc](#)

## Item 5 - Transaction Date: 5/27/2010

### FORECLOSURE

**Buyer/Borrower:**

**Seller:**

**Title Company**

**Transaction Value** \$0.00

**Transaction Type:** FORECLOSURE

**Deed Type:** Notice Of Trustee Sale

**Document Number:** 2010.245759

[View Doc](#)



Notice Of Trustee Sale

## Item 6 - Transaction Date: 2/25/2010

### FORECLOSURE

**Buyer/Borrower:**

**Seller:**

**Title Company**

**Transaction Value** \$0.00

**Transaction Type:** FORECLOSURE

**Deed Type:** Notice Of Default

**Document Number:** 2010.86149

[View Doc](#)



Notice Of Default

## Item 7 - Transaction Date: 9/26/2008

### REFINANCE

**Buyer/Borrower:** Elsinore West Llc

**Seller:**

**Title Company**

**Transaction Value** \$550,000.00

**Transaction Type:** FINANCE

**Deed Type:** Trust Deed/Mortgage

**Document Number:** 2008.527044

[View Doc](#)

### MORTGAGE RECORD

**Lender:** TEMECULA VALLEY BANK NA

**Loan Type:** CONVENTIONAL

**Interest Rate Type:** VAR

**Finance Type:** REFINANCE

## Item 8 - Transaction Date: 7/17/2007

### SALE

**Buyer/Borrower:** Elsinore West Llc

**Seller:** Quirk Family Trust

**Title Company**

**Transaction Value** \$1,550,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2007.463006

[View Doc](#)

## Item 9 - Transaction Date: 10/31/2005

### SALE

**Buyer/Borrower:** Elsinore West Llc

**Seller:** Quirk Family Trust

**Title Company**

**Transaction Value** \$1,550,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2005.901205

[View Doc](#)

## Item 10 - Transaction Date: 7/21/2005

### SALE

**Buyer/Borrower:** Quirk Family Trust

**Seller:** Carson Robert & S Trust

**Title Company** FIDELITY NATIONAL TITLE

**Transaction Value** \$550,000.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2005.584328

[View Doc](#)

## Item 11 - Transaction Date: 10/15/2004

### SALE

**Buyer/Borrower:** Quality Fence Co Inc

**Seller:** Jackson,Floyd B & Anna K

**Title Company** STEWART TITLE

**Transaction Value** \$0.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2004.820899

[View Doc](#)

## Item 12 - Transaction Date: 4/19/2002

### SALE

**Buyer/Borrower:** Quality Fence Co Inc

**Seller:** Jackson,Floyd B & Anna

**Title Company:** STEWART TITLE

**Transaction Value:** \$143,500.00

**Transaction Type:** SALE

**Deed Type:** Deed Transfer

**Document Number:** 2002.207116

[View Doc](#)

### MORTGAGE RECORD

**Lender:** JACKSON, FLOYD B & ANNA

**Finance Type:** RESALE

**Loan Type:** CONVENTIONAL

**Interest Rate Type:** FIX

**Document Number:** 2002.207117

[View Doc](#)

## **12.6 DTSC Envirostor Map and Geotracker**

Supreme Boxer

Federal Superfund

State Response

Voluntary Cleanup

School Cleanup

Evaluation

School Investigation

Military Evaluation

Tiered Permit

Corrective Action

Field Points

STATUS

All Statuses

Permitted Sites

Operating

Post-Closure

Non-Operating

Other Sites

GeoTracker LUST Cleanup

GeoTracker Cleanup Program

GeoTracker Military Cleanup

GeoTracker Field Points

GIS Layers

Tools

[TAKE A TOUR](#) [SHARE THIS MAP](#)

Google

West Minthorn Street & Collier Avenue, Lake Elsinore, ... [Map Address](#)

Riverside County Department of public...

W Minthorn St

Collier Ave

Cam Del Norte

W Minthorn St

Collier Ave

Wiley St

Ohana Cir

Chaney St

Extra Space Storage

Labeda Hockey

15

Warm Springs Valley

Lake Elsinore Public Works

West Minthorn Street & Collier Avenue, Lake Elsinore, CA

**RIGHTWAY PORTABLE TOILETS**  
653 W MINTHON ST  
LAKE ELSINORE, CA 92330

**LUST Cleanup Site**

**Cleanup Status: Completed - Case Closed**  
RB Case #: 083300324T

**Permitted Sites**

- Operating (red dot)
- Post-Closure (orange dot)
- Non-Operating (yellow dot)

**Other Sites**

- GeoTracker LUST Cleanup (blue triangle)
- GeoTracker Cleanup Program (blue triangle)
- GeoTracker Military Cleanup (blue triangle)
- GeoTracker Field Points (blue circle)

**GIS Layers**

**Tools**

[TAKE A TOUR](#) [SHARE THIS MAP](#)

West Minthorn Street & Collier Avenue, Lake Elsinore, CA

**LAIDLAW TRANSIT**  
609 W MINTHON ST  
LAKE ELSINORE, CA 92330

**LUST Cleanup Site**

**Cleanup Status: Completed - Case Closed**  
RB Case #: 083300978T

## **12.7 DOGGR Map**



## Well Finder

CalGEM GIS

▼ Well Status and Well Type Filter

▼ Search

▼ \* Zoom to Field


▼ ↗ Measurement

▼ ━━ Layers



Powered by

WellSTAR

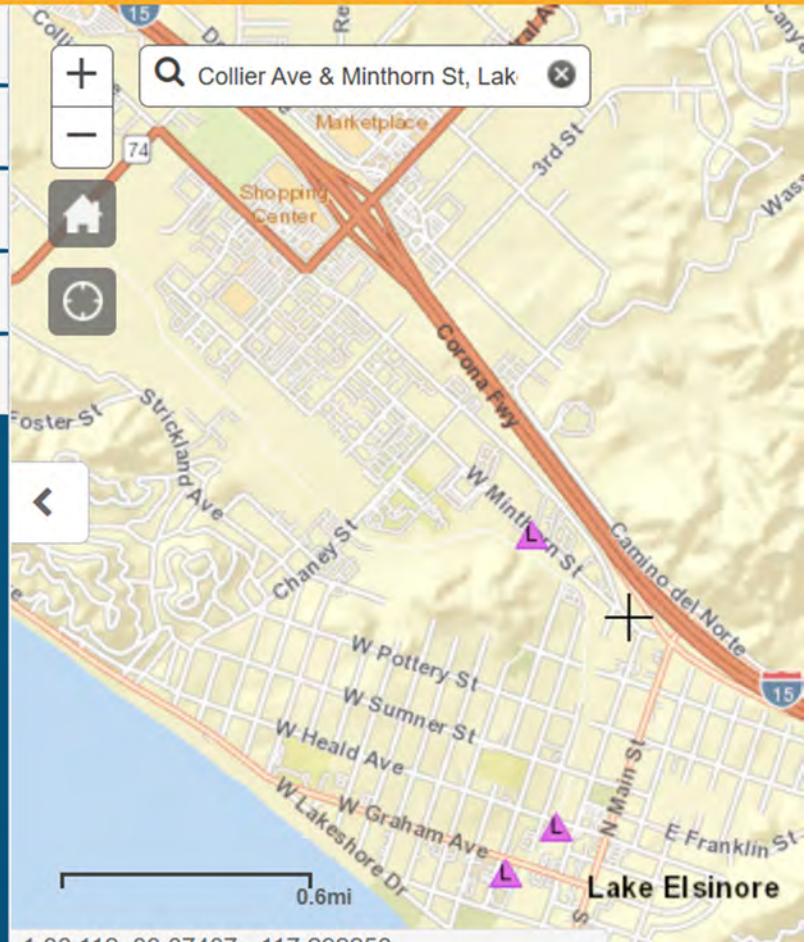



## Well Finder

CalGEM GIS

Well Status and Well Type Filter

Search

Zoom to Field

Measurement

Layers



### Geothermal Well

API: 06590015

Lease Name: GW

Well Number: 3

Well Type: Commercial Low Temperature

Well Status: Idle

[View in GeoSteam](#)

[View Well Record](#)

[Get Driving Directions](#)

Zoom to



Powered by

WellSTAR

1-18-056 33-671817 -117-30107

## **12.8 SCAQMD Permit**

**No Address and No Permits**

## **12.9 Letter from Magnetek**

The following is a reprint of:

*MagneTek  
Universal Manufacturing*

200 Robin Road  
Paramus, NJ 07652  
Phone (201) 967-7600  
TELEX 753330  
Fax (201) 967-0904

-----  
Mailing Address  
P.O. Box 3028  
Paterson, NJ 07509

RE: PCB's

Ballasts are used in fluorescent fixtures in business, commercial and industrial establishments, as well as in schools. One of the devices used in these ballasts is called a capacitor, which makes the ballasts operate more efficiently. These capacitors, used in ballasts made by every manufacturer in the industry, including Universal, used PCBs in small amounts until 1978, when a change was made to another liquid. Universal ballasts manufactured since January 1979 do not contain PCBs and the label of all these ballasts contain the statement "No PCB's".

The capacitor is a hermetically sealed device, which entirely isolates the PCB from human contact. The typical fluorescent ballast contained about 0.05 lbs. of 100% PCB liquid. That represents 1-2 liquid ounces. The weight of PCB used in relationship to the total capacitor weight, was approximately 15%. In relationship to the total ballast weight it varied from 0.6% (Slimline ballasts) to 1.5% (2 lamp, 40 watt ballasts). The degree of chlorination was 42%.

For HID ballasts where larger capacitors were used, it may have been as much as 5-6 ounces of liquid. In all cases the amount of "free PCBs" (the quantity that could leak if the can ruptured), was much less because most of the liquid was absorbed by the blotter-like dielectric material.

Ballasts occasionally fail in service and sometimes the asphalt (tar) with which they are filled melts and leaks out. On very rare occasions, the capacitor will also rupture and its contents mix with the tar. If a leak occurs, it should be cleaned up with any petroleum-based solvent.

Such a leak does not represent any significant immediate or long-term hazard. The United States Environmental Protection Agency has recognized the existence of PCBs in ballasts, has carefully evaluated the situation and in the regulations controlling the use and disposal of PCBs has concluded that continued use in existing lighting installations is acceptable; also that the occasional ballasts which becomes defective in service may be disposed of in compliance with 40 CFR\* Part 761 or check with your local State Environmental Protection Agency for instruction.

Should you have any questions regarding this matter, please do not hesitate to call me at your convenience.

Very truly yours,

MagneTek Universal Manufacturing

Robert E. Babcock  
Manager, Marketing Engineering

REB:cp

\* Code of Federal Regulations

## **12.10 Certification**

## **ENVIRONMENTAL PROFESSIONAL CERTIFICATION**

I, Stephen A. Quartararo declare that, to the best of my professional knowledge and belief, I meet the definition of an Environmental Professional as defined in Section 312.10 of this part [40CFR Part 312].

I have the specific qualifications based upon education, training, and experience to assess a property of the nature, history and setting of the subject property. I have developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

**S&S Commercial Environmental Services, Inc.**

A handwritten signature in black ink, appearing to read "Stephen A. Quartararo".

**Stephen A Quartararo, CEO  
Environmental Professional  
Title 40, Code of Federal  
Regulations CFR Part 312.22**

## **12.11 Resume**

## **RESUME**

**STEPHEN A. QUARTARARO** <http://www.phase1reports.com>  
Environmental Professional, CFR Title 40 Code of Federal Regulations Section 312.22  
ASTM 1527-2021, ASTM 2600-15, CA 2010 CHHSLs, CA HERO 2016, SBA May 1, 2015, HUD  
2016

**Owner S&S Commercial Environmental Services, Inc.** since formation 1997. General Engineering Contractor A Hazardous Materials Certified, General Building Contractor B, Insulation and Acoustical C-2, Asbestos Certified, Water Well Drilling Contractor C-57. CA Real Estate Brokers License, Life & Health Insurance License (former).

**Phase I Site Surveys, Phase II Soil and Groundwater Investigations, Phase III Remediation of Soil and Groundwater** leading to No Further Action or Closure by Local, County, State and Federal Agencies. Environmental Hazard Assessment, Project Cost to Cure Physical Deterioration, Construction Management, Environmental Site Appraisals. Storm and Irrigation Water Conservation, Re-use.

Coordinator for Oil Well Re-abandonment at Signal Hill, CA site in 2009 and at a Valencia, California Site in 2006.

### **Recent Projects**

2020, 21 - Phase II & II Characterization & Vapor Extraction - former dry cleaner in Ventura County CA

2020 - Phase I and Phase II of former auto wrecking yard in Inland Empire with one area owned by City and other area part of DTSC Conditionally Closed former Gas Manufacturing Plant.

2020 - Phase I, II, III, Lead Dust Abatement Excavation and Disposal of 12 tons of lead and copper contaminated soil in former radiator shop in South Bay.

2019 – Clarifier Closure including off excavation and off haul of 8 truckloads of contaminated soil in Gardena, CA under LADPW oversight.

2019 – January and July 2019 – Phase I, II and III including Abandonment of two separate Industrial Clarifiers in Southeast and Middle Los Angeles County with closure through LA County Department of Public Works. .

2018 – Phase I and Phase II with Risk Assessment by others to prove property adjoining HITCO, a regional soil and groundwater contamination site on 135th Street Gardena CA was safe for Commercial Worker Occupancy leading to approval for SBA Loan. June 2017 - Closure Investigation after nine years Under Regional Water Quality Board Oversight including 2 groundwater monitoring wells in City Sidewalk Long Beach CA.

June 2017 - Closure Investigation after nine years Under Regional Water Quality Board Oversight

including 2 groundwater monitoring wells in City Sidewalk Long Beach CA.

May 2017 - Investigation - Remediation of Gas Station in Calexico, CA under Regional Water Quality Board Oversight.

December 2016 - Facilitator with LA County Fire Department Site Mitigation Unit and General Engineering Contractor for Closure of 3.5-acre industrial property in Carson, CA over a five year period. Removal of PCE Vapor in three major areas to 45 feet. Removal and off haul of 30 = twenty-four-ton truckloads of gasoline and diesel, pce and tce contaminated waste under over site of LA County Fire Department Site Mitigation Unit in a final remediation of source. Closure of minimally contaminated groundwater at 58 feet as non-beneficial water attenuating naturally.

March 2016 - Facilitator for No Further Action (NFA) Closure Letter for Soil, Soil Vapor and Groundwater for large light industrial property in Carson, CA after four years of testing and remediation. Relieved Owner from further quarterly monitoring and remediation of groundwater under NFA property by proving that the contamination was from an offsite VOC contaminant source being remediated by Others.

## **EXPERIENCE**

6,000 plus Phase I site assessments in CA, AL, AZ, AR, NV, NY and TN.

100's of Phase II and Phase III site investigations and closures in CA.

40 years as asbestos and environmental consultant and abatement contractor direct and subcontract. 20 of those years as owner of an Environmental Company, 19 as a General Engineering Contractor with Hazardous Certification and 3 of those years with related storm and irrigation water conservation related companies.

Professional cost estimation, third party verification of sampling activities, underground tank removal monitoring and property assessment consultant for soil and groundwater.

Coordinator of design and construction in two Los Angeles high rise office buildings for fire safety retrofit under the City of Los Angeles fire life safety ordinance.

Develop and Design of Affordable Housing, including site selection, negotiation, planning and permit process and funding sourcing.

## **MAJOR CONTRACTS**

UC Santa Barbara (1979) - HVAC system cleaning of five-story Chemistry and Physical Sciences buildings on campus.

VA Medical Center LA Jolla (1980) - After-fire decontamination of Surgery Floor HVAC.

TRW (1983) - Bulk materials sampling for asbestos in 65-building facility, Redondo Beach, CA. UC Chancellors Office, UC San Francisco Medical Center (1984) - Survey design, field work completion, report design, report completion for UC Chancellor's office's funding request to State Assembly funding for asbestos abatement and management - 103 buildings - hospital, classrooms, administrative offices.

California Hospital Medical Center (1983) - Contract and specification design and

completion of asbestos abatement projects.

County of Los Angeles (1984) - Approval of specifications, third party monitoring of contractor during Building 5 Asbestos Abatement Project at Rancho Los Amigos Medical Center.

JMB Property Management (1985) - Coordination as part of Pacific Abatement Group with building management and Med Tox abatement and hygiene personnel on 3 stories of asbestos containment project in 25 story high rise office building, Century City, CA.

UC Riverside (1985) - Asbestos management and control in utility tunnels under campus.

Tishman Construction (1985) - Area containment for electrical work adjacent to occupied areas in asbestos affected Bank of America offices at ARCO Towers, Los Angeles, CA.

Equitable Real Estate Investment Management (1986) - Asbestos abatement and containment projects, including elevator lobby doors, full floor abatement and after-fire decontamination projects in former First Interstate Bank and Union Bank buildings, Los Angeles, CA.

Baxter Pharmaceutical (1988) - Building materials sampling for asbestos and reports for 14 buildings in seven Midwest States.

Fremont Indemnity (1991) - Independent owner's agent for fire protection citation response to LAFD and construction of tenant improvements for asbestos abatement and fire life safety rehabilitation of 11-story office building in midtown Los Angeles. Included removal of underground diesel tank.

Redlands Federal Savings (1990) - Phase I Environmental Assessments of raw land in Inland Empire and San Diego areas of Southern California.

SPS Technologies (1993) - "Qualified Risk Assessment"(QRA) for sale of existing 20-acre site in Costa Mesa, CA: Work involved review of commercial appraisals, Environmental Site Remediation work completed, further remediation cost proposals, interviews with responsible

government agencies, interviews with banking authorities, preparation of report detailing current conditions and value of property less expected remediation costs, results of interviews with regulatory agencies and financial authorities, four scenarios under which the property might be sold and the anticipated financial return and liability concerns of each scenario.

Money Store Investment Corporation (from 1992 until sold) - Related - 400+ Phase I Environmental Assessments of commercial property as collateral for SBA backed commercial loans in California.

First Union/Wachovia - Successors to Money Story Investment Corporation, Then Wells Fargo Coast Federal Savings (Former- early 1990's) - 300+ Phase I Environmental Assessments and Asbestos Inspections of residential apartment buildings, commercial shopping centers and other commercial buildings from San Diego to San Francisco and Sacramento to New York State.

Chevron Real Estate Services (1991) - Coordination and management of gasoline contaminated soil remediation project in Blythe, CA; work included shoring to 30 feet along the western perimeter of project to protect adjacent restaurant, removal and bio-remediation of 3,500 cubic feet of contaminated soil, removal of 5,000 gallons of contaminated water, placement of filter over local groundwater, back filling of excavation with remediated soil.

Carlsberg Management Company (1989-1995) - Independent owner's agent for fire protection citation response to LAFD and construction of tenant improvements for asbestos abatement and fire life safety rehabilitation of 10-story office building in West Los Angeles.

Owner's representative: work included selection and coordination of architect, mechanical, electrical, fire sprinkler, asbestos abatement/containment and industrial hygiene contractors and

interface with the City of Los Angeles Building, Electrical and Structural Departments and Inspectors over a five-year period under occupied and vacant building conditions.

California Federal Bank (1993) - Phase I Environmental Assessments and Asbestos Inspections of commercial and residential buildings in Northern and Southern California.

Folger & Levin, Law Firm (1995) - "Environmental Risk Assessment" (ERA) for 3-acre parcel in West Los Angeles. Review of six environmental soil and groundwater studies, practical expansion of research and coordinated explanation of real environmental issues for use by commercial property appraiser.

State Farm Insurance Company (1995) - Asbestos expert for client negotiations.

Berger, Kahn, Shafton, Moss, Figler, Simon & Gladstone (1996/1997) - Asbestos expert witness.

Prestholt, Kleeger, Fidone & Villasenor (1996) - Asbestos expert witness.

S&S Commercial Environmental Services (1997 - Present) - Phase I Site Assessments and Miscellaneous Independent Project Management and General Engineering Contractor for soil and groundwater sampling and remediation leading to site closure letter from County and City Fire Departments, Health Departments and CA Regional Water Boards ranging from thousands to hundreds of thousands of dollars. Oil Well Re-abandonment.

Bank of America - Related - Phase I Environmental Assessments Southern California.

Wells Fargo Bank - Phase I Environmental Assessments and Asbestos Inspections in California for Standard and SBA backed RE property loans. (Successor To Wachovia Bank - SBA Division) Chase Bank - Phase I Site Assessments

First Foundation Bank - Phase I Environmental Site Assessments & Phase I Reviews, Phase II Site Investigations. California and Nevada

Standard Life Insurance Company - Phase I Site Assessments

Metropolitan Life Insurance Company - Phase I Site Assessments

Textron Financial - Heritage Golf Group - 127 Acre Golf Course Santa Clarita - Phase I

Blue Green Preservation - Phase I and Phase II Site Assessments HUD Senior Housing California, Alabama, Tennessee, Arkansas

Miscellaneous Independent Cost Estimation for required remediation of contaminated sites with commercial and industrial property appraisers.

## **EDUCATION**

B.S. Urban Environmental Management; Cal State University Dominguez Hills

J.D. Candidate Classes in Torts, Contracts, Criminal Law, Legal Writing; Western State University, Southern California College of Law

Major Emphasis - Tort Theory and the implications to modern environmental contamination and clean-up problems.

"Low Risk Closure Guidelines" - California Regional Water Quality Board - Los Angeles Region Seminar June 1996.

Miscellaneous Classes provided by State Agencies in past twenty years and job site discussion regarding water quality standards and remediation with Regulators for Closure.

California Storm Water Association (CASQA - Member and participation as vendor representing OSORB as Absorb Concentrate & Eliminate (AC&E San Diego August 2012. Member and participation as vendor representing ASRE (Advanced Stormwater Recovery & Engineering Garden Grove September 2014.

## **LICENSES**

California A General Engineering Contractor, Hazardous Materials Certified  
California B General Building Contractor  
California C-2 Contractors License, Asbestos  
Certified California C-57 Water Well Driller  
California Real Estate Broker  
CA Life & Health Agent (former)

Current & Former

## **CERTIFICATIONS**

Certified Asbestos Consultant (CAC, State of California)  
EPA/AHERA Competent Person, Supervisor/ Management Planner/Project Designer  
Hazwhopper 48 Hour OSHA Certified Field Supervisor  
Certified Professional Estimator (CPE) Lead Abatement Supervisor

## **REGISTRATIONS**

Registered Environmental Assessor (REA)  
Registered Property Manager (RPM)

## **AFFILIATIONS**

American Society of Professional Estimators (ASPE)  
California Society of Real Estate Appraisers  
(CSOREA) American Institute of Plant Engineers  
(AIPE)  
California Society of Hospital Engineers  
(CSHE) National Society of Power Engineers  
(NSPE)  
Kiwanis International, Greater Anaheim, CA (KIWANIS)

## **PUBLICATIONS**

Industrial Real Estate Association Fall 1997 Newsletter, "The Environmental Report, To Close or Not To Close", 1997  
Home Trader Publications, Copyright 1994 - Residential properties for sale or trade. American Numerous articles on asbestos in "Asbestos Issues", a nationally published magazine, and the "Los Angeles BOMA" magazine.

## **SEMINAR SPEAKER**

IRS (Internal Revenue Service), "Discounted Value of Asbestos and Environmentally Affected Property"  
CATL (CA Assoc of Thrift and Loans), "The Effect of Asbestos and Environmental Discounts on Loans"  
American Society of Professional Estimators - "The Design and Estimate of an Asbestos Abatement Project"  
Los Angeles Board of Realtors, "Asbestos in Homes and Property"  
(AIPE) American Institute of Plant Engineers, "Asbestos, History and Challenges"  
(CSHE) California Society of Hospital Engineers, "Asbestos, History and Challenges"

(SCACEO)Southern California Association of Code Enforcement Officials "Single Room Occupancy Hotels, History and Modern Operations"

### **TRAINING CLASSES PRESENTED**

8-hour Asbestos Awareness Class presented to:

- \* City of LA Fire Safety Inspectors
- \* Zurn Cosco Supervisors and Workers
- \* Grinnell Fire Protection Supervisors and Workers

### **EDUCATION VIDEOS**

Installation of Fire Sprinkler Hangers within asbestos affected environments, 1986

SROs, The Myth and Reality, 1991

### **DEVELOPMENT DESIGN**

General Partner - 210-unit Single Room Occupancy (SRO residential project in Anaheim, CA.

General Partner - 55-unit Single Room Occupancy (SRO residential project in Santa Ana, CA.

### **EMPLOYMENT HISTORY AND OWNERSHIP**

S & S Commercial Environmental Services, Inc., ASRE, Inc. AC&E, Inc., Enviroprop, Home Trader Realty, Inc., Equity Funding Mortgage, NATEC International, Inc., McClelland Management Services, National Abatement Corporation, Med-Tox Consultants, Pacific Abatement Group, Asbestos

## **12.14 Environmental First Search Report**

# RecCheck

The Standard for ASTM/AAI Radius Searches

(One Mile Environmental Records Search. Exceeds ASTM I527/I528 and EPA All Appropriate Inquiry)

# Report Results

**REPORT RESULTS**



## Site Location:

Collier And Minthorn  
Lake Elsinore , CA 92530  
(N 33-40-55, W 117-19-49) NAD83

## Client:

SSS Commercial Environmental Services, Inc.

---

## TABLE OF CONTENTS

<u>EXECUTIVE SUMMARY</u>	<u>1</u>
<u>SUMMARY OF OCCURRENCES</u>	<u>3</u>
<u>POTENTIAL AREAS OF CONCERN/CONTAMINATION SUMMARY</u>	<u>9</u>
<u>DATABASE OCCURRENCE SUMMARY</u>	<u>9</u>
<u>SITE LOCATION TOPOGRAPHIC MAP</u>	<u>17</u>
<u>SITE LOCATION MAP</u>	<u>18</u>
<u>1-MILE RADIUS STREET MAP W/OCCURRENCES (MAP1)</u>	<u>19</u>
<u>0.25-MILE RADIUS STREET MAP W/OCCURRENCES (MAP2)</u>	<u>20</u>
<u>0.0625-MILE RADIUS STREET MAP W/ OCCURRENCES (MAP3)</u>	<u>21</u>
<u>1-MILE TOPOGRAPHIC MAP W/OCCURRENCES (MAP4)</u>	<u>22</u>
<u>AGENCY DIFFERENCES IN MAPPED LOCATIONS (MAP5)</u>	<u>23</u>
<u>SUMMARY OF AGENCY DIFFERENCES</u>	<u>24</u>
<u>MAPPED AIR PERMITS WITH POTENTIAL DISPERSION (MAP6)</u>	<u>25</u>
<u>LISTED OCCURRENCE DETAILS</u>	<u>26</u>
<u>RECORDS SOURCES SEARCHED</u>	<u>72</u>
<u>UN-MAPPABLE OCCURRENCES</u>	<u>86</u>
<u>DISCLAIMER, LIMITS AND LIABILITIES</u>	<u>87</u>

## EXECUTIVE SUMMARY

### INFORMATION ON THE REQUESTED LOCATION

<b>Site Address:</b>	Collier And Minthorn Lake Elsinore , CA 92530
<b>Client Project Name/Number:</b>	2104787850
<b>Coordinates:</b>	N 33-40-55, W 117-19-49 (NAD 83) 33.681843, -117.330313
<b>Date of Report</b>	October 29, 2024
<b>ERS Project Number:</b>	2104787850
<b>Subject Site Listed on the following lists:</b>	Not Listed
<b>Subject Site Listed as Map ID#:</b>	N/A
<b>USGS 7.5 Minute Quad Map:</b>	Lake Elsinore (Date Unavailable)
<b>Subject Site Located within a Potential Area of Concern:</b>	No
<b>Township, Section and Range:</b>	Township: 06S Range: 04W Section: 06 Baseline: San Bernardino
<b>Site Elevation: (feet above or below (-) mean sea level)</b>	1282
<b>Flood Zone: (Digital Flood Insurance Rate Maps - DFIRMs)</b>  Only available digital data is provided	Panel: 06065C2037G, Effective Date: 8/28/2008 Zone X - Area of minimal flood hazard, usually depicted on FIRMs as above the 500-year flood level.
<b>Fire Insurance Map Coverage:</b>	No
<b>Radon Information:</b>	EPA Radon Zone: 2 (Predicted avg for county: 2 to 4 pCi/L)
<b>Search Radius Expansion Size: (In Miles)</b>	0

<b>Soil Type:</b> <b>(USDA Soil Survey Geographic Database) (SSURGO)</b>	Map Unit Name: Arbuckle gravelly loam, 15 to 25 percent slopes Map Unit Type: Consociation Drainage Class - Dominant Condition: Well drained General Information: Fine-loamy, mixed, thermic Typic Haploxeralfs Top 3 Map Unit Components are below (if available): Component Name: Garretson, Cortina, Arbuckle Component Percentage: 5%, 5%, 85% Hydric: No, No, No
<b>Zip Codes Searched for "Un-Mappable" Sites:</b>	Not Researched
<b>Occurrence Count:</b>	66

## SUMMARY OF OCCURRENCES

MAP ID	ID/SITE NAME	ADDRESS	DATABASE	STATUS	DISTANCE (MILES)	ELEV DIFF (FEET)
<a href="#">1</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	214479 LAIDLAW TRANSIT	Not Reported by Agency	CRSP-CA	Listed	0.05 SE	-6
<a href="#">2</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	124616-SC EASTERN MUNICIPAL WATER DISTRICT	866 MINTHORN ST LAKE ELSINORE	AIR-DIST-CA	Listed	0.05 SW	-5
<a href="#">3</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	77669-SC M & J AUTO & BODY	609 MINTHORN ST LAKE ELSINORE	AIR-DIST-CA	Listed	0.06 W	-4
<a href="#">3</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	110065082234 LAIDLAW TRANSIT	609 W MINTHORN ST LAKE ELSINORE	FRS-US	Listed	0.06 W	-4
<a href="#">3</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	110070474323 STEVE'S TOWING INC	609 W MINTHORN ST LAKE ELSINORE	FRS-US	Listed	0.06 W	-4
<a href="#">3</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	235566 LAIDLAW TRANSIT	609 MINTHORN STREET, WEST LAKE ELSINORE	Hist-LUSTIS-CA	Listed	0.06 W	-4
<a href="#">3</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	235566 LAIDLAW TRANSIT	609 MINTHORN STREET WEST LAKE ELSINORE	Hist-Regional-UST-CA	Listed	0.06 W	-4
<a href="#">3</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	214068 ARA TRANSPORTATION INC	609 MINTHORN AVE LAKE ELSINORE	Hist-UST-CA	Listed	0.06 W	-4
<a href="#">3</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	244271 LAIDLAW TRANSIT / ELSINORE DIV	609 MINTHORN LAKE ELSINORE	Hist-UST-CA	Listed	0.06 W	-4
<a href="#">3</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	54FDFFFA-CAL000337032 STEVE'S TOWING INC	609 W MINTHORN ST LAKE ELSINORE	HWIS-CA	No Longer Listed	0.06 W	-4

MAP ID	ID/SITE NAME	ADDRESS	DATABASE	STATUS	DISTANCE (MILES)	ELEV DIFF (FEET)
<a href="#">3</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	CAL000337032 STEVE'S TOWING INC	609 W MINTHORN ST LAKE ELSINORE	HWIS-CA	No Longer Listed	0.06 W	-4
<a href="#">3</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	T0606500097 LAIDLAW TRANSIT	609 W MINTHORN ST LAKE ELSINORE	LUST-Closed-CA	COMPLETED - CASE CLOSED	0.06 W	-4
<a href="#">3</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	CAL000337032 STEVE'S TOWING INC	609 W MINTHORN ST LAKE ELSINORE	RCRA-NON-US	Listed	0.06 W	-4
<a href="#">3</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	CAD982317299 ZIEMBAS AUTO	609 MINTHORN LAKE ELSINORE	RCRA-SQG-US	Listed	0.06 W	-4
<a href="#">4</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	265854 Lake Elsinore Outlet Channel Maintenance Project	Not Reported by Agency	CRSP-CA	Listed	0.07 SW	-8
<a href="#">5</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	36895-SC THERMAL ELECTRONICS INC	403 MINTHORN LAKE ELSINORE	AIR-DIST-CA	Listed	0.08 S	-9
<a href="#">5</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	CAD052663085 THERMAL ELECTRONICS, INC	403 W Minthorn St Lake Elsinore	RCRA-NON-US	Listed	0.08 S	-9
<a href="#">6</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	338019 Temescal Creek Outfall	Not Reported by Agency	ENF-Wastewater-CA	Historical	0.09 SW	-6
<a href="#">6</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	221849 Temescal Creek Outfall	Not Reported by Agency	ENF-Wastewater-CA	Historical	0.09 SW	-6
<a href="#">6</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	253277 Temescal Creek Outfall	Not Reported by Agency	ENF-Wastewater-CA	Historical	0.09 SW	-6
<a href="#">6</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	251510 Temescal Creek Outfall	Not Reported by Agency	ENF-Wastewater-CA	Historical	0.09 SW	-6
<a href="#">6</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	74331 Temescal Creek Outfall	Not Reported by Agency	CRSP-CA	Listed	0.09 SW	-6

MAP ID	ID/SITE NAME	ADDRESS	DATABASE	STATUS	DISTANCE (MILES)	ELEV DIFF (FEET)
<a href="#">7</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	CAC003030691 NET DEVELOPMENT CO.	311 W Minthorn St Lake Elsinore	RCRA-NON-US	Listed	0.1 S	-12
<a href="#">7</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	CAR000284208 ABEL'S AUTO REPAIR LLC	311 W Minthorn St Ste 4 Lake Elsinore	RCRA-SQG-US	Listed	0.1 S	-12
<a href="#">8</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	319242 Lake Elsinore Inflatable Dam Installation	Not Reported by Agency	CRSP-CA	Listed	0.15 W	-8
<a href="#">9</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	61661 Rightway Portable Toilets	Not Reported by Agency	CRSP-CA	Listed	0.16 NW	-1
<a href="#">10</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	28303 EMWD Reach 4 Dissipation Facility	Not Reported by Agency	CRSP-CA	Listed	0.17 SE	-15
<a href="#">11</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	5607-RSD EMWD Reach 4 Dissipation Facility	636 Minthorn St Lake Elsinore	County-Others-CA	Listed	0.17 SE	-16
<a href="#">12</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	66761-RSD Rightway Portable Toilets	653 W Minthorn St Lake Elsinore	County-Others-CA	Listed	0.17 NW	-3
<a href="#">12</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	5713-RSD Rightway Portable Toilets	653 W Minthorn St Lake Elsinore	County-Others-CA	Listed	0.17 NW	-3
<a href="#">12</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	55715 RIGHTWAY PORTABLE TOILETS	653 W MINTHORN ST LAKE ELSINORE	ENF-CA	Listed	0.17 NW	-3
<a href="#">12</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	1293320 RIGHTWAY PORTABLE TOILETS	653 MINTHORN STREET, WEST LAKE ELSINORE	Hist-LUSTIS-CA	Listed	0.17 NW	-3
<a href="#">12</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	1293320 RIGHTWAY PORTABLE TOILETS	653 MINTHORN STREET WEST LAKE ELSINORE	Hist-Regional-UST- CA	Listed	0.17 NW	-3
<a href="#">12</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	260446 RIGHTWAY	653 W MINTHORN LAKE ELSINORE	Hist-UST-CA	Listed	0.17 NW	-3
<a href="#">12</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	79 RIGHTWAY	653 W MINTHORN LAKE ELSINOR	HWT-CA	Listed	0.17 NW	-3

MAP ID	ID/SITE NAME	ADDRESS	DATABASE	STATUS	DISTANCE (MILES)	ELEV DIFF (FEET)
<a href="#">12</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	T0606500035 RIGHTWAY PORTABLE TOILETS	653 W MINTHORN ST LAKE ELSINORE	LUST-Closed-CA	COMPLETED - CASE CLOSED	0.17 NW	-3
<a href="#">12</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	CAD092259407 RIGHTWAY	653 W MINTHORN LAKE ELSINORE	RCRA-NON-US	Listed	0.17 NW	-3
<a href="#">12</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	CAL000059230 RIGHTWAY	653 W MINTHORN ST LAKE ELSINORE	RCRA-NON-US	Listed	0.17 NW	-3
<a href="#">13</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	112507 Douglas Technology Group Inc	Not Reported by Agency	CRSP-CA	Listed	0.18 NW	-4
<a href="#">14</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	218756 BUTTERFIELD SUPVEYS INC	18740 Collier Ave Lake Elsinore	Hist-UST-CA	Listed	0.2 NW	5
<a href="#">14</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	3193660 BUTTERFIELD SURVEYS INC	18740 Collier Ave Lake Elsinore	Hist-USTReg-CA	Listed	0.2 NW	5
<a href="#">15</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	10578097 SoCal RV Doctor	29910 Ohana Cir # 102 Lake Elsinore	CERS-CA	Listed	0.22 NE	36
<a href="#">15</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	5722-RSD SoCal RV Doctor	29910 Ohana Cir #102 Lake Elsinore	County-Others-CA	Listed	0.22 NE	36
<a href="#">15</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	5708-RSD Precision Sports Inc	29910 Ohana Cir Lake Elsinore	County-Others-CA	Listed	0.22 NE	36
<a href="#">15</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	66773-RSD SoCal RV Doctor	29910 Ohana Cir #102 Lake Elsinore	County-Others-CA	Listed	0.22 NE	36
<a href="#">15</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	66758-RSD Precision Sports Inc	29910 Ohana Cir Lake Elsinore	County-Others-CA	Listed	0.22 NE	36
<a href="#">15</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	19908 LABEDA WHEELS	29910 Ohana Cir Lake Elsinore	Hist-Auto Repair	Listed	0.22 NE	36
<a href="#">15</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	CAL000129258 PRECISION SPORTS	29910 Ohana Cir Lake Elsinore	RCRA-NON-US	Listed	0.22 NE	36

MAP ID	ID/SITE NAME	ADDRESS	DATABASE	STATUS	DISTANCE (MILES)	ELEV DIFF (FEET)
<a href="#">15</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	CAL000366697 TEAM LABEDA TEST FACILITY LLC DBA SOCAL RV DOCTOR	29910 Ohana Cir Ste 102 Lake Elsinore	RCRA-NON-US	Listed	0.22 NE	36
<a href="#">15</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	402422 SoCal RV Doctor	Not Reported by Agency	CRSP-CA	Listed	0.22 NE	36
<a href="#">15</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	58562 Precision Sports Inc	Not Reported by Agency	CRSP-CA	Listed	0.22 NE	36
<a href="#">16</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	184414 Deleo Clay Tile Co Inc	Not Reported by Agency	CRSP-CA	Listed	0.24 NW	-1
<a href="#">17</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	118612-SC J S TECHNOLOGIES INC, JOHN SUHN, DBA	18650 COLLIER AVE UNIT A LAKE ELSINORE	AIR-DIST-CA	Listed	0.24 NW	4
<a href="#">17</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	2260 Comm Bldg,Lake Elsinore	18650 Collier Elsinore	WDR-CA	Listed	0.24 NW	4
<a href="#">18</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	5595-RSD Deleo Clay Tile Co Inc.	600 Chaney St Lake Elsinore	County-Others-CA	Listed	0.25 NW	0
<a href="#">18</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	66698-RSD Deleo Clay Tile Co Inc.	600 Chaney St Lake Elsinore	County-Others-CA	Listed	0.25 NW	0
<a href="#">18</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	411564 Deleo Clay Tile Co	600 CHANEY ST Lake Elsinore	ENF-SMARTS-CA	Historical	0.25 NW	0
<a href="#">18</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	232632 Deleo Clay Tile Co	600 CHANEY ST Lake Elsinore	ENF-SMARTS-CA	Historical	0.25 NW	0
<a href="#">18</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	233686 Deleo Clay Tile Co	600 CHANEY ST Lake Elsinore	ENF-SMARTS-CA	Historical	0.25 NW	0
<a href="#">18</a> Maps: <a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	400585 Deleo Clay Tile Co	600 CHANEY ST Lake Elsinore	ENF-SMARTS-CA	Active	0.25 NW	0
<a href="#">19</a> Maps: <a href="#">1</a> , <a href="#">4</a>	94051-RSD Redman Property	520 Riley St Lake Elsinore	County-LUST-CA	Listed	0.37 SE	-7

MAP ID	ID/SITE NAME	ADDRESS	DATABASE	STATUS	DISTANCE (MILES)	ELEV DIFF (FEET)
<a href="#"><u>19</u></a> Maps: <a href="#"><u>1, 4</u></a>	T0606500134 REDMAN PROPERTY	520 N Riley St Lake Elsinore	LUST-Closed-CA	COMPLETED - CASE CLOSED	0.37 SE	-7
<a href="#"><u>20</u></a> Maps: <a href="#"><u>1, 4</u></a>	88062-RSD City Yard	521 N Langstaff St Lake Elsinore	County-LUST-Closed-CA	Closed	0.39 S	-8
<a href="#"><u>20</u></a> Maps: <a href="#"><u>1, 4</u></a>	T0606500084 CITY YARD	521 N Langstaff St Lake Elsinore	LUST-Closed-CA	COMPLETED - CASE CLOSED	0.39 S	-8
<a href="#"><u>21</u></a> Maps: <a href="#"><u>1, 4</u></a>	2488 Elsinore Valley Cemetery Dist	18170 Collier Ave Lake Elsinore	SWIS-CA	Listed	0.39 NW	4
<a href="#"><u>22</u></a> Maps: <a href="#"><u>1, 4</u></a>	91081-RSD Big Al Oil Co	501 N Spring St Lake Elsinore	County-LUST-Closed-CA	Closed	0.49 SE	-5

## POTENTIAL AREAS OF CONCERN/CONTAMINATION SUMMARY

DATABASE SEARCHED	SUBJECT SITE WITHIN POTENTIAL AREA OF CONCERN	AREAS FOUND WITHIN 1-MILE RADIUS
MethaneLF-CA	No	0
LA-LF-CA	No	0
Military-Bases-US	No	0
SGV-Deep-Plumes-CA	No	0
SGV-Shallow-Plumes-Puente-Valley-CA	No	0
SGV-Shallow-Plumes-CA	No	0
NPL-Boundaries-US	No	0

## DATABASE OCCURRENCE SUMMARY

HIGH RISK* OCCURRENCES IDENTIFIED IN REQUESTED SEARCH RADIUS		
DATABASE SEARCHED	DISTANCE SEARCHED (MILES)	HIGH RISK OCCURRENCES FOUND
CorAct-Open-CA	0.5	0
County-LUST-Open-CA	0.5	0
County-SLIC-Open-CA	0.5	0
Eval-Hist-Active-CA	0.5	0
Hist-UST-Cleanup-CA	0.5	0
LUST-Open-CA	0.5	0
Military-Active-CA	1	0
NPL-Proposed-US	1	0
NPL-US	1	0
Response-CA	1	0
SAA-Agreements-US	1	0
School-Active-CA	0.5	0
SCP-Open-CA	0.5	0
SEMS-Active-US	0.5	0
State-Response-Active-CA	1	0
Superfund-Active-CA	1	0
Tribal-LUST-Open-US	0.5	0
VCP-Active-CA	0.5	0

\* For the purposes of this report, "high risk" occurrences are those that have known contamination and have not received a "case closed" or "no further action" status from the agency that maintains the records.

## ASTM/AI STANDARD RECORD SOURCES SUMMARY

STANDARD ENVIRONMENTAL RECORD SOURCES	ASTM MIN. SEARCH DIST. / ERS SEARCH DIST. (MILES)	ERS DATABASE NAME	TOTAL LISTINGS	MAP ID #'S
Federal NPL site list	1.0 / 1.0	NPL-Proposed-US	0	None Listed
		NPL-US	0	None Listed

Federal Delisted NPL site list	0.5 / 1.0	NPL-Delisted-US	0	None Listed
Federal CERCLIS list	0.5 / 0.5	SEMS-Active-US	0	None Listed
Federal CERCLIS NFRAP site list	0.5 / 0.5	SEMS-Archived-US	0	None Listed
Federal RCRA CORRACTS facilities list	1.0 / 1.0	RCRA-COR-US	0	None Listed
Federal RCRA non-CORRACTS TSD facilities list	0.5 / 0.5	RCRA-TSDF-US	0	None Listed
Federal RCRA generators list	Property and adjoining properties / 0.25	RCRA-CESQG-US	0	None Listed
		RCRA-LQG-US	0	None Listed
		RCRA-NON-US	7	<u>3, 5, 7, 12, 12, 15, 15</u>
		RCRA-SQG-US	2	<u>3, 7</u>
Federal Inst/Eng control registries	Property Only / 0.25	Controls-RCRA-US	0	None Listed
		Controls-US	0	None Listed
		Hist-US-EC	0	None Listed
		Hist-US-IC	0	None Listed
		LIENS-US	0	None Listed
Federal ERNS list	Property Only / 0.0625	ERNS-US	0	None Listed
State and Tribal-Equivalent NPL	1.0 / 1.0	Response-CA	0	None Listed
		State-Response-Active-CA	0	None Listed
		State-Response-NFA-CA	0	None Listed
		State-Response-Other-CA	0	None Listed
State and Tribal-Equivalent CERCLIS	0.5 / 0.5	Superfund-Active-CA	0	None Listed
		Superfund-NFA-CA	0	None Listed
		Superfund-Other-CA	0	None Listed
State and Tribal landfill and/or solid waste disposal sites	0.5 / 0.5	County-SWF-CA	0	None Listed
		Debris-Reg9-US	0	None Listed
		Hist-Dumps-US	0	None Listed
		Land-Disposal-CA	0	None Listed
		SWIS-CA	1	<u>21</u>
		SWLF-US	0	None Listed
		Tribal-ODI-US	0	None Listed
State and Tribal Leaking Storage Tank Lists	0.5 / 0.5	County-LUST-CA	1	<u>19</u>
		County-LUST-Closed-CA	2	<u>20, 22</u>
		County-LUST-Open-CA	0	None Listed
		Hist-UST-Cleanup-CA	0	None Listed
		LUST-Closed-CA	4	<u>3, 12, 19, 20</u>
		LUST-Open-CA	0	None Listed

		Tribal-LUST-Closed-US	0	None Listed
		Tribal-LUST-Open-US	0	None Listed
State and Tribal Registered Storage Tank Lists	Property and adjoining properties / 0.25	AST-CA	0	None Listed
		City-AST-CA	0	None Listed
		City-UST-CA	0	None Listed
		County-AST-CA	0	None Listed
		County-UST-CA	0	None Listed
		FEMA-UST-US	0	None Listed
		Hist-AST2-CA	0	None Listed
		Hist-UST-CA	4	<u>3, 3, 12, 14</u>
		Military-UST-CA	0	None Listed
		Tribal-LUST-Open-US	0	None Listed
		UST-Abandoned-COMP-CA	0	None Listed
		UST-Abandoned-NCOMP-CA	0	None Listed
		UST-CA	0	None Listed
		UST-Closed-CA	0	None Listed
State and Tribal Inst/Eng Control Registries	Property Only / 0.5	UST-Priority-CA	0	None Listed
		UST-Proposed-CA	0	None Listed
		Controls-CA	0	None Listed
		Deed-CA	0	None Listed
		Hist-Controls-CA	0	None Listed
State and Tribal Voluntary Cleanup Sites	0.5 / 0.5	HWMP-Controls-CA	0	None Listed
		Liens-CA	0	None Listed
		Military-Active-CA	0	None Listed
		Military-NFA-CA	0	None Listed
		Military-Other-CA	0	None Listed
		School-Active-CA	0	None Listed
		School-NFA-CA	0	None Listed
		School-Other-CA	0	None Listed
		VCP-Active-CA	0	None Listed
		VCP-NFA-CA	0	None Listed
State and Tribal Brownfield Sites	0.5 / 0.5	VCP-Other-CA	0	None Listed
		BF-MOA-CA	0	None Listed
		BF-Tribal-US	0	None Listed

#### FEDERAL ASTM/AI DATABASES

DATABASE SEARCHED	DISTANCE SEARCHED	SUBJECT SITE	0.125 MILES	0.25 MILES	0.5 MILES	1.0 MILES	TOTAL
BF-Tribal-US	0.5	0	0	0	0	-	0
BF-US	0.5	0	0	0	0	-	0
Controls-RCRA-US	0.5	0	0	0	0	-	0
Controls-US	0.5	0	0	0	0	-	0
Debris-Reg9-US	0.5	0	0	0	0	-	0

FEDERAL ASTM/AI DATABASES							
DATABASE SEARCHED	DISTANCE SEARCHED	SUBJECT SITE	0.125 MILES	0.25 MILES	0.5 MILES	1.0 MILES	TOTAL
ERNS-US	0.0625	0	0	-	-	-	0
FTTS-ENF-US	0.25	0	0	0	-	-	0
Hist-Dumps-US	0.5	0	0	0	0	-	0
Hist-FEMA-UST-US	0.25	0	0	0	-	-	0
Hist-US-EC	0.5	0	0	0	0	-	0
Hist-US-IC	0.5	0	0	0	0	-	0
HMIS-US	0.0625	0	0	-	-	-	0
LIENS-US	0.0625	0	0	-	-	-	0
NPL-Delisted-US	1	0	0	0	0	0	0
NPL-Proposed-US	1	0	0	0	0	0	0
NPL-US	1	0	0	0	0	0	0
PADS-US	0.0625	0	0	-	-	-	0
PCB-US	0.25	0	0	0	-	-	0
RCRA-CESQG-US	0.25	0	0	0	-	-	0
RCRA-COR-US	1	0	0	0	0	0	0
RCRA-LQG-US	0.25	0	0	0	-	-	0
RCRA-NON-US	0.25	0	3	4	-	-	7
RCRA-SQG-US	0.25	0	2	0	-	-	2
RCRA-TSDF-US	0.5	0	0	0	0	-	0
SAA-Agreements-US	1	0	0	0	0	0	0
SEMS-Active-US	0.5	0	0	0	0	-	0
SEMS-Archived-US	0.5	0	0	0	0	-	0
SWLF-US	0.5	0	0	0	0	-	0
Tribal-LUST-Closed-US	0.5	0	0	0	0	-	0
Tribal-LUST-Open-US	0.5	0	0	0	0	-	0
Tribal-ODL-US	0.5	0	0	0	0	-	0
Tribal-UST-US	0.25	0	0	0	-	-	0

STATE ASTM/AI DATABASES							
DATABASE SEARCHED	DISTANCE SEARCHED	SUBJECT SITE	0.125 MILES	0.25 MILES	0.5 MILES	1.0 MILES	TOTAL
AST-CA	0.25	0	0	0	-	-	0
BF-MOA-CA	0.5	0	0	0	0	-	0
BZ-HazWaste-CA	0.5	0	0	0	0	-	0
CERS-CA	0.25	0	0	1	-	-	1
CHMIRS-CA	0.0625	0	0	-	-	-	0
City-AST-CA	0.25	0	0	0	-	-	0
City-CUPA-CA	0.25	0	0	0	-	-	0
City-Others-CA	0.25	0	0	0	-	-	0
City-UST-CA	0.25	0	0	0	-	-	0
Controls-CA	0.5	0	0	0	0	-	0
CorAct-Closed-CA	0.5	0	0	0	0	-	0
CorAct-Open-CA	0.5	0	0	0	0	-	0
CorAct-Other-CA	0.5	0	0	0	0	-	0
CORTESE-CA	0.25	0	0	0	-	-	0
County-AST-CA	0.25	0	0	0	-	-	0
County-Hist-CA	0.25	0	0	0	-	-	0
County-LUST-CA	0.5	0	0	0	1	-	1
County-LUST-Closed-CA	0.5	0	0	0	2	-	2
County-LUST-Open-CA	0.5	0	0	0	0	-	0
County-Others-CA	0.25	0	0	9	-	-	9
County-SLIC-Closed-CA	0.25	0	0	0	-	-	0
County-SLIC-Open-CA	0.5	0	0	0	0	-	0

STATE ASTM/AI DATABASES							
DATABASE SEARCHED	DISTANCE SEARCHED	SUBJECT SITE	0.125 MILES	0.25 MILES	0.5 MILES	1.0 MILES	TOTAL
County-SML-CA	0.5	0	0	0	0	-	0
County-SWF-CA	0.5	0	0	0	0	-	0
County-UST-CA	0.25	0	0	0	-	-	0
CRSP-CA	0.25	0	3	7	-	-	10
CUPA-CA	0.25	0	0	0	-	-	0
Deed-CA	0.5	0	0	0	0	-	0
ENF-CA	0.25	0	0	1	-	-	1
ENF-SMARTS-CA	0.25	0	0	4	-	-	4
ENF-Wastewater-CA	0.25	0	4	0	-	-	4
Eval-Hist-Active-CA	0.5	0	0	0	0	-	0
Eval-Hist-NFA-CA	0.5	0	0	0	0	-	0
Eval-Hist-Other-CA	0.5	0	0	0	0	-	0
HazWaste-CA	0.25	0	0	0	-	-	0
Hist-AST2-CA	0.25	0	0	0	-	-	0
Hist-Controls-CA	0.5	0	0	0	0	-	0
Hist-Cort-CA	0.25	0	0	0	-	-	0
HIST-R4-CA	0.25	0	0	0	-	-	0
HIST-SLIC-CV-CLOSED-CA	0.5	0	0	0	0	-	0
HIST-SLIC-CV-OPEN-CA	0.5	0	0	0	0	-	0
Hist-UST-CA	0.25	0	2	2	-	-	4
Hist-UST-Cleanup-CA	0.5	0	0	0	0	-	0
Hist-WIP-Active-CA	0.5	0	0	0	0	-	0
Hist-WIP-Backlog-CA	0.5	0	0	0	0	-	0
Hist-WIP-Historical-CA	0.5	0	0	0	0	-	0
HWIS-CA	0.0625	0	2	-	-	-	2
HWMP-Controls-CA	0.5	0	0	0	0	-	0
ICE-CA	0.25	0	0	0	-	-	0
Land-Disposal-CA	0.5	0	0	0	0	-	0
Liens-CA	0.0625	0	0	-	-	-	0
LUST-Closed-CA	0.5	0	1	1	2	-	4
LUST-Open-CA	0.5	0	0	0	0	-	0
Manifest2-RI	0.0625	0	0	-	-	-	0
Military-Active-CA	1	0	0	0	0	0	0
Military-NFA-CA	1	0	0	0	0	0	0
Military-Other-CA	1	0	0	0	0	0	0
Military-UST-CA	0.25	0	0	0	-	-	0
PR-MOA-CA	0.25	0	0	0	-	-	0
Response-CA	1	0	0	0	0	0	0
School-Active-CA	0.5	0	0	0	0	-	0
School-NFA-CA	0.5	0	0	0	0	-	0
School-Other-CA	0.5	0	0	0	0	-	0
SCP-Closed-CA	0.5	0	0	0	0	-	0
SCP-Open-CA	0.5	0	0	0	0	-	0
SML-CA	0.5	0	0	0	0	-	0
State-Response-Active-CA	1	0	0	0	0	0	0
State-Response-NFA-CA	0.5	0	0	0	0	-	0
State-Response-Other-CA	0.5	0	0	0	0	-	0
Superfund-Active-CA	1	0	0	0	0	0	0
Superfund-NFA-CA	1	0	0	0	0	0	0
Superfund-Other-CA	1	0	0	0	0	0	0
SWIS-CA	0.5	0	0	0	1	-	1
SWRCY-CA	0.5	0	0	0	0	-	0
UST-Abandoned-COMP-CA	0.25	0	0	0	-	-	0
UST-Abandoned-NCOMP-CA	0.25	0	0	0	-	-	0
UST-CA	0.25	0	0	0	-	-	0

STATE ASTM/AI DATABASES							
DATABASE SEARCHED	DISTANCE SEARCHED	SUBJECT SITE	0.125 MILES	0.25 MILES	0.5 MILES	1.0 MILES	TOTAL
UST-Closed-CA	0.25	0	0	0	-	-	0
UST-Priority-CA	0.5	0	0	0	0	-	0
UST-Proposed-CA	0.25	0	0	0	-	-	0
VCP-Active-CA	0.5	0	0	0	0	-	0
VCP-NFA-CA	0.5	0	0	0	0	-	0
VCP-Other-CA	0.5	0	0	0	0	-	0

SUPPLEMENTAL DATABASES							
DATABASE SEARCHED	DISTANCE SEARCHED	SUBJECT SITE	0.125 MILES	0.25 MILES	0.5 MILES	1.0 MILES	TOTAL
Air-CA	0.25	0	0	0	-	-	0
AIR-DIST-CA	0.25	0	3	1	-	-	4
BioFuel-US	0.25	0	0	0	-	-	0
CAF-CA	0.25	0	0	0	-	-	0
CDL-CA	0.0625	0	0	-	-	-	0
CDL-US	0.0625	0	0	-	-	-	0
CHWF-CA	0.5	0	0	0	0	-	0
Cleaners-CA	0.25	0	0	0	-	-	0
Coal-Ash-Dams-US	0.5	0	0	0	0	-	0
County-BI-CA	0.25	0	0	0	-	-	0
Dams-CA	0.25	0	0	0	-	-	0
DPR-CA	0.25	0	0	0	-	-	0
DryCleaners-CA	0.25	0	0	0	-	-	0
EGRID-US	0.5	0	0	0	0	-	0
EPA-Watch-List-US	0.25	0	0	0	-	-	0
FA-HW-CA	0.0625	0	0	-	-	-	0
FA-HW-US	0.0625	0	0	-	-	-	0
FA-SWF-CA	0.0625	0	0	-	-	-	0
FRS-US	0.0625	0	2	-	-	-	2
FTTS-INSPI-US	0.0625	0	0	-	-	-	0
FUDS-US	1	0	0	0	0	0	0
FUSRAP-US	0.25	0	0	0	-	-	0
Haulers-CA	0.0625	0	0	-	-	-	0
Hist-AFS2-US	0.25	0	0	0	-	-	0
Hist-AFS-US	0.25	0	0	0	-	-	0
Hist-AST-CA	0.25	0	0	0	-	-	0
Hist-AWS-CA	0.25	0	0	0	-	-	0
Hist-CA	0.0625	0	0	-	-	-	0
Hist-CalFID-CA	0.25	0	0	0	-	-	0
Hist-CALSITES-CA	0.25	0	0	0	-	-	0
Hist-CERCLIS-NFRAP-US	0.25	0	0	0	-	-	0
Hist-CERCLIS-US	0.25	0	0	0	-	-	0
Hist-City-UST-CA	0.25	0	0	0	-	-	0
Hist-Deed-CA	0.25	0	0	0	-	-	0
Hist-DTG-CA	0.25	0	0	0	-	-	0
Hist-ERNS-US	0.0625	0	0	-	-	-	0
Hist-FIFRA-US	0.25	0	0	0	-	-	0
Hist-FINDS-US	0.0625	0	0	-	-	-	0
Hist-HWS-CA	0.25	0	0	0	-	-	0
Hist-LUSTIS-CA	0.25	0	1	1	-	-	2
HIST-MLTS-US	0.25	0	0	0	-	-	0
HIST-MTBE-CA	0.25	0	0	0	-	-	0
Hist-NPL-US	0.25	0	0	0	-	-	0


SUPPLEMENTAL DATABASES							
DATABASE SEARCHED	DISTANCE SEARCHED	SUBJECT SITE	0.125 MILES	0.25 MILES	0.5 MILES	1.0 MILES	TOTAL
Hist-Orange-County-LF-CA	0.25	0	0	0	-	-	0
Historical-CA	0.5	0	0	0	0	-	0
Hist-Prop65-CA	0.25	0	0	0	-	-	0
Hist-RCRIS-US	0.25	0	0	0	-	-	0
Hist-Regional-LUST-CA	0.25	0	0	0	-	-	0
Hist-Regional-Other-CA	0.25	0	0	0	-	-	0
Hist-Regional-SLIC-CA	0.25	0	0	0	-	-	0
Hist-Regional-Spills-CA	0.25	0	0	0	-	-	0
Hist-Regional-SWLF-CA	0.25	0	0	0	-	-	0
Hist-Regional-UST-CA	0.25	0	1	1	-	-	2
Hist-SCL-CA	0.25	0	0	0	-	-	0
Hist-SWIS-CA	0.25	0	0	0	-	-	0
Hist-ToxicPits-CA	0.25	0	0	0	-	-	0
Hist-TRIS-US	0.25	0	0	0	-	-	0
Hist-US	0.0625	0	0	-	-	-	0
Hist-USGS-WaterWells-CA	0.0625	0	0	-	-	-	0
Hist-USTReg-CA	0.25	0	0	1	-	-	1
Hist-WaterWells-US	0.0625	0	0	-	-	-	0
Hist-WMUDS-CA	0.25	0	0	0	-	-	0
HWT-CA	0.25	0	0	1	-	-	1
ICIS-Air-US	0.0625	0	0	-	-	-	0
ICIS-FEC-US	0.0625	0	0	-	-	-	0
ICIS-NPDES-US	0.0625	0	0	-	-	-	0
LA-Waste-Haulers-CA	0.0625	0	0	-	-	-	0
Lead-Smelter-2-US	0.25	0	0	0	-	-	0
Lead-US	0.25	0	0	0	-	-	0
LMOP-US	0.5	0	0	0	0	-	0
Mines2-CA	0.0625	0	0	-	-	-	0
Mines-CA	0.0625	0	0	-	-	-	0
Mines-CDMG-CA	0.0625	0	0	-	-	-	0
MINES-US	0.0625	0	0	-	-	-	0
MLTS-US	0.0625	0	0	-	-	-	0
Mortgage-CA	0.25	0	0	0	-	-	0
MRDS-US	0.25	0	0	0	-	-	0
MWMP-CA	0.25	0	0	0	-	-	0
NCI-CA	0.25	0	0	0	-	-	0
NEI-LF-CA	0.25	0	0	0	-	-	0
NPDES-CA	0.0625	0	0	-	-	-	0
NPDES-SW-CA	0.0625	0	0	-	-	-	0
OGM-CA	0.0625	0	0	-	-	-	0
OGW-CA	0.0625	0	0	-	-	-	0
OSCF-CA	0.5	0	0	0	0	-	0
PCS-US	0.25	0	0	0	-	-	0
Perch1-CA	0.25	0	0	0	-	-	0
Perch2-CA	0.25	0	0	0	-	-	0
Project-CA	0.25	0	0	0	-	-	0
RADINFO-US	0.0625	0	0	-	-	-	0
RFG-Lab-US	0.25	0	0	0	-	-	0
RMP-US	0.0625	0	0	-	-	-	0
ROD-US	0.5	0	0	0	0	-	0
SDWIS-US	0.25	0	0	0	-	-	0
SP-CA	0.25	0	0	0	-	-	0
Spills-SSO-CA	0.0625	0	0	-	-	-	0
SSTS-US	0.0625	0	0	-	-	-	0
TierPer-CA	0.25	0	0	0	-	-	0

### SUPPLEMENTAL DATABASES

DATABASE SEARCHED	DISTANCE SEARCHED	SUBJECT SITE	0.125 MILES	0.25 MILES	0.5 MILES	1.0 MILES	TOTAL
TOMS-CA	0.0625	0	0	-	-	-	0
Tribal-Air-US	0.25	0	0	0	-	-	0
Tribal-VCP-US	0.5	0	0	0	0	-	0
TRIS2000-US	0.0625	0	0	-	-	-	0
TRIS2010-US	0.0625	0	0	-	-	-	0
TRIS80-US	0.0625	0	0	-	-	-	0
TRIS90-US	0.0625	0	0	-	-	-	0
TSCA-US	0.0625	0	0	-	-	-	0
UIC2-CA	0.0625	0	0	-	-	-	0
UIC-CA	0.0625	0	0	-	-	-	0
UMTRA-US	0.0625	0	0	-	-	-	0
USGS-Waterwells-US	0.0625	0	0	-	-	-	0
Vapor-Intrusions-US	0.5	0	0	0	0	-	0
WDR-CA	0.25	0	0	1	-	-	1

### PROPRIETARY HISTORIC DATABASES

DATABASE SEARCHED	DISTANCE SEARCHED	SUBJECT SITE	0.125 MILES	0.25 MILES	0.5 MILES	1.0 MILES	TOTAL
Hist-Agriculture	0.0625	0	0	-	-	-	0
Hist-Auto Dealers	0.0625	0	0	-	-	-	0
Hist-Auto Repair	0.25	0	0	1	-	-	1
Hist-Chemical Manufacturing	0.0625	0	0	-	-	-	0
Hist-Chemical-Storage	0.0625	0	0	-	-	-	0
Hist-Cleaners	0.25	0	0	0	-	-	0
Hist-Convenience	0.0625	0	0	-	-	-	0
Hist-Disposal-Recycle	0.0625	0	0	-	-	-	0
Hist-Food-Processors	0.0625	0	0	-	-	-	0
Hist-Gun-Ranges	0.0625	0	0	-	-	-	0
Hist-Machine Shop	0.0625	0	0	-	-	-	0
Hist-Manufacturing	0.0625	0	0	-	-	-	0
Hist-Metal Plating	0.0625	0	0	-	-	-	0
Hist-Mining	0.0625	0	0	-	-	-	0
Hist-Mortuaries	0.0625	0	0	-	-	-	0
Hist-Oil-Gas	0.0625	0	0	-	-	-	0
Hist-OilGas-Refiners	0.0625	0	0	-	-	-	0
Hist-Other	0.0625	0	0	-	-	-	0
Hist-Paint-Stores	0.0625	0	0	-	-	-	0
Hist-Petroleum	0.0625	0	0	-	-	-	0
Hist-Post-Offices	0.0625	0	0	-	-	-	0
Hist-Printers	0.0625	0	0	-	-	-	0
Hist-Rental	0.0625	0	0	-	-	-	0
Hist-RV-Dealers	0.0625	0	0	-	-	-	0
Hist-Salvage	0.0625	0	0	-	-	-	0
Hist-Service Stations	0.25	0	0	0	-	-	0
Hist-Steel-Metals	0.0625	0	0	-	-	-	0
Hist-Textile	0.0625	0	0	-	-	-	0
Hist-Transportation	0.0625	0	0	-	-	-	0
Hist-Trucking	0.0625	0	0	-	-	-	0
Hist-Vehicle-Parts	0.0625	0	0	-	-	-	0
Hist-Vehicle-Washing	0.0625	0	0	-	-	-	0

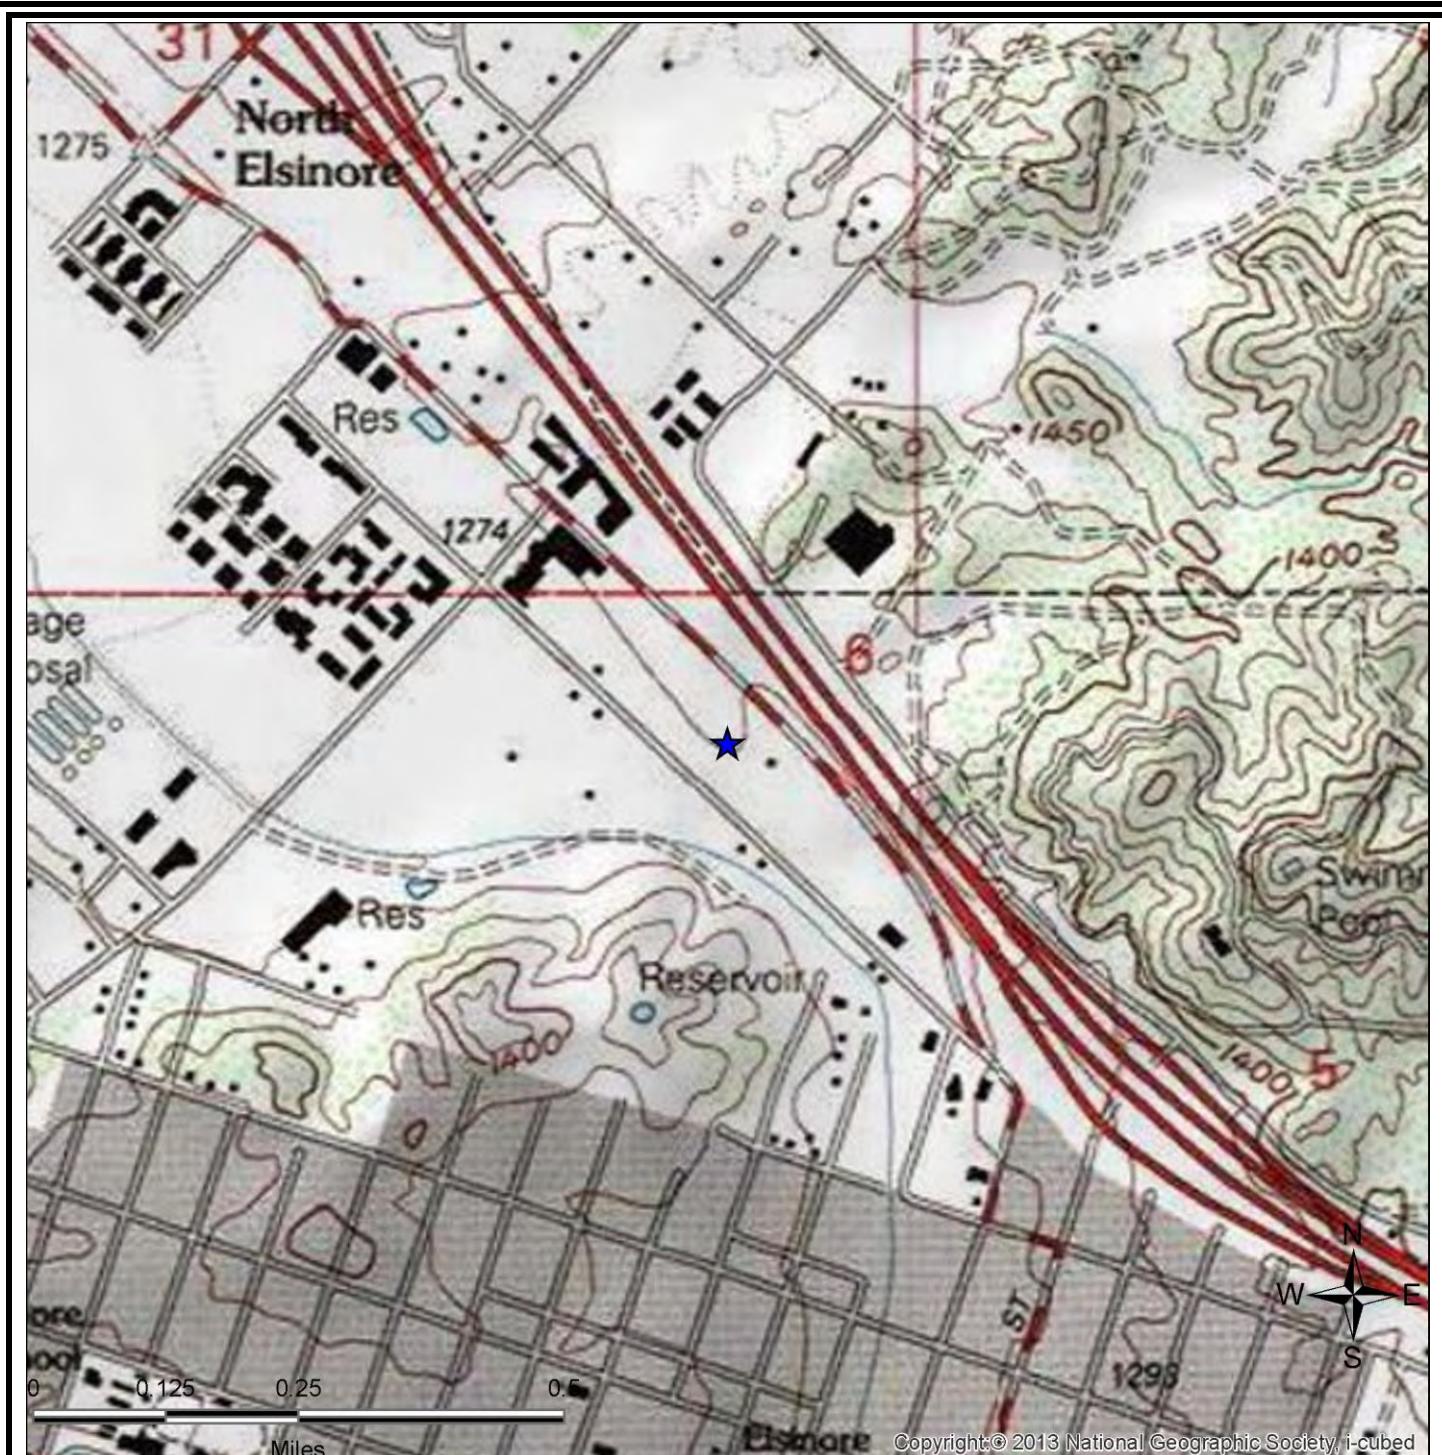


## SITE LOCATION TOPOGRAPHIC MAP

U.S. Geological Survey, Lake Elsinore (Date Unavailable) Quadrangle, 7.5 Minute Series

S&S Commercial Environmental  
Services, Inc.

Collier And Minthorn  
Lake Elsinore, CA 92530

FIGURE: 1  
JOB: 2104787850  
DATE: 10/29/2024

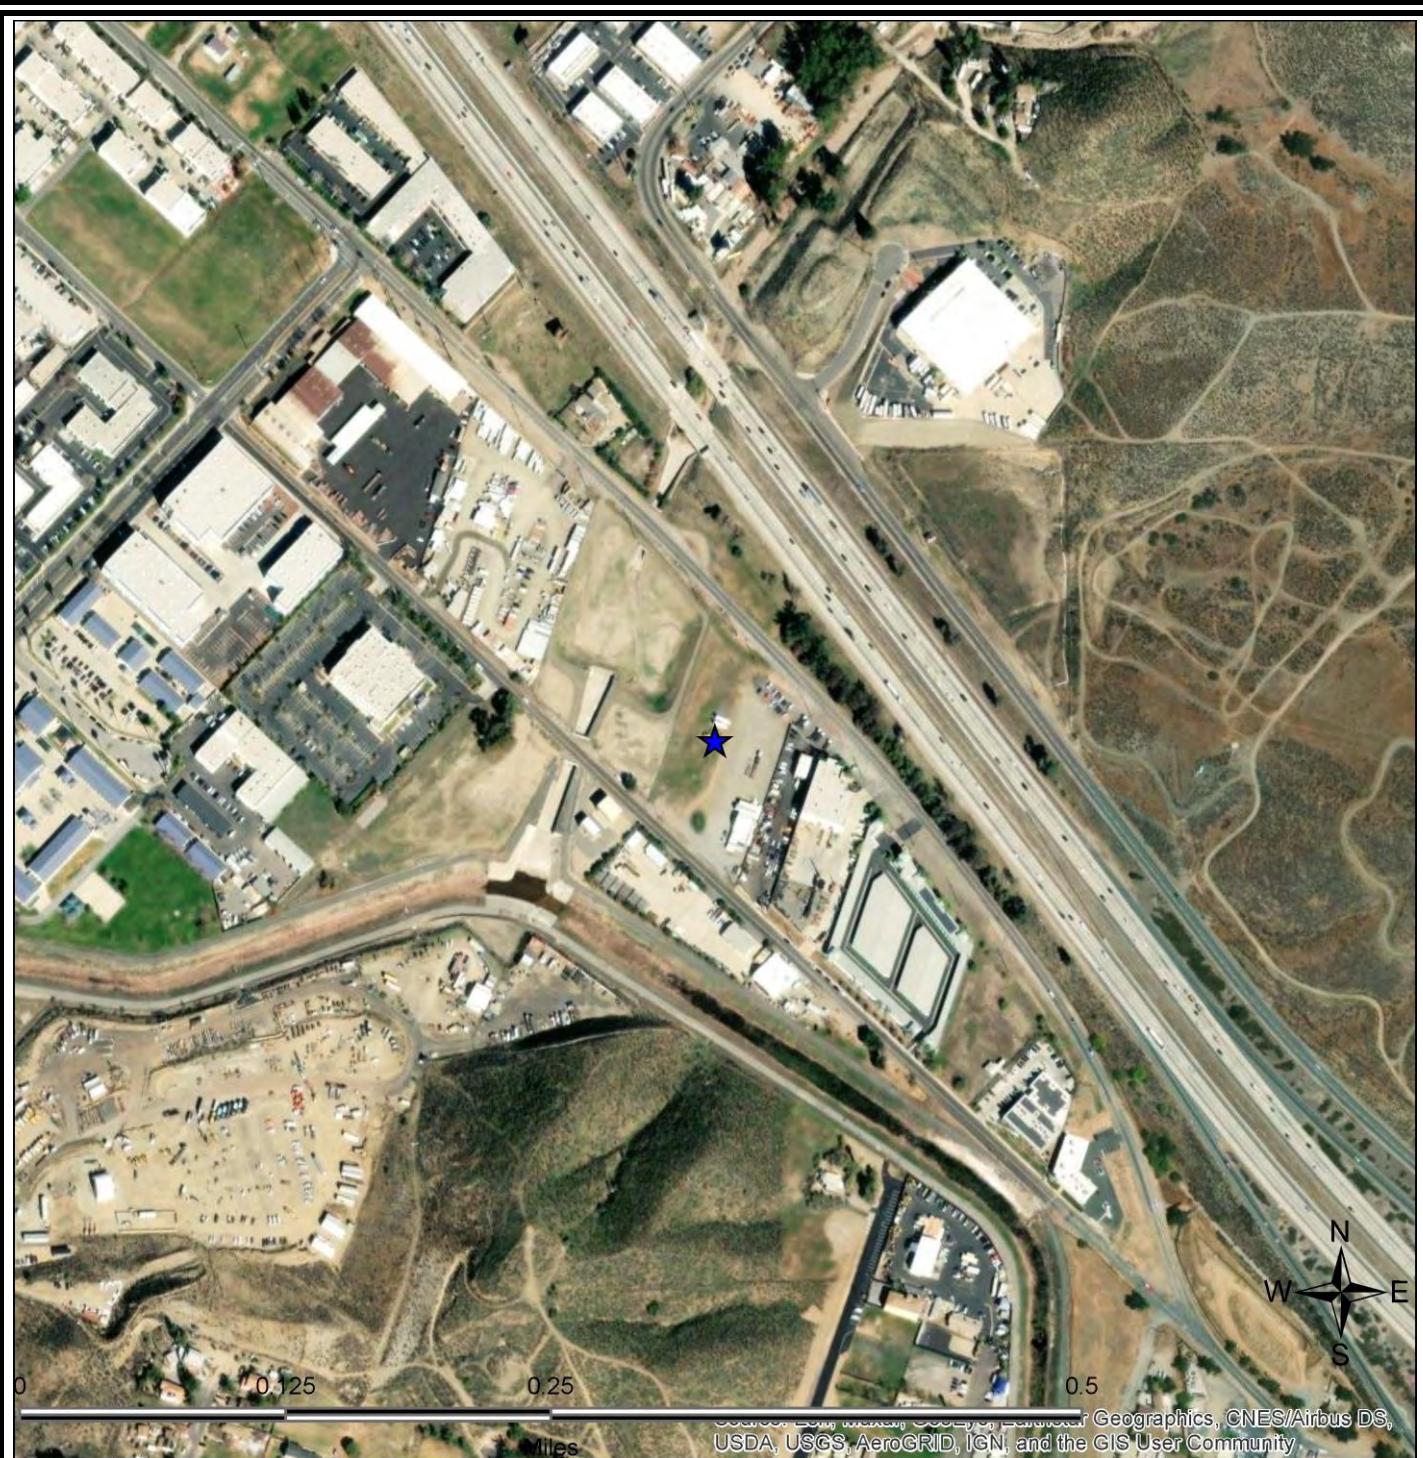


## SITE LOCATION MAP

S&S Commercial Environmental  
Services, Inc.

Collier And Minthorn  
Lake Elsinore , CA 92530


FIGURE: 2  
JOB: 2104787850  
DATE: 10/29/2024

## 1-MILE RADIUS STREET MAP W/OCCURRENCES (MAP1)

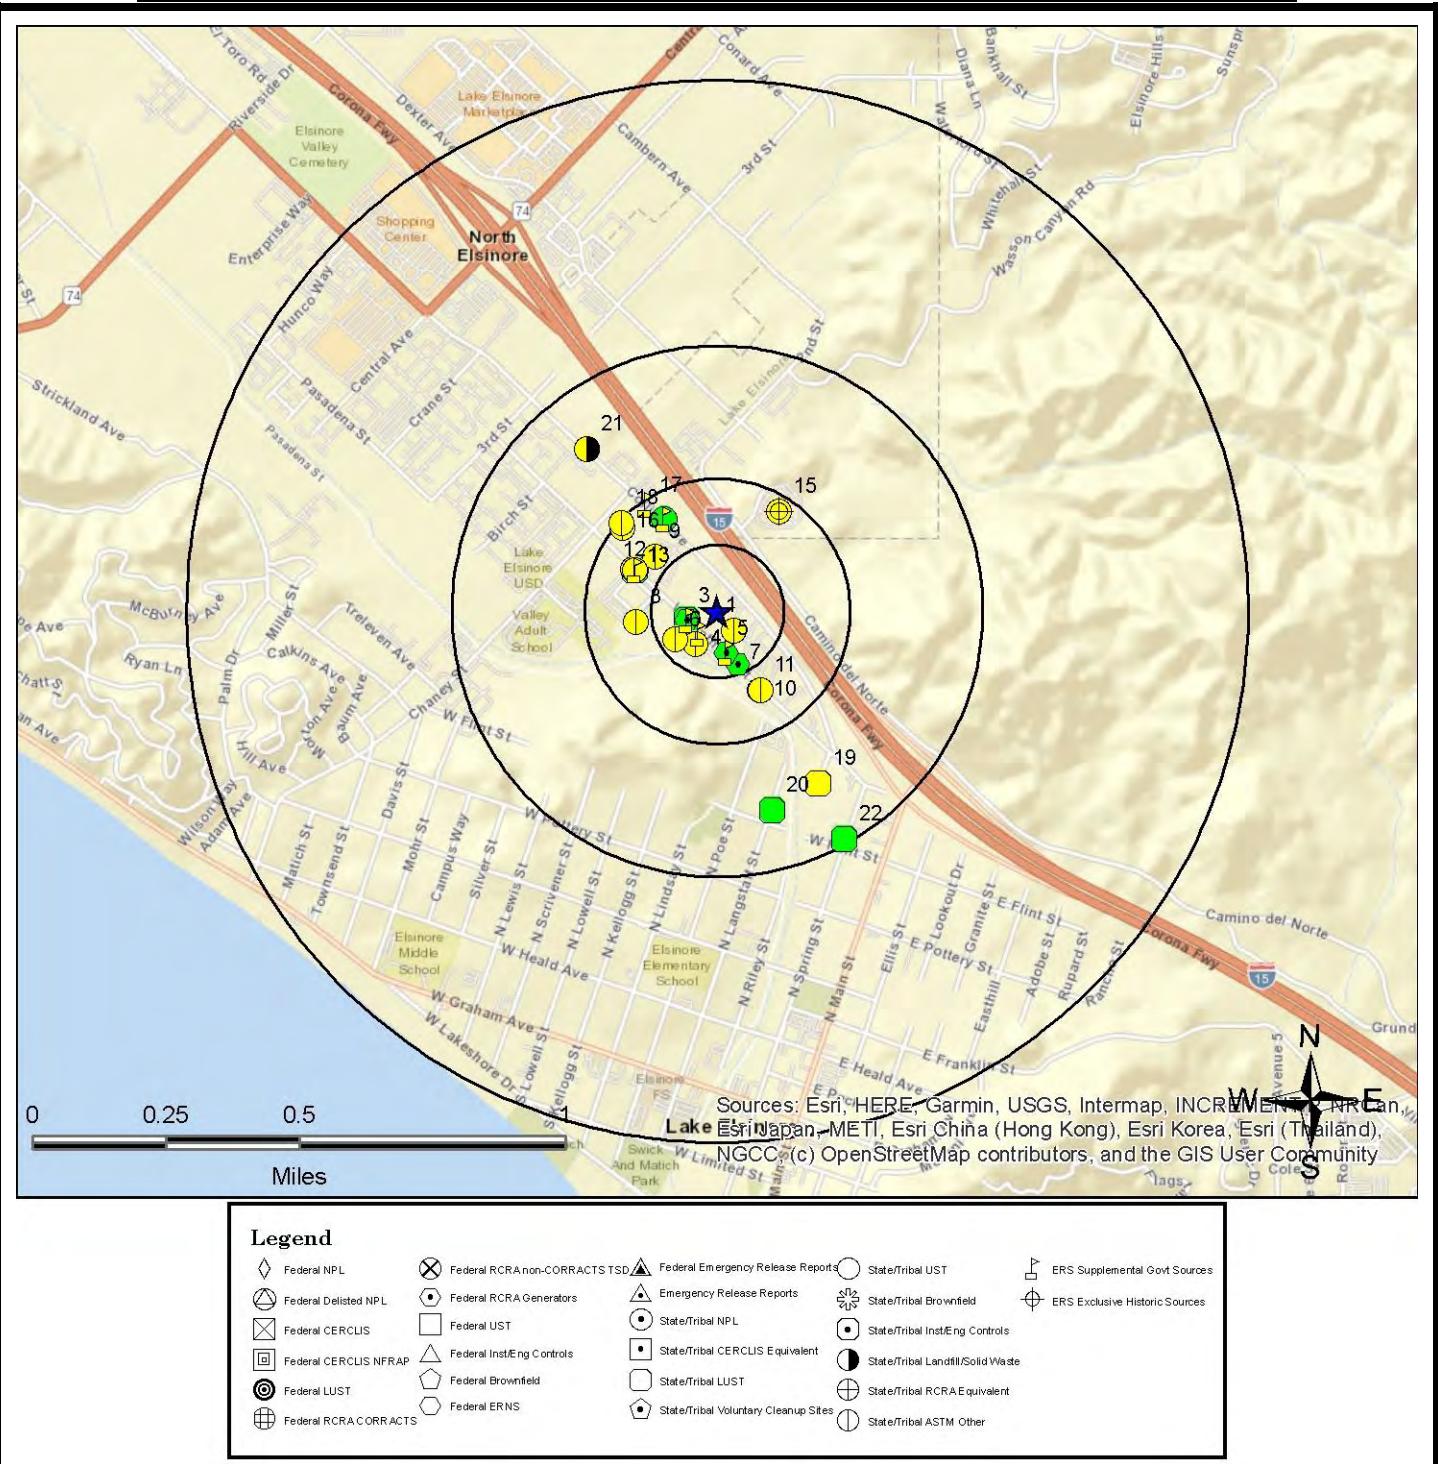


All plotted occurrences represent approximate locations based on geographic information provided by the respective agency. Actual locations may vary due to numerous reasons such as: the size of the property, accuracy of the provided location, accuracy of the software used to determine the location, etc. Occurrences are shown in three colors to give a visual indication of the potential risk of the listed occurrence based on the type of list and the current status of the occurrence. Occurrences shown in **RED** are locations with known contamination that have not received a "case closed" or "no further action" status. Occurrences shown in **YELLOW** have been listed by the respective agency, but do not always represent an environmental risk. The detailed status information and description of the listing should be reviewed for further information. Occurrences shown in **GREEN** are occurrences that have active permits or have had contamination in the past but have received a "case closed" or "no further action" status and therefore, do not likely present an environmental risk.

## 0.25-MILE RADIUS STREET MAP W/OCCURRENCES (MAP2)

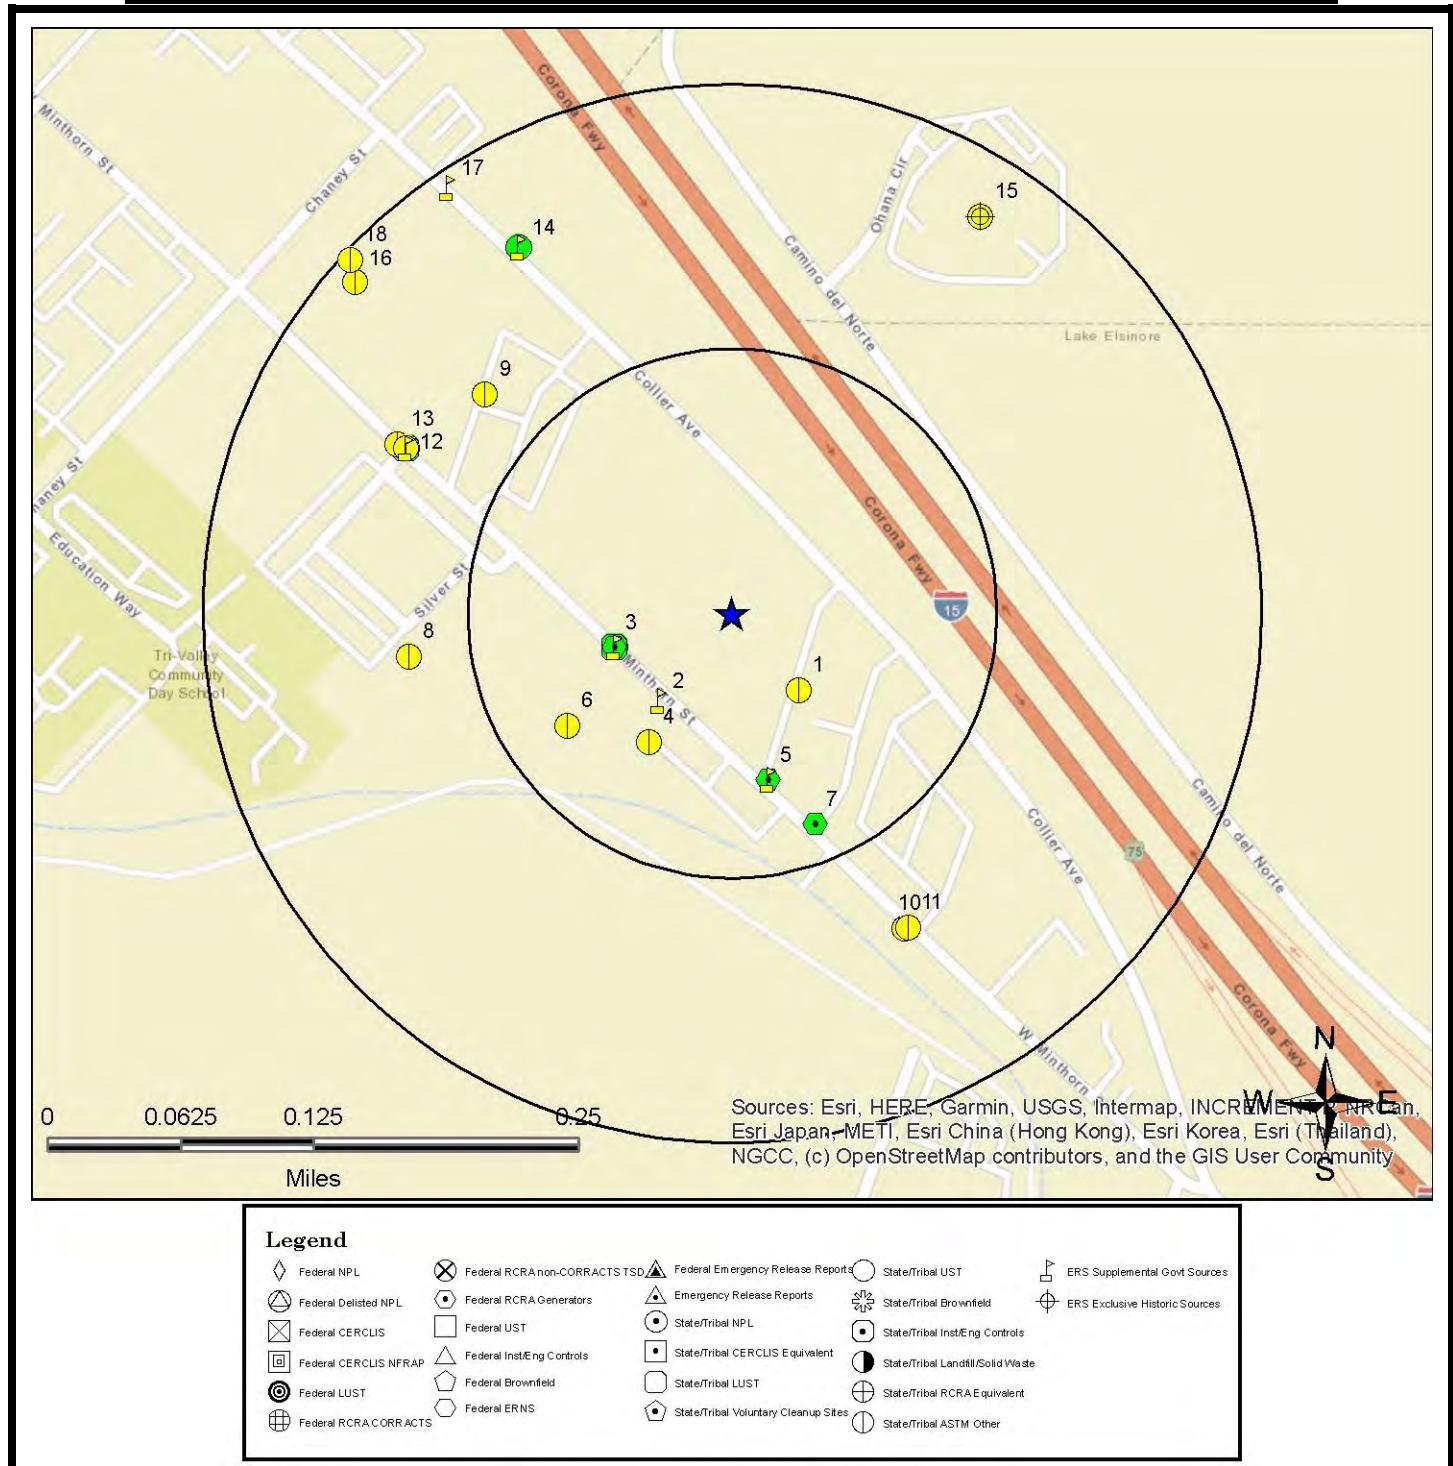


All plotted occurrences represent approximate locations based on geographic information provided by the respective agency. Actual locations may vary due to numerous reasons such as: the size of the property, accuracy of the provided location, accuracy of the software used to determine the location, etc. Occurrences are shown in three colors to give a visual indication of the potential risk of the listed occurrence based on the type of list and the current status of the occurrence. Occurrences shown in **RED** are locations with known contamination that have not received a "case closed" or "no further action" status. Occurrences shown in **YELLOW** have been listed by the respective agency, but do not always represent an environmental risk. The detailed status information and description of the listing should be reviewed for further information. Occurrences shown in **GREEN** are occurrences that have active permits or have had contamination in the past but have received a "case closed" or "no further action" status and therefore, do not likely present an environmental risk.

## 0.0625-MILE RADIUS STREET MAP W/ OCCURRENCES (MAP3)

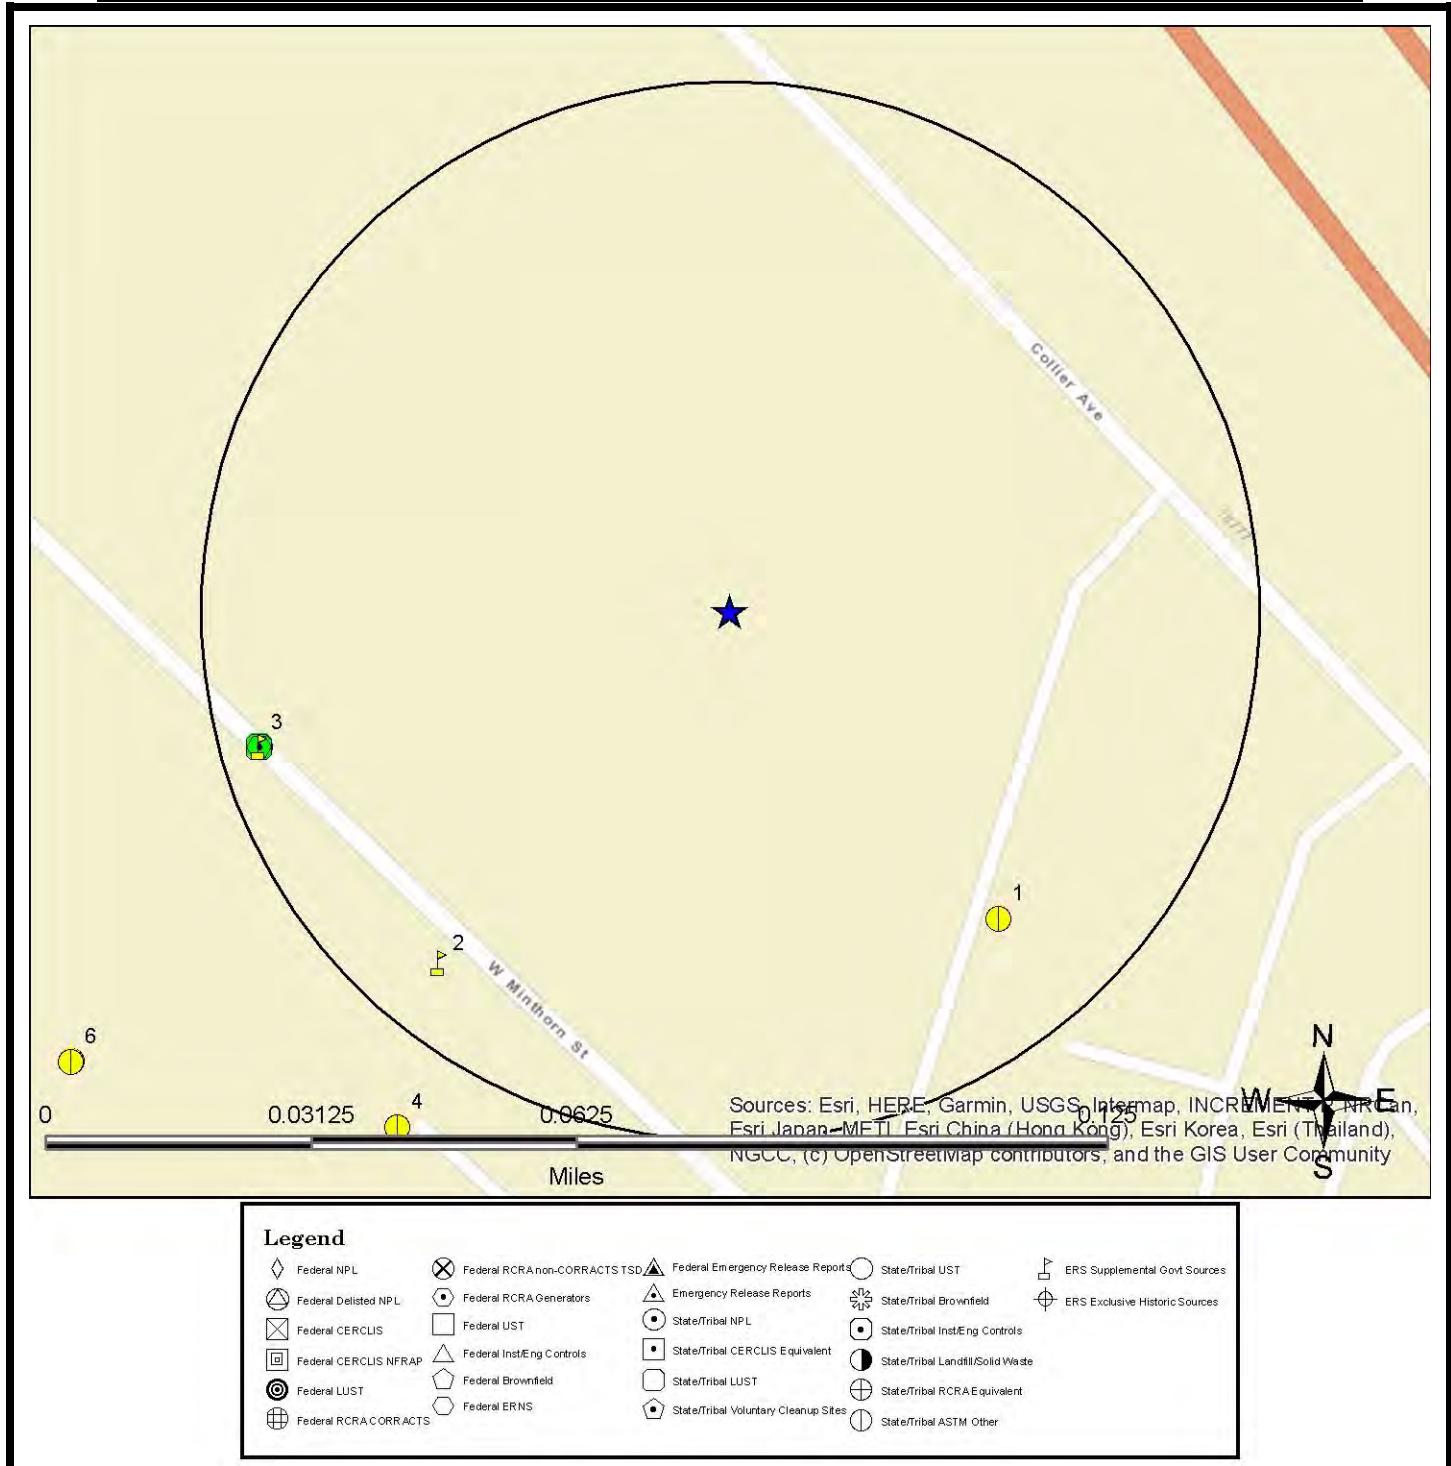

All plotted occurrences represent approximate locations based on geographic information provided by the respective agency. Actual locations may vary due to numerous reasons such as: the size of the property, accuracy of the provided location, accuracy of the software used to determine the location, etc. **Occurrences are shown in three colors** to give a visual indication of the potential risk of the listed occurrence based on the type of list and the current status of the occurrence. Occurrences shown in **RED** are locations with known contamination that have not received a "case closed" or "no further action" status. Occurrences shown in **YELLOW** have been listed by the respective agency, but do not always represent an environmental risk. The detailed status information and description of the listing should be reviewed for further information. Occurrences shown in **GREEN** are occurrences that have active permits or have had contamination in the past but have received a "case closed" or "no further action" status and therefore, do not likely present an environmental risk.


## 1-MILE TOPOGRAPHIC MAP W/OCCURRENCES (MAP4)

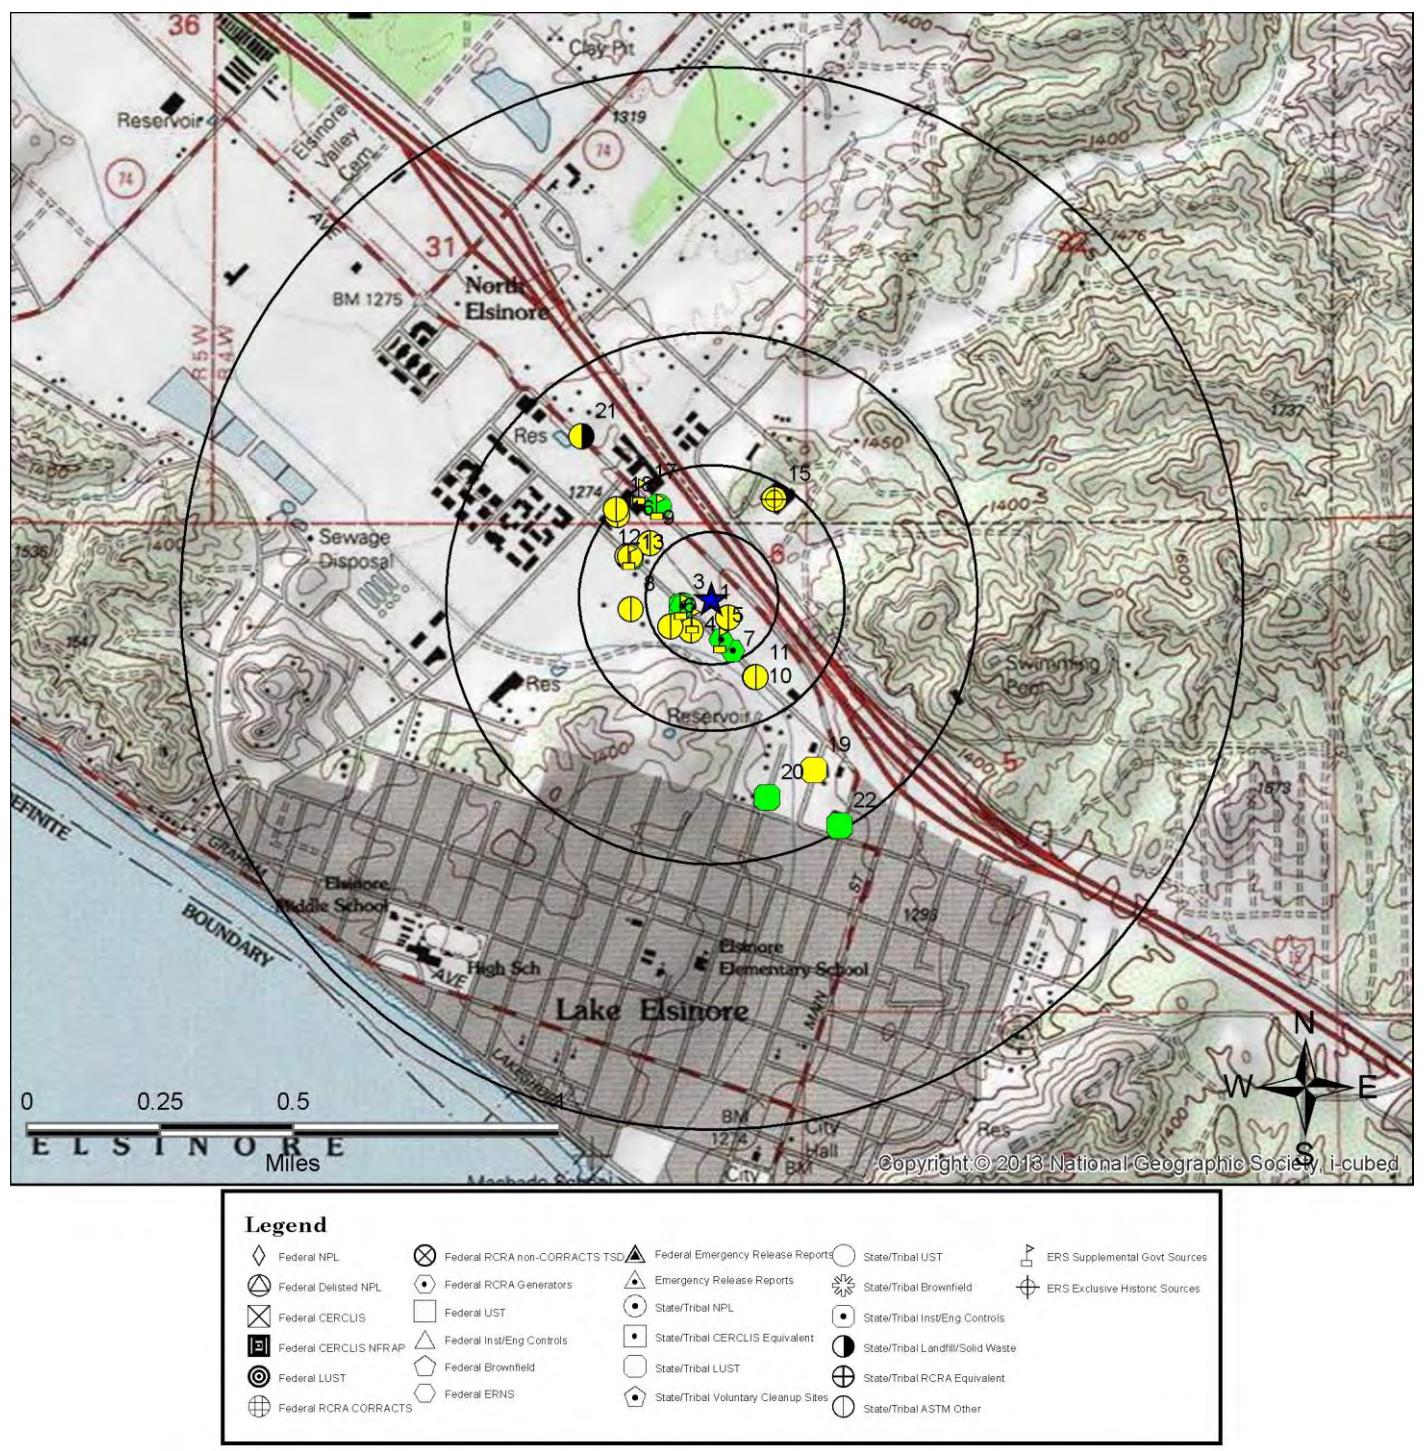

All plotted occurrences represent approximate locations based on geographic information provided by the respective agency. Actual locations may vary due to numerous reasons such as: the size of the property, accuracy of the provided location, accuracy of the software used to determine the location, etc. Occurrences are shown in three colors to give a visual indication of the potential risk of the listed occurrence based on the type of list and the current status of the occurrence. Occurrences shown in **RED** are locations with known contamination that have not received a "case closed" or "no further action" status. Occurrences shown in **YELLOW** have been listed by the respective agency, but do not always represent an environmental risk. The detailed status information and description of the listing should be reviewed for further information. Occurrences shown in **GREEN** are occurrences that have active permits or have had contamination in the past but have received a "case closed" or "no further action" status and therefore, do not likely present an environmental risk.

## AGENCY DIFFERENCES IN MAPPED LOCATIONS (MAP5)

Note: Occurrences on this map have agency provided coordinates which differ significantly from geocoded locations.

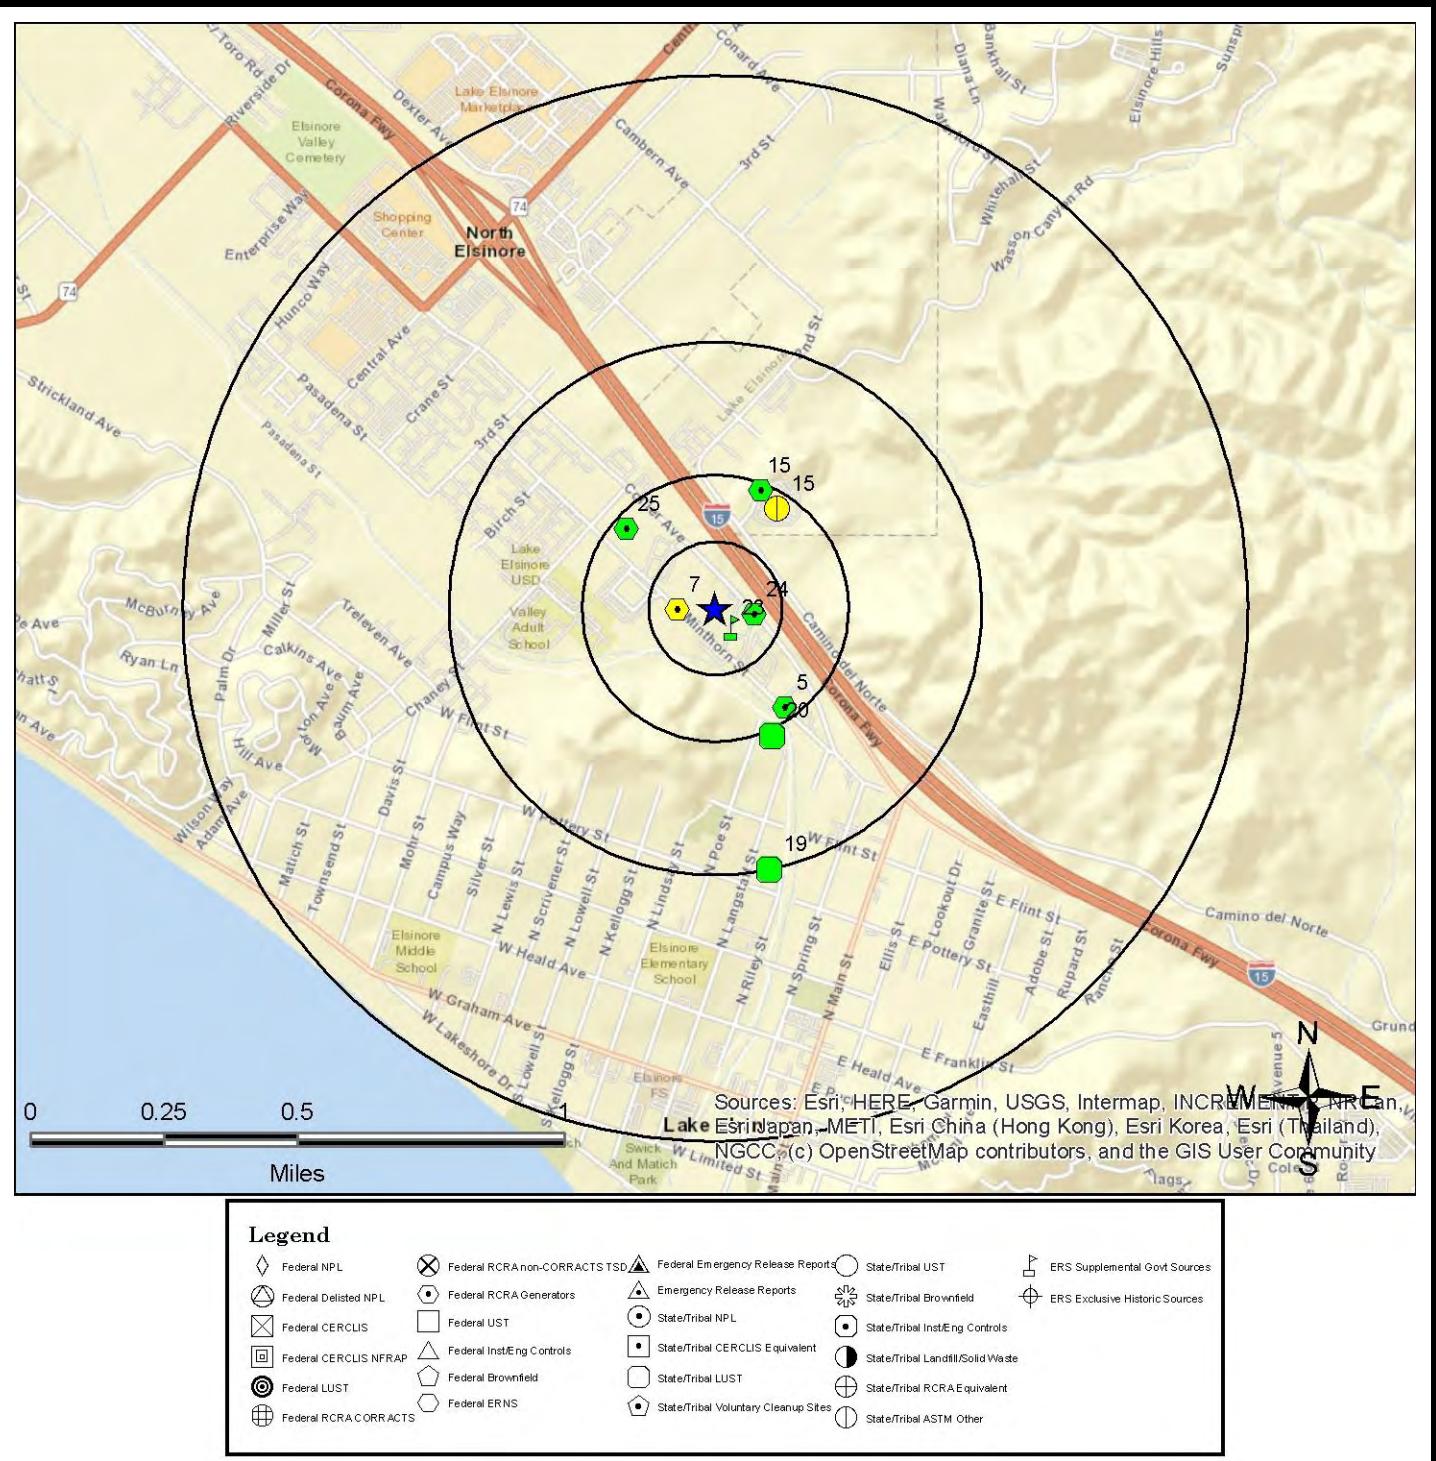

This "AGENCY DIFFERENCES IN MAPPED LOCATIONS (MAP 4)" is fully protected against reproduction in any way, shape or form by ERS Environmental Record Search. ALL applicable laws, copyrights, pending copyrights, trademarks, and any and all applicable Federal and State laws apply at all times. These protections include the concept, procedures, processes, layout, vision, color scheme, mapping layout, legends, data, any and all verbiage, and the entire concept.

## SUMMARY OF AGENCY DIFFERENCES

MAP ID	ID / SITE NAME	ADDRESS / DATABASE	AGENCY COORDINATES	DISTANCE (MILES)	DIRECTION
5	CAD052663085 THERMAL ELECTRONICS, INC	403 W Minthorn St RCRA-NON-US	-117.32803, 33.679184	0.23	SE
7	CAR000284208 ABEL'S AUTO REPAIR LLC	311 W Minthorn St Ste 4 RCRA-SQG-US	-117.331542, 33.681854	0.07	W
15	10578097 SoCal RV Doctor	29910 Ohana Cir # 102 CERS-CA	-117.32829, 33.68461	0.22	NE
15	CAL000366697 TEAM LABEDA TEST FACILITY LLC DBA SOCAL RV DOCTOR	29910 Ohana Cir Ste 102 RCRA-NON-US	-117.328845, 33.685099	0.24	N
15	CAL000129258 PRECISION SPORTS	29910 Ohana Cir RCRA-NON-US	-117.328845, 33.685099	0.24	N
19	T0606500134 REDMAN PROPERTY	520 N Riley St LUST-Closed-CA	-117.3285037, 33.6747664	0.5	S
20	T0606500084 CITY YARD	521 N Langstaff St LUST-Closed-CA	-117.3284271, 33.67841564	0.26	SE
23	T0606500097 LAIDLAW TRANSIT	609 W MINTHORN ST Hist-CA	-117.329771, 33.681359	0.05	SE
24	CAL000399691 AGGREGATE CRUSHER SPECIALISTS INC DBA ACS INC	18785 Collier Ave RCRA-NON-US	-117.329048, 33.681723	0.07	E
25	CAD981568488 DELEO CLAY TILE CO INC	600 Chaney St RCRA-LQG-US	-117.333225, 33.684039	0.23	NW
25	CAL000375591 NP MECHANICAL INC	600 Chaney St RCRA-NON-US	-117.333225, 33.684039	0.23	NW

## MAPPED AIR PERMITS WITH POTENTIAL DISPERSION (MAP6)

Note: Occurrences on this map are reported in Air Quality databases. Potential air plumes are drawn in the direction of the prevailing wind.



All plotted occurrences represent approximate locations based on geographic information provided by the respective agency/source. Actual locations may vary due to numerous reasons such as: the size of the property, accuracy of the provided location, accuracy of the software used to determine the location, etc. Potential air dispersion plumes are depicted to graphically show the direction contaminants may travel based on prevailing wind data and provide a visual screening tool only. Actual direction will vary especially by season. Depending on the actual contaminant, amount released, and other variables, the distance from the source the contaminant may travel can and will vary. Interpretation and review of all the actual relevant data by an environmental professional is recommended before making any decisions, conclusions or otherwise based on the map depictions, air data, and potential air dispersion plumes.

This "MAPPED AIR PERMITS WITH POTENTIAL DISPERSION (MAP 6)" is fully protected against reproduction in any way, shape or form by ERS Environmental Record Search. ALL applicable laws, copyrights, pending copyrights, trademarks, and any and all applicable Federal and State laws apply at all times. These protections include the concept, procedures, processes, layout, vision, color scheme, mapping layout, legends, data, any and all verbiage, and the entire concept.

## LISTED OCCURRENCE DETAILS

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
CRSP-CA	Listed	0.05 miles SE	1276 ft (6 ft lower than site)	1		
<b>SITE NAME</b>		<b>MAPS</b>		<b>ID</b>		
LAIDLAW TRANSIT		<a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>		214479		
<b>ADDRESS</b>		<b>CITY</b>		<b>ZIP</b>		
Not Reported by Agency		LAKE ELSINORE		92330		
<b>DETAILS</b>						
<p>Site Regulated Program Information            Site ID: 214479            Site EI ID: T0606500097            Agency Provided Latitude: 33.681359            Agency Provided Longitude: -117.329771</p> <p>Program Description: Leaking Underground Storage Tank Cleanup Site</p> <p>Evaluation Information</p> <ul style="list-style-type: none"> <li>: Not Reported</li> <li>: Violation Information</li> <li>: Not Reported</li> <li>: Enforcement Information</li> <li>: Not Reported</li> <li>: Chemical Information</li> <li>: Not Reported</li> <li>: Coordinate Information</li> <li>: Not Reported</li> <li>:</li> </ul>						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
AIR-DIST-CA	Listed	0.05 miles SW	1277 ft (5 ft lower than site)	2
<b>SITE NAME</b>		<b>MAPS</b>		<b>ID</b>
EASTERN MUNICIPAL WATER DISTRICT		<a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>		124616-SC
<b>ADDRESS</b>		<b>CITY</b>		<b>ZIP</b>
866 MINTHORN ST		LAKE ELSINORE		92530

## DETAILS

District: South Coast AQMD

Compliance URL:

<https://xappprod.aqmd.gov/find//facility/AQMDsearch?facilityID=124616>

Note: For additional Facility, Equipment, Emissions, Hearing Board or Transportation Plan Information click on different tabs.

Facility Id: 124616

County Code: RV

County: Riverside

Facility Status Code: A

Facility Status: ACTIVE

Number of Employees: 0

Location Zip Code Extension: Not Reported

Facility Representative First Name: FELIPE

Facility Representative Last Name: GREGORIO

Location Area Code: 951

Location Phone Number: 9283777

Location Phone Extension: 6325

Mailing Address: P.O. BOX 8300

Mailing City: PERRIS

Mailing State: CA

Mailing Zip Code: 92572

Mailing Zip Code Extension: 8300

Mailing Area Code: 951

Mailing Phone Number: 9283777

Mailing Phone Extension: 6325

Mailing Representative First Name: FELIPE

Mailing Representative Last Name: GREGORIO

[More Details Link](#)

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
AIR-DIST-CA	Listed	0.06 miles W	1278 ft (4 ft lower than site)	3
SITE NAME			MAPS	ID
M & J AUTO & BODY			<a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	77669-SC
ADDRESS			CITY	ZIP
609 MINTHORN ST			LAKE ELSINORE	92532

## DETAILS

District: South Coast AQMD

Compliance URL:

<https://xappprod.aqmd.gov/find//facility/AQMDsearch?facilityID=77669>

Note: For additional Facility, Equipment, Emissions, Hearing Board or Transportation Plan Information click on different tabs.

Facility Id: 77669

County Code: RV

County: Riverside

Facility Status Code: A

Facility Status: ACTIVE

Number of Employees: 0

Location Zip Code Extension: Not Reported

Facility Representative First Name: MAURICE

Facility Representative Last Name: CARMICHAEL

Location Area Code: 213

Location Phone Number: 3759848

Location Phone Extension: Not Reported

Mailing Address: 39634 WILD FLOWER DR

Mailing City: MURRIETA

Mailing State: CA

Mailing Zip Code: 92563

Mailing Zip Code Extension: 8664

Mailing Area Code: 213

Mailing Phone Number: 3759848

Mailing Phone Extension: Not Reported

Mailing Representative First Name: MAURICE

Mailing Representative Last Name: CARMICHAEL

[More Details Link](#)

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
FRS-US	Listed	0.06 miles W	1278 ft (4 ft lower than site)	3		
SITE NAME		MAPS		ID		
LAIDLAW TRANSIT		<a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>		110065082234		
ADDRESS		CITY		ZIP		
609 W MINTHORN ST		LAKE ELSINORE		92330		
DETAILS						
FRS Facility Detail Report URL: <a href="https://frs-public.epa.gov/ords/frs_public2/fii_query_detail.disp_program_facility?p_registry_id=110065082234">https://frs-public.epa.gov/ords/frs_public2/fii_query_detail.disp_program_facility?p_registry_id=110065082234</a> Registry ID: 110065082234						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
FRS-US	Listed	0.06 miles W	1278 ft (4 ft lower than site)	3		
<b>SITE NAME</b>		<b>MAPS</b>		<b>ID</b>		
STEVES TOWING INC		<a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>		110070474323		
<b>ADDRESS</b>		<b>CITY</b>		<b>ZIP</b>		
609 W MINTHORN ST		LAKE ELSINORE				
<b>DETAILS</b>						
FRS Facility Detail Report URL: <a href="https://frs-public.epa.gov/ords/frs_public2/fii_query_detail.disp_program_facility?p_registry_id=110070474323">https://frs-public.epa.gov/ords/frs_public2/fii_query_detail.disp_program_facility?p_registry_id=110070474323</a> Registry ID: 110070474323						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
Hist-LUSTIS-CA	Listed	0.06 miles W	1278 ft (4 ft lower than site)	3		
<b>SITE NAME</b>		<b>MAPS</b>		<b>ID</b>		
LAIDLAW TRANSIT		<a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>		235566		
<b>ADDRESS</b>		<b>CITY</b>		<b>ZIP</b>		
609 MINTHORN STREET, WEST		LAKE ELSINORE		92330		
<b>DETAILS</b>						
Reported Date: 1998						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
Hist-Regional-UST-CA	Listed	0.06 miles W	1278 ft (4 ft lower than site)	3
<b>SITE NAME</b>		<b>MAPS</b>		<b>ID</b>
LAIDLAW TRANSIT		<a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>		235566
<b>ADDRESS</b>		<b>CITY</b>		<b>ZIP</b>
609 MINTHORN STREET WEST		LAKE ELSINORE		

## DETAILS

Reported Date: 1998  
 List: Region #8-Santa Ana Regional Underground Tank Database List  
 Agency: Regional Water Quality Control Board, Region #8

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
Hist-UST-CA	Listed	0.06 miles W	1278 ft (4 ft lower than site)	3
<b>SITE NAME</b>			<b>MAPS</b>	<b>ID</b>
ARA TRANSPORTATION INC			<a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	214068
<b>ADDRESS</b>			<b>CITY</b>	<b>ZIP</b>
609 MINTHORN AVE			LAKE ELSINORE	92330
<b>DETAILS</b>				
<p>Note: ID has been assigned by ERS          Tank Details:  <a href="https://documents.geotracker.waterboards.ca.gov/ustpdfs/pdf/0001f413.pdf">https://documents.geotracker.waterboards.ca.gov/ustpdfs/pdf/0001f413.pdf</a></p>				

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
Hist-UST-CA	Listed	0.06 miles W	1278 ft (4 ft lower than site)	3
<b>SITE NAME</b>			<b>MAPS</b>	<b>ID</b>
LAIDLAW TRANSIT / ELSINORE DIV			<a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	244271
<b>ADDRESS</b>			<b>CITY</b>	<b>ZIP</b>
609 MINTHORN			LAKE ELSINORE	92330
<b>DETAILS</b>				
<p>Note: ID has been assigned by ERS          Tank Details:  <a href="https://documents.geotracker.waterboards.ca.gov/ustpdfs/pdf/0001f7a3.pdf">https://documents.geotracker.waterboards.ca.gov/ustpdfs/pdf/0001f7a3.pdf</a></p>				

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
HWIS-CA	No Longer Listed	0.06 miles W	1278 ft (4 ft lower than site)	3		
SITE NAME		MAPS		ID		
STEVE'S TOWING INC		<a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>		54FDFFFA-CAL000337032		
ADDRESS		CITY		ZIP		
609 W MINTHORN ST		LAKE ELSINORE		8561800900		
DETAILS						
Previous List: HWIS-CA Archived: 4/2/2012						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
HWIS-CA	No Longer Listed	0.06 miles W	1278 ft (4 ft lower than site)	3
SITE NAME		MAPS		ID
STEVE'S TOWING INC		<a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>		CAL000337032
ADDRESS		CITY		ZIP
609 W MINTHORN ST		LAKE ELSINORE		925302801

## DETAILS

Original Database: HWIS-CA  
 Last Agency Status: Listed  
 Archive Date: 10/07/21  
 No Longer Listed-EPA ID: CAL000337032  
 Facility County: 33  
 Mailing Street: PO BOX 355  
 Mailing City: LAKE ELSINORE  
 Mailing State: CA  
 Mailing Zip: 925310355  
 Contact Name: JOHN MILLER  
 Contact Phone: 9515381400

Year: 2016  
 TONS: 0.3525  
 TSD EPA ID: UTD991301748  
 Category Code: 352  
 Category Description: Other organic solids  
 Method Description: LANDFILL OR SURFACE IMPOUNDMENT THAT WILL BE CLOSED AS LANDFILL( TO INCLUDE ON-SITE TREATMENT AND/OR STABILIZATION)

Year: 2015  
 TONS: 0.1125  
 TSD EPA ID: UTD991301748  
 Category Code: 352  
 Category Description: Other organic solids  
 Method Description: LANDFILL OR SURFACE IMPOUNDMENT THAT WILL BE CLOSED AS LANDFILL( TO INCLUDE ON-SITE TREATMENT AND/OR STABILIZATION)

Year: 2015

[More Details Link](#)

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
LUST-Closed-CA	COMPLETED - CASE CLOSED	0.06 miles W	1278 ft (4 ft lower than site)	3
SITE NAME		MAPS	ID	
LAIDLAW TRANSIT		<a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>		T0606500097
ADDRESS		CITY	ZIP	
609 W MINTHORN ST		LAKE ELSINORE		92330

## DETAILS

Global ID: T0606500097  
 Site/Facility Type: LUST CLEANUP SITE  
 County: RIVERSIDE  
 Census Tract: 6065043006  
 EPA Region: 9  
 Case Type: LUST Cleanup Site  
 Status Date: 4/4/1989  
 CUF Case: NO  
 Lead Agency: RIVERSIDE COUNTY LOP  
 Case Manager: RIV  
 Local Agency: RIVERSIDE COUNTY LOP  
 Regional Water Board Case Case Number: 083300978T  
 Potential Contaminants of Concern: Heating Oil / Fuel Oil  
 Potential Media of Concern: Soil  
 Case Begin Date: 3/2/1988  
 Leak Reported Date: 6/2/1988  
 How Leak was Discovered: Tank Closure  
 Discharge Source: Tank  
 Discharge Cause: Corrosion  
 No Further Action Date: 4/4/1989  
 CalWater Watershed Name: Santa Ana River - Lake Mathews - Terra Colta (801.35)  
 DWR Groundwater Sub-Basin Name: Elsinore - Elsinore Valley (8-004.01)  
 CalEnviroScreen 3 Percentile: 81-85%  
 CalEnviroScreen 4 Percentile: 80-85%  
 Is the site a Military or DOD site?: No  
 Regional Board Office Region: SANTA ANA RWQCB (REGION 8)

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
RCRA-NON-US	Listed	0.06 miles W	1278 ft (4 ft lower than site)	3
SITE NAME		MAPS	ID	
STEVE'S TOWING INC		<a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>	CAL000337032	
ADDRESS		CITY	ZIP	
609 W MINTHORN ST		LAKE ELSINORE	92530-2801	
DETAILS				
More Details: <a href="https://enviro.epa.gov/envirofacts/rcrainfo/facility?handlerId=CAL000337032">https://enviro.epa.gov/envirofacts/rcrainfo/facility?handlerId=CAL000337032</a> Reporting Universe: Other				

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
RCRA-SQG-US	Listed	0.06 miles W	1278 ft (4 ft lower than site)	3		
SITE NAME		MAPS		ID		
ZIEMBAS AUTO		<a href="#">1</a> , <a href="#">2</a> , <a href="#">3</a> , <a href="#">4</a>		CAD982317299		
ADDRESS		CITY		ZIP		
609 MINTHORN		LAKE ELSINORE		92530		
DETAILS						
More Details: <a href="https://enviro.epa.gov/envirofacts/rcrecinfo/facility?handlerId=CAD982317299">https://enviro.epa.gov/envirofacts/rcrecinfo/facility?handlerId=CAD982317299</a> Reporting Universe: SQG						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
CRSP-CA	Listed	0.07 miles SW	1274 ft (8 ft lower than site)	4
SITE NAME		MAPS		ID
Lake Elsinore Outlet Channel Maintenance Project		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		265854
ADDRESS		CITY		ZIP
Not Reported by Agency				

## DETAILS

### Site Regulated Program Information

Site ID: 265854

Site EI ID: 772217

Agency Provided Latitude: 33.681

Agency Provided Longitude: -117.331

Program Description: Wetlands - Fill and Dredge Material

### Evaluation Information

: Not Reported

: Violation Information

: Not Reported

: Enforcement Information

: Not Reported

: Chemical Information

: Not Reported

: Coordinate Information

: Not Reported

:

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
AIR-DIST-CA	Listed	0.08 miles S	1273 ft (9 ft lower than site)	5
SITE NAME		MAPS		ID
THERMAL ELECTRONICS INC		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		36895-SC
ADDRESS		CITY		ZIP
403 MINTHORN		LAKE ELSINORE		92530

## DETAILS

District: South Coast AQMD

Compliance URL:

<https://xappprod.aqmd.gov/find/facility/AQMDsearch?facilityID=36895>

Note: For additional Facility, Equipment, Emissions, Hearing Board or Transportation Plan Information click on different tabs.

Facility Id: 36895

County Code: RV

County: Riverside

Facility Status Code: A

Facility Status: ACTIVE

Number of Employees: 0

Location Zip Code Extension: Not Reported

Facility Representative First Name: Not Reported

Facility Representative Last Name: Not Reported

Location Area Code: Not Reported

Location Phone Number: Not Reported

Location Phone Extension: Not Reported

Mailing Address: 403 MINTHORN

Mailing City: LAKE ELSINORE

Mailing State: CA

Mailing Zip Code: 92530

Mailing Zip Code Extension: Not Reported

Mailing Area Code: Not Reported

Mailing Phone Number: Not Reported

Mailing Phone Extension: Not Reported

Mailing Representative First Name: Not Reported

Mailing Representative Last Name: Not Reported

[More Details Link](#)

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
RCRA-NON-US	Listed	0.08 miles S	1273 ft (9 ft lower than site)	5		
SITE NAME		MAPS		ID		
THERMAL ELECTRONICS, INC		<a href="#">1, 2, 4</a>		CAD052663085		
ADDRESS		CITY		ZIP		
403 W Minthorn St		Lake Elsinore		92530		
DETAILS						
<p>More Details:</p> <p><a href="https://enviro.epa.gov/envirofacts/rcriinfo/facility?handlerId=CAD052663085">https://enviro.epa.gov/envirofacts/rcriinfo/facility?handlerId=CAD052663085</a></p> <p>Reporting Universe: Other</p>						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
ENF-Wastewater-CA	Historical	0.09 miles SW	1276 ft (6 ft lower than site)	6		
SITE NAME		MAPS		ID		
Temescal Creek Outfall		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		338019		
ADDRESS		CITY		ZIP		
Not Reported by Agency						
DETAILS						
<p>ENFORCEMENT ID (EID): 338019      FACILITY NAME: Temescal Creek Outfall      PLACE SUBTYPE: Wastewater Treatment Facility      PLACE LATITUDE: 33.681111      STATUS: Historical      REGION: 8      FACILITY ID: 259196      AGENCY NAME: Eastern Municipal Water District      PLACE TYPE: Utility      PLACE LONGITUDE: -117.331667      WDID: 8 332303001      REG MEASURE ID: 133107      REG MEASURE TYPE: NPDES Permits      ORDER / RESOLUTION NUMBER: R8-2006-0069      ENFORCEMENT ACTION TYPE: Admin Civil Liability      EFFECTIVE DATE: 12/15/2006      ACL ISSUANCE DATE: 12/15/2006      TITLE: MPC No. R8-2006-0069 for EMWD      DESCRIPTION: Issued Mandatory Penalty Complaint to address minimum mandatory penalties accrued from 7 (seven) effluent limit violations for Aluminum and chlorine residual, which occurred between Jan-05 &amp; Mar-06.      PROGRAM: NPPDMUNILRG      PROGRAM CATEGORY: NPDESWW      TOTAL ASSESSMENT AMOUNT: 21000      INITIAL ASSESSED AMOUNT: 0      LIABILITY \$ AMOUNT: 10500      PROJECT \$ AMOUNT: 0      LIABILITY \$ PAID: 10500      PROJECT \$ COMPLETED: 0       </p> <p><a href="#">More Details Link</a></p>						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
ENF-Wastewater-CA	Historical	0.09 miles SW	1276 ft (6 ft lower than site)	6		
SITE NAME		MAPS		ID		
Temescal Creek Outfall		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		221849		
ADDRESS		CITY		ZIP		
Not Reported by Agency						
DETAILS						
<p>ENFORCEMENT ID (EID): 221849      FACILITY NAME: Temescal Creek Outfall      PLACE SUBTYPE: Wastewater Treatment Facility      PLACE LATITUDE: 33.681111      STATUS: Historical      REGION: 8      FACILITY ID: 259196      AGENCY NAME: Eastern Municipal Water District      PLACE TYPE: Utility      PLACE LONGITUDE: -117.331667      WDID: 8 332303001      REG MEASURE ID: 133107      REG MEASURE TYPE: NPDES Permits      ORDER / RESOLUTION NUMBER: R8-1998-0106      ENFORCEMENT ACTION TYPE: Admin Civil Liability      EFFECTIVE DATE: 12/18/1998      TERMINATION DATE: 10/2/2003      TITLE: Enforcement - 8 332303001      DESCRIPTION: 13385-CHLORINE DISCHARGE TO TEMESCAL CREEK SEP-DAIRY RUNOFF SAMPLING      PROGRAM: NPDMUNILRG      PROGRAM CATEGORY: NPDESWW      TOTAL ASSESSMENT AMOUNT: 10000      INITIAL ASSESSED AMOUNT: 0      LIABILITY \$ AMOUNT: 2000      PROJECT \$ AMOUNT: 0      LIABILITY \$ PAID: 2000      PROJECT \$ COMPLETED: 0   </p> <p><a href="#">More Details Link</a></p>						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
ENF-Wastewater-CA	Historical	0.09 miles SW	1276 ft (6 ft lower than site)	6		
SITE NAME		MAPS		ID		
Temescal Creek Outfall		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		253277		
ADDRESS		CITY		ZIP		
Not Reported by Agency						
DETAILS						
<p>ENFORCEMENT ID (EID): 253277      FACILITY NAME: Temescal Creek Outfall      PLACE SUBTYPE: Wastewater Treatment Facility      PLACE LATITUDE: 33.681111      STATUS: Historical      REGION: 8      FACILITY ID: 259196      AGENCY NAME: Eastern Municipal Water District      PLACE TYPE: Utility      PLACE LONGITUDE: -117.331667      WDID: 8 332303001      REG MEASURE ID: 147651      REG MEASURE TYPE: NPDES Permits      ORDER / RESOLUTION NUMBER: R8-2004-0100      ENFORCEMENT ACTION TYPE: Admin Civil Liability      EFFECTIVE DATE: 11/16/2004      TITLE: MPC R8-2004-0100 for EMWD      DESCRIPTION: For violations of Se &amp; cyanide in January &amp; February 2004      PROGRAM: NPDMUNILRG      PROGRAM CATEGORY: NPDESWW      TOTAL ASSESSMENT AMOUNT: 12000      INITIAL ASSESSED AMOUNT: 12000      LIABILITY \$ AMOUNT: 12000      PROJECT \$ AMOUNT: 0      LIABILITY \$ PAID: 12000      PROJECT \$ COMPLETED: 0      TOTAL \$ PAID/COMPLETED AMOUNT: 12000   </p> <p><a href="#">More Details Link</a></p>						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
ENF-Wastewater-CA	Historical	0.09 miles SW	1276 ft (6 ft lower than site)	6		
SITE NAME		MAPS		ID		
Temescal Creek Outfall		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		251510		
ADDRESS		CITY		ZIP		
Not Reported by Agency						
DETAILS						
<p>ENFORCEMENT ID (EID): 251510      FACILITY NAME: Temescal Creek Outfall      PLACE SUBTYPE: Wastewater Treatment Facility      PLACE LATITUDE: 33.681111      STATUS: Historical      REGION: 8      FACILITY ID: 259196      PLACE TYPE: Utility      PLACE LONGITUDE: -117.331667      ORDER / RESOLUTION NUMBER: R8-2004-0045      ENFORCEMENT ACTION TYPE: Admin Civil Liability      EFFECTIVE DATE: 3/11/2004      TITLE: MPC R8-2004-0045 for EMWD      DESCRIPTION: Issued to address chlorine residual (6 violations), cyanide (1), iron (1), Turbidity (2), selenium (2), and Mercury (1) violations from discharge to Temescal Creek from March 2001 to December 2003.      PROGRAM: NPDESWW      PROGRAM CATEGORY: NPDESWW      TOTAL ASSESSMENT AMOUNT: 30000      INITIAL ASSESSED AMOUNT: 0      LIABILITY \$ AMOUNT: 30000      PROJECT \$ AMOUNT: 0      LIABILITY \$ PAID: 30000      PROJECT \$ COMPLETED: 0      TOTAL \$ PAID/COMPLETED AMOUNT: 30000      Location 1: (33.681111, -117.331667)</p>						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
CRSP-CA	Listed	0.09 miles SW	1276 ft (6 ft lower than site)	6
SITE NAME		MAPS		ID
Temescal Creek Outfall		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		74331
ADDRESS		CITY		ZIP
Not Reported by Agency		LAKE ELSINORE		

## DETAILS

### Site Regulated Program Information

Site ID: 74331

Site EI ID: 259196

Agency Provided Latitude: 33.681111

Agency Provided Longitude: -117.331667

Program Description: NPDES Wastewater and Stormwater

### Evaluation Information

Evaluation Date: 5/16/2018

Violations Found? (Y/N): No

Evaluation General Type: Compliance Evaluation Inspection

Evaluation Type: RWQCB Type B compliance inspection

Evaluation Note(s): Not Reported

Evaluation Division: Water Boards

Evaluation Program: NPDMUNILRG

Evaluation Source: CIWQS

Evaluation Date: 2/3/2016

Violations Found? (Y/N): No

Evaluation General Type: Compliance Evaluation Inspection

Evaluation Type: RWQCB Type B compliance inspection

Evaluation Note(s): Not Reported

Evaluation Division: Water Boards

Evaluation Program: NPDMUNILRG

Evaluation Source: CIWQS

[More Details Link](#)

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
RCRA-NON-US	Listed	0.1 miles S	1270 ft (12 ft lower than site)	7
SITE NAME		MAPS	ID	
NET DEVELOPMENT CO.		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	CAC003030691	
ADDRESS		CITY	ZIP	
311 W Minthorn St		Lake Elsinore	92530	
DETAILS				
<p>More Details:  <a href="https://enviro.epa.gov/envirofacts/rcriinfo/facility?handlerId=CAC003030691">https://enviro.epa.gov/envirofacts/rcriinfo/facility?handlerId=CAC003030691</a></p> <p>Reporting Universe: Other</p>				

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
RCRA-SQG-US	Listed	0.1 miles S	1270 ft (12 ft lower than site)	7		
SITE NAME		MAPS		ID		
ABEL'S AUTO REPAIR LLC		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		CAR000284208		
ADDRESS		CITY		ZIP		
311 W Minthorn St Ste 4		Lake Elsinore		92530		
DETAILS						
More Details: <a href="https://enviro.epa.gov/envirofacts/rcrecinfo/facility?handlerId=CAR000284208">https://enviro.epa.gov/envirofacts/rcrecinfo/facility?handlerId=CAR000284208</a> Reporting Universe: SQG						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
CRSP-CA	Listed	0.15 miles W	1274 ft (8 ft lower than site)	8
SITE NAME		MAPS		ID
Lake Elsinore Inflatable Dam Installation		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		319242
ADDRESS		CITY		ZIP
Not Reported by Agency				

## DETAILS

### Site Regulated Program Information

Site ID: 319242

Site EI ID: 783611

Agency Provided Latitude: 33.68158

Agency Provided Longitude: -117.33297

Program Description: Wetlands - Fill and Dredge Material

### Evaluation Information

: Not Reported

: Violation Information

: Not Reported

: Enforcement Information

: Not Reported

: Chemical Information

: Not Reported

: Coordinate Information

: Not Reported

:

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
CRSP-CA	Listed	0.16 miles NW	1281 ft (1 ft lower than site)	9
SITE NAME		MAPS		ID
Rightway Portable Toilets		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		61661
ADDRESS		CITY		ZIP
Not Reported by Agency		LAKE ELSINORE		92530

## DETAILS

### Site Regulated Program Information

Site ID: 61661

Site EI ID: 10316641

Agency Provided Latitude: 33.683379

Agency Provided Longitude: -117.33235

Program Description: Chemical Storage Facilities

Program Description: Hazardous Waste Generator

Program Description: Leaking Underground Storage Tank Cleanup Site

Program Description: Underground Storage Tank

### Evaluation Information

Evaluation Date: 11/29/2018

Violations Found? (Y/N): Yes

Evaluation General Type: Compliance Evaluation Inspection

Evaluation Type: Routine done by local agency

Evaluation Note(s): Not Reported

Evaluation Division: Riverside County Department of Env Health

Evaluation Program: HW

Evaluation Source: CERS

Evaluation Date: 11/29/2018

Violations Found? (Y/N): Yes

[More Details Link](#)

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
CRSP-CA	Listed	0.17 miles SE	1267 ft (15 ft lower than site)	10
SITE NAME			MAPS	ID
EMWD Reach 4 Dissipitation Facility			<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	28303
ADDRESS		CITY	ZIP	
Not Reported by Agency		LAKE ELSINORE	92530	

## DETAILS

### Site Regulated Program Information

Site ID: 28303

Site EI ID: 10322920

Agency Provided Latitude: 33.67973

Agency Provided Longitude: -117.3289

Program Description: Chemical Storage Facilities

### Evaluation Information

Evaluation Date: 2/9/2017

Violations Found? (Y/N): No

Evaluation General Type: Compliance Evaluation Inspection

Evaluation Type: Routine done by local agency

Evaluation Note(s): Not Reported

Evaluation Division: Riverside County Department of Env Health

Evaluation Program: HMRRP

Evaluation Source: CERS

### Violation Information

: Not Reported

: Enforcement Information

: Not Reported

: Chemical Information

: Not Reported

: Coordinate Information

[More Details Link](#)

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
County-Others-CA	Listed	0.17 miles SE	1266 ft (16 ft lower than site)	11
SITE NAME			MAPS	ID
EMWD Reach 4 Dissipitation Facility			<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	5607-RSD
ADDRESS			CITY	ZIP
636 Minthorn St			Lake Elsinore	92530
DETAILS				
Agency: Riverside County Department of Environmental Health, Hazardous Materials Management Branch Note: This is an ERS assigned ID County: Riverside Type: Disclosure Facility List				

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
County-Others-CA	Listed	0.17 miles NW	1279 ft (3 ft lower than site)	12		
SITE NAME		MAPS		ID		
Rightway Portable Toilets		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		66761-RSD		
ADDRESS		CITY		ZIP		
653 W Minthorn St		Lake Elsinore		92530		
DETAILS						
Agency: Riverside County Department of Environmental Health Note: This is an ERS assigned ID County: Riverside Type: Generator Agency Provided Latitude: Not Reported Agency Provided Longitude: Not Reported						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
County-Others-CA	Listed	0.17 miles NW	1279 ft (3 ft lower than site)	12		
SITE NAME		MAPS		ID		
Rightway Portable Toilets		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		5713-RSD		
ADDRESS		CITY		ZIP		
653 W Minthorn St		Lake Elsinore		92530		
DETAILS						
Agency: Riverside County Department of Environmental Health, Hazardous Materials Management Branch Note: This is an ERS assigned ID County: Riverside Type: Disclosure Facility List						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
ENF-CA	Listed	0.17 miles NW	1279 ft (3 ft lower than site)	12		
SITE NAME		MAPS		ID		
RIGHTWAY PORTABLE TOILETS		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		55715		
ADDRESS		CITY		ZIP		
653 W MINTHORN ST		LAKE ELSINORE		92330		
DETAILS						
<p>Note: This is an ERS generated SOURCEID          SOURCEID: 55715          Global ID: T0607301511          Action Type: ENFORCEMENT          Action Date: 4/4/1989          Action Taken: Closure/No Further Action Letter          Street Number: 653          Street Name: W MINTHORN ST          Status: Completed - Case Closed          Status Date: 4/4/1989          County: Riverside          EPA Region: 9          Coordinate Source: Google Geocode          Case Type: LUST Cleanup Site          Is the site linked to a Cleanup Fund SCUFIIIS case?: NO          Lead Agency: RIVERSIDE COUNTY LOP          Case Manager: RIV          Local Agency: RIVERSIDE COUNTY LOP          Regional Water Board case number: 083300324T          Potential contaminants of concern: Gasoline          Potential media of concern: Soil       </p>						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
Hist-LUSTIS-CA	Listed	0.17 miles NW	1279 ft (3 ft lower than site)	12
SITE NAME		MAPS		ID
RIGHTWAY PORTABLE TOILETS		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		1293320
ADDRESS		CITY		ZIP
653 MINTHORN STREET, WEST		LAKE ELSINORE		92330

## DETAILS

Reported Date: 1998

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
Hist-Regional-UST-CA	Listed	0.17 miles NW	1279 ft (3 ft lower than site)	12
<b>SITE NAME</b>			<b>MAPS</b>	<b>ID</b>
RIGHTWAY PORTABLE TOILETS			<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	1293320
<b>ADDRESS</b>			<b>CITY</b>	<b>ZIP</b>
653 MINTHORN STREET WEST			LAKE ELSINORE	
<b>DETAILS</b>				
<p>Reported Date: 1998</p> <p>List: Region #8-Santa Ana Regional Underground Tank Database List</p> <p>Agency: Regional Water Quality Control Board, Region #8</p>				

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
Hist-UST-CA	Listed	0.17 miles NW	1279 ft (3 ft lower than site)	12
<b>SITE NAME</b>			<b>MAPS</b>	<b>ID</b>
RIGHTWAY			<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	260446
<b>ADDRESS</b>			<b>CITY</b>	<b>ZIP</b>
653 W MINTHORN			LAKE ELSINORE	92330
<b>DETAILS</b>				
<p>Note: ID has been assigned by ERS</p> <p>Tank Details:</p> <p><a href="https://documents.geotracker.waterboards.ca.gov/ustpdfs/pdf/0001f8c7.pdf">https://documents.geotracker.waterboards.ca.gov/ustpdfs/pdf/0001f8c7.pdf</a></p>				

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
HWT-CA	Listed	0.17 miles NW	1279 ft (3 ft lower than site)	12		
<b>SITE NAME</b>		<b>MAPS</b>		<b>ID</b>		
RIGHTWAY		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		79		
<b>ADDRESS</b>		<b>CITY</b>		<b>ZIP</b>		
653 W MINTHORN		LAKE ELSINOR		92330		
<b>DETAILS</b>						
URL: <a href="https://hwts.dtsc.ca.gov/reports/transporter/79">https://hwts.dtsc.ca.gov/reports/transporter/79</a> Registration Number: 79 Registration Date: 6/30/1985 Expiration Date: 6/30/1986 Last Updated: 4/28/1993 Record Entered: 3/5/1982 Standing Flag: Expired County: RIVERSIDE Mailing Address: 653 W MINTHORN STREET LAKE ELSINORE, CA 92330 Contact: ROBERT M. HARDING Position: OWNER Contact Number: 7146742708 Owner(s): ROBERT M. HARDING EPA ID(s): CAD092259407						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
LUST-Closed-CA	COMPLETED - CASE CLOSED	0.17 miles NW	1279 ft (3 ft lower than site)	12
<b>SITE NAME</b>		<b>MAPS</b>		<b>ID</b>
RIGHTWAY PORTABLE TOILETS		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		T0606500035
<b>ADDRESS</b>		<b>CITY</b>		<b>ZIP</b>
653 W MINTHORN ST		LAKE ELSINORE		92330

## DETAILS

Global ID: T0606500035  
 Site/Facility Type: LUST CLEANUP SITE  
 County: RIVERSIDE  
 Census Tract: 6065043006  
 EPA Region: 9  
 Case Type: LUST Cleanup Site  
 Status Date: 4/4/1989  
 CUF Case: NO  
 Lead Agency: RIVERSIDE COUNTY LOP  
 Case Manager: RIV  
 Local Agency: RIVERSIDE COUNTY LOP  
 Regional Water Board Case Case Number: 083300324T  
 Potential Contaminants of Concern: Gasoline  
 Potential Media of Concern: Soil  
 Case Begin Date: 7/24/1986  
 Leak Reported Date: 7/24/1986  
 How Leak was Discovered: Tank Tightness Test  
 Discharge Source: Other  
 Discharge Cause: Unknown  
 No Further Action Date: 4/4/1989  
 CalWater Watershed Name: Santa Ana River - Lake Mathews - Terra Colta (801.35)  
 DWR Groundwater Sub-Basin Name: Elsinore - Elsinore Valley (8-004.01)  
 CalEnviroScreen 3 Percentile: 81-85%  
 CalEnviroScreen 4 Percentile: 80-85%  
 Is the site a Military or DOD site?: No  
 Regional Board Office Region: SANTA ANA RWQCB (REGION 8)

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
RCRA-NON-US	Listed	0.17 miles NW	1279 ft (3 ft lower than site)	12		
SITE NAME		MAPS		ID		
RIGHTWAY		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		CAD092259407		
ADDRESS		CITY		ZIP		
653 W MINTHORN		LAKE ELSINORE		92530		
DETAILS						
More Details: <a href="https://enviro.epa.gov/envirofacts/rcrainfo/facility?handlerId=CAD092259407">https://enviro.epa.gov/envirofacts/rcrainfo/facility?handlerId=CAD092259407</a> Reporting Universe: Transporter						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
RCRA-NON-US	Listed	0.17 miles NW	1279 ft (3 ft lower than site)	12		
<b>SITE NAME</b>		<b>MAPS</b>		<b>ID</b>		
RIGHTWAY		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		CAL000059230		
<b>ADDRESS</b>		<b>CITY</b>		<b>ZIP</b>		
653 W MINTHORN ST		LAKE ELSINORE		92530-0000		
<b>DETAILS</b>						
<p>More Details:  <a href="https://enviro.epa.gov/envirofacts/rcrecinfo/facility?handlerId=CAL000059230">https://enviro.epa.gov/envirofacts/rcrecinfo/facility?handlerId=CAL000059230</a>          Reporting Universe: Other</p>						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
CRSP-CA	Listed	0.18 miles NW	1278 ft (4 ft lower than site)	13
<b>SITE NAME</b>		<b>MAPS</b>		<b>ID</b>
Douglas Technology Group Inc		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		112507
<b>ADDRESS</b>		<b>CITY</b>		<b>ZIP</b>
Not Reported by Agency		LAKE ELSINORE		92530

## DETAILS

### Site Regulated Program Information

Site ID: 112507

Site EI ID: 10449442

Agency Provided Latitude: 33.68304

Agency Provided Longitude: -117.33307

Program Description: Chemical Storage Facilities

### Evaluation Information

: Not Reported

: Violation Information

: Not Reported

: Enforcement Information

: Not Reported

: Chemical Information

: Not Reported

: Coordinate Information

: Not Reported

:

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
Hist-UST-CA	Listed	0.2 miles NW	1287 ft (5 ft higher than site)	14		
SITE NAME		MAPS		ID		
BUTTERFIELD SUPVEYS INC		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		218756		
ADDRESS		CITY		ZIP		
18740 Collier Ave		Lake Elsinore		92530		
DETAILS						
<p>Note: ID has been assigned by ERS</p> <p>Tank Details:</p> <p><a href="https://documents.geotracker.waterboards.ca.gov/ustpdfs/pdf/0001f455.pdf">https://documents.geotracker.waterboards.ca.gov/ustpdfs/pdf/0001f455.pdf</a></p>						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
Hist-USTReg-CA	Listed	0.2 miles NW	1287 ft (5 ft higher than site)	14		
SITE NAME		MAPS		ID		
BUTTERFIELD SURVEYS INC		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		3193660		
ADDRESS		CITY		ZIP		
18740 Collier Ave		Lake Elsinore		92530		
DETAILS						
Reported Date: 1998						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
CERS-CA	Listed	0.22 miles NE	1318 ft (36 ft higher than site)	15		
SITE NAME		MAPS		ID		
SoCal RV Doctor		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		10578097		
ADDRESS		CITY		ZIP		
29910 Ohana Cir # 102		Lake Elsinore		92532		
DETAILS						
SiteID: 402422 EI ID: 10578097 Description: Chemical Storage Facilities Hazardous Waste Generator						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
County-Others-CA	Listed	0.22 miles NE	1318 ft (36 ft higher than site)	15
SITE NAME		MAPS		ID
SoCal RV Doctor		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		5722-RSD
ADDRESS		CITY		ZIP
29910 Ohana Cir #102		Lake Elsinore		92532

## DETAILS

Agency: Riverside County Department of Environmental Health, Hazardous Materials Management Branch

Note: This is an ERS assigned ID

County: Riverside

Type: Disclosure Facility List

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
County-Others-CA	Listed	0.22 miles NE	1318 ft (36 ft higher than site)	15
SITE NAME			MAPS	ID
Precision Sports Inc		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		5708-RSD
ADDRESS			CITY	ZIP
29910 Ohana Cir			Lake Elsinore	92532
DETAILS				
Agency: Riverside County Department of Environmental Health, Hazardous Materials Management Branch Note: This is an ERS assigned ID County: Riverside Type: Disclosure Facility List				

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
County-Others-CA	Listed	0.22 miles NE	1318 ft (36 ft higher than site)	15
SITE NAME			MAPS	ID
SoCal RV Doctor		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		66773-RSD
ADDRESS			CITY	ZIP
29910 Ohana Cir #102			Lake Elsinore	92532
DETAILS				

## DETAILS

Agency: Riverside County Department of Environmental Health  
 Note: This is an ERS assigned ID  
 County: Riverside  
 Type: Generator  
 Agency Provided Latitude: Not Reported  
 Agency Provided Longitude: Not Reported

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
County-Others-CA	Listed	0.22 miles NE	1318 ft (36 ft higher than site)	15
SITE NAME			MAPS	ID
Precision Sports Inc			<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	66758-RSD
ADDRESS			CITY	ZIP
29910 Ohana Cir			Lake Elsinore	92532
DETAILS				

Agency: Riverside County Department of Environmental Health  
 Note: This is an ERS assigned ID  
 County: Riverside  
 Type: Generator  
 Agency Provided Latitude: Not Reported  
 Agency Provided Longitude: Not Reported

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
Hist-Auto Repair	Listed	0.22 miles NE	1318 ft (36 ft higher than site)	15
SITE NAME			MAPS	ID
LABEDA WHEELS			<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>	19908
ADDRESS			CITY	ZIP
29910 Ohana Cir			Lake Elsinore	92532

## DETAILS

Sic Code: 5531  
 Desc: Auto, Truck & Tire Service  
 Site Added: 2/2010

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
RCRA-NON-US	Listed	0.22 miles NE	1318 ft (36 ft higher than site)	15		
<b>SITE NAME</b>		<b>MAPS</b>		<b>ID</b>		
PRECISION SPORTS		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		CAL000129258		
<b>ADDRESS</b>		<b>CITY</b>		<b>ZIP</b>		
29910 Ohana Cir		Lake Elsinore		92532		
<b>DETAILS</b>						
More Details: <a href="https://enviro.epa.gov/envirofacts/rcrecinfo/facility?handlerId=CAL000129258">https://enviro.epa.gov/envirofacts/rcrecinfo/facility?handlerId=CAL000129258</a> Reporting Universe: Other						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
RCRA-NON-US	Listed	0.22 miles NE	1318 ft (36 ft higher than site)	15		
<b>SITE NAME</b>		<b>MAPS</b>		<b>ID</b>		
TEAM LABEDA TEST FACILITY LLC DBA SOCAL RV DOCTOR		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		CAL000366697		
<b>ADDRESS</b>		<b>CITY</b>		<b>ZIP</b>		
29910 Ohana Cir Ste 102		Lake Elsinore		92532		
<b>DETAILS</b>						
More Details: <a href="https://enviro.epa.gov/envirofacts/rcrecinfo/facility?handlerId=CAL000366697">https://enviro.epa.gov/envirofacts/rcrecinfo/facility?handlerId=CAL000366697</a> Reporting Universe: Other						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
CRSP-CA	Listed	0.22 miles NE	1318 ft (36 ft higher than site)	15		
SITE NAME		MAPS		ID		
SoCal RV Doctor		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		402422		
ADDRESS		CITY		ZIP		
Not Reported by Agency		LAKE ELSINORE		92532		
DETAILS						
<p>Site Regulated Program Information</p> <p>Site ID: 402422</p> <p>Site EI ID: 10578097</p> <p>Agency Provided Latitude: 33.68461</p> <p>Agency Provided Longitude: -117.32829</p> <p>Program Description: Chemical Storage Facilities</p> <p>Program Description: Hazardous Waste Generator</p> <p>Evaluation Information</p> <p>Evaluation Date: 6/29/2016</p> <p>Violations Found? (Y/N): No</p> <p>Evaluation General Type: Compliance Evaluation Inspection</p> <p>Evaluation Type: Routine done by local agency</p> <p>Evaluation Note(s): SoCal RV add generator program</p> <p>Evaluation Division: Riverside County Department of Env Health</p> <p>Evaluation Program: HW</p> <p>Evaluation Source: CERS</p> <p>Evaluation Date: 6/29/2016</p> <p>Violations Found? (Y/N): Yes</p> <p>Evaluation General Type: Compliance Evaluation Inspection</p> <p>Evaluation Type: Routine done by local agency</p> <p>Evaluation Note(s): Not Reported</p> <p>Evaluation Division: Riverside County Department of Env Health</p> <p><a href="#">More Details Link</a></p>						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
CRSP-CA	Listed	0.22 miles NE	1318 ft (36 ft higher than site)	15		
SITE NAME		MAPS		ID		
Precision Sports Inc		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		58562		
ADDRESS		CITY		ZIP		
Not Reported by Agency		LAKE ELSINORE		92532		
DETAILS						
<p>Site Regulated Program Information</p> <p>Site ID: 58562</p> <p>Site EI ID: 10320322</p> <p>Agency Provided Latitude: 33.68461</p> <p>Agency Provided Longitude: -117.32829</p> <p>Program Description: Chemical Storage Facilities</p> <p>Program Description: Hazardous Waste Generator</p> <p>Evaluation Information</p> <p>Evaluation Date: 10/20/2017</p> <p>Violations Found? (Y/N): Yes</p> <p>Evaluation General Type: Other/Unknown</p> <p>Evaluation Type: Other, not routine, done by local agency</p> <p>Evaluation Note(s): Not Reported</p> <p>Evaluation Division: Riverside County Department of Env Health</p> <p>Evaluation Program: HMRRP</p> <p>Evaluation Source: CERS</p> <p>Evaluation Date: 9/12/2017</p> <p>Violations Found? (Y/N): Yes</p> <p>Evaluation General Type: Other/Unknown</p> <p>Evaluation Type: Other, not routine, done by local agency</p> <p>Evaluation Note(s): Not Reported</p> <p>Evaluation Division: Riverside County Department of Env Health</p> <p><a href="#">More Details Link</a></p>						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
CRSP-CA	Listed	0.24 miles NW	1281 ft (1 ft lower than site)	16		
SITE NAME		MAPS		ID		
Deleo Clay Tile Co Inc		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		184414		
ADDRESS		CITY		ZIP		
Not Reported by Agency		LAKE ELSINORE		92530		
DETAILS						
<p>Site Regulated Program Information</p> <p>Site ID: 184414</p> <p>Site EI ID: 10614910</p> <p>Agency Provided Latitude: 33.684147</p> <p>Agency Provided Longitude: -117.33342</p> <p>Program Description: Chemical Storage Facilities</p> <p>Program Description: Hazardous Waste Generator</p> <p>Evaluation Information</p> <p>Evaluation Date: 11/27/2018</p> <p>Violations Found? (Y/N): Yes</p> <p>Evaluation General Type: Other/Unknown</p> <p>Evaluation Type: Other, not routine, done by local agency</p> <p>Evaluation Note(s): Not Reported</p> <p>Evaluation Division: Riverside County Department of Env Health</p> <p>Evaluation Program: HMRRP</p> <p>Evaluation Source: CERS</p> <p>Evaluation Date: 8/25/2016</p> <p>Violations Found? (Y/N): No</p> <p>Evaluation General Type: Other/Unknown</p> <p>Evaluation Type: Other, not routine, done by local agency</p> <p>Evaluation Note(s): Not Reported</p> <p>Evaluation Division: Riverside County Department of Env Health</p> <p><a href="#">More Details Link</a></p>						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
AIR-DIST-CA	Listed	0.24 miles NW	1286 ft (4 ft higher than site)	17		
SITE NAME		MAPS		ID		
J S TECHNOLOGIES INC, JOHN SUHN, DBA		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		118612-SC		
ADDRESS		CITY		ZIP		
18650 COLLIER AVE UNIT A		LAKE ELSINORE		92530		
DETAILS						
District: South Coast AQMD Compliance URL: <a href="https://xappprod.aqmd.gov/find//facility/AQMDsearch?facilityID=118612">https://xappprod.aqmd.gov/find//facility/AQMDsearch?facilityID=118612</a> Note: For additional Facility, Equipment, Emissions, Hearing Board or Transporation Plan Information click on different tabs. Facility Id: 118612 County Code: RV County: Riverside Facility Status Code: A Facility Status: ACTIVE Number of Employees: 8 Location Zip Code Extension: Not Reported Facility Representative First Name: ROBERT Facility Representative Last Name: SUMMERS Location Area Code: 310 Location Phone Number: 5052559 Location Phone Extension: Not Reported Mailing Address: 18650 COLLIER AVE UNIT A Mailing City: LAKE ELSINORE Mailing State: CA Mailing Zip Code: 92530 Mailing Zip Code Extension: Not Reported Mailing Area Code: 310 Mailing Phone Number: 5052559 Mailing Phone Extension: Not Reported Mailing Representative First Name: ROBERT Mailing Representative Last Name: SUMMERS						
<a href="#">More Details Link</a>						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
WDR-CA	Listed	0.24 miles NW	1286 ft (4 ft higher than site)	17		
SITE NAME		MAPS		ID		
Comm Bldg,Lake Elsinore		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		2260		
ADDRESS		CITY		ZIP		
18650 Collier		Elsinore				
DETAILS						
<p>Note: This is an ERS assigned Automated ID.          SIC/NAICS: 1541          County: Riverside          Region: 8 - Santa Ana          WDID: 8 332198001          Agency: Ayres &amp; Son Construction Company          Agency Address: Po Box A, Huntington Beach, CA 92648          Place/Project Type: Other          Program: WDRMUNIOTH          Regulatory Measure Status: Historical          Regulatory Measure Type: WDR          Order Number: 91-03501          NPDES Number: Not Reported          Adoption Date: 3/15/1991          Effective Date: 3/15/1991          Termination Date: Not Reported          Expiration/Review Date: Not Reported          Design Flow: 0.0037          Major/Minor: Not Reported          Complexity: C          TTWQ: 3          Number Of Enforcement Actions within 5 years: 0          Number Of Violations within 5 years: 0          Latitude: Not Reported          Longitude: Not Reported       </p>						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
County-Others-CA	Listed	0.25 miles NW	1282 ft (0 ft higher than site)	18
SITE NAME		MAPS		ID
Deleo Clay Tile Co Inc.		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		5595-RSD
ADDRESS		CITY		ZIP
600 Chaney St		Lake Elsinore		92530

## DETAILS

Agency: Riverside County Department of Environmental Health, Hazardous Materials Management Branch

Note: This is an ERS assigned ID

County: Riverside

Type: Disclosure Facility List

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
County-Others-CA	Listed	0.25 miles NW	1282 ft (0 ft higher than site)	18
SITE NAME		MAPS		ID
Deleo Clay Tile Co Inc.		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		66698-RSD
ADDRESS		CITY		ZIP
600 Chaney St		Lake Elsinore		92530
DETAILS				

Agency: Riverside County Department of Environmental Health

Note: This is an ERS assigned ID

County: Riverside

Type: Generator

Agency Provided Latitude: Not Reported

Agency Provided Longitude: Not Reported

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
ENF-SMARTS-CA	Historical	0.25 miles NW	1282 ft (0 ft higher than site)	18
SITE NAME		MAPS		ID
Deleo Clay Tile Co		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		411564
ADDRESS		CITY		ZIP
600 CHANEY ST		Lake Elsinore		92530

## DETAILS

ENFORCEMENT ID: 411564  
 ENFORCEMENT STATUS: Historical  
 PLACE NAME: Deleo Clay Tile Co  
 PLACE ADDRESS: 600 Chaney St  
 PLACE CITY: Lake Elsinore  
 PLACE STATE: CA  
 PLACE ZIP: 92530  
 PLACE LATITUDE: 33.68415  
 PLACE LONGITUDE: -117.3344  
 WASTE DISCHARGE ID: 8 33I014321  
 APP ID: 210863  
 ENFORCEMENT TYPE: 1st NNC - AR  
 ISSUANCE DATE: 8/9/2012  
 DUE DATE: 9/10/2012  
 DESCRIPTION: 2011-2012 annual report late submissionSite has not submit the 2011-2012 annual report by 07/02/2012.- 1st Notice of Non-Compliance sent on 08/09/2012, via certified mail to facility, CC to owner.  
 INITIAL ASSESSMENT: 0  
 TOTAL ASSESSMENT: 0  
 RECEIVED AMOUNT: 0  
 SPENT AMOUNT: 0  
 BALANCE DUE: 0  
 COUNT OF VIOLATIONS: 1  
 PERMIT TYPE: Industrial  
 REGIONAL BOARD: 8  
 PLACE COUNTY: Riverside  
 PLACE TOTAL SIZE: 5  
 PLACE TOTAL SIZE UNIT: Acres  
 RECEIVING WATER NAME: Lake Elsinore

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
ENF-SMARTS-CA	Historical	0.25 miles NW	1282 ft (0 ft higher than site)	18
SITE NAME		MAPS		ID
Deleo Clay Tile Co		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		232632
ADDRESS		CITY		ZIP
600 CHANEY ST		Lake Elsinore		92530

## DETAILS

ENFORCEMENT ID: 232632  
 ENFORCEMENT STATUS: Historical  
 PLACE NAME: Deleo Clay Tile Co  
 PLACE ADDRESS: 600 Chaney St  
 PLACE CITY: Lake Elsinore  
 PLACE STATE: CA  
 PLACE ZIP: 92530  
 PLACE LATITUDE: 33.68415  
 PLACE LONGITUDE: -117.3344  
 WASTE DISCHARGE ID: 8 33I014321  
 APP ID: 210863  
 ENFORCEMENT TYPE: NOV  
 ISSUANCE DATE: 8/18/2000  
 DESCRIPTION: NOV letter sent 8/18/00  
 ORDER NUMBER: UNKNOWN  
 STAFF COSTS: 0  
 INITIAL ASSESSMENT: 0  
 TOTAL ASSESSMENT: 0  
 RECEIVED AMOUNT: 0  
 SPENT AMOUNT: 0  
 BALANCE DUE: 0  
 COMPLIANCE DATE: 8/18/2000  
 PERMIT TYPE: Industrial  
 REGIONAL BOARD: 8  
 PLACE COUNTY: Riverside  
 PLACE TOTAL SIZE: 5  
 PLACE TOTAL SIZE UNIT: Acres

[More Details Link](#)

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
ENF-SMARTS-CA	Historical	0.25 miles NW	1282 ft (0 ft higher than site)	18
SITE NAME		MAPS		ID
Deleo Clay Tile Co		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		233686
ADDRESS		CITY		ZIP
600 CHANEY ST		Lake Elsinore		92530

## DETAILS

ENFORCEMENT ID: 233686  
 ENFORCEMENT STATUS: Historical  
 PLACE NAME: Deleo Clay Tile Co  
 PLACE ADDRESS: 600 Chaney St  
 PLACE CITY: Lake Elsinore  
 PLACE STATE: CA  
 PLACE ZIP: 92530  
 PLACE LATITUDE: 33.68415  
 PLACE LONGITUDE: -117.3344  
 WASTE DISCHARGE ID: 8 33I014321  
 APP ID: 210863  
 ENFORCEMENT TYPE: NOV  
 ISSUANCE DATE: 10/26/1999  
 DESCRIPTION: Notice of Violation for non-submittal of Annual Report  
 CORRECTIVE ACTION: This enforcement action generated from SWRCB NOI database  
 ORDER NUMBER: UNKNOWN  
 STAFF COSTS: 0  
 INITIAL ASSESSMENT: 0  
 TOTAL ASSESSMENT: 0  
 RECEIVED AMOUNT: 0  
 SPENT AMOUNT: 0  
 BALANCE DUE: 0  
 COMPLIANCE DATE: 10/26/1999  
 COUNT OF VIOLATIONS: 1  
 PERMIT TYPE: Industrial  
 REGIONAL BOARD: 8  
 PLACE COUNTY: Riverside

[More Details Link](#)

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
ENF-SMARTS-CA	Active	0.25 miles NW	1282 ft (0 ft higher than site)	18
SITE NAME		MAPS		ID
Deleo Clay Tile Co		<a href="#">1</a> , <a href="#">2</a> , <a href="#">4</a>		400585
ADDRESS		CITY		ZIP
600 CHANEY ST		Lake Elsinore		92530

## DETAILS

ENFORCEMENT ID: 400585  
 ENFORCEMENT STATUS: Active  
 PLACE NAME: Deleo Clay Tile Co  
 PLACE ADDRESS: 600 Chaney St  
 PLACE CITY: Lake Elsinore  
 PLACE STATE: CA  
 PLACE ZIP: 92530  
 PLACE LATITUDE: 33.68415  
 PLACE LONGITUDE: -117.3344  
 WASTE DISCHARGE ID: 8 33I014321  
 APP ID: 210863  
 ENFORCEMENT TYPE: Verbal Communication  
 ISSUANCE DATE: 11/10/2009  
 DESCRIPTION: Sent email with inspection report asking for corrective actions  
 INITIAL ASSESSMENT: 0  
 TOTAL ASSESSMENT: 0  
 RECEIVED AMOUNT: 0  
 SPENT AMOUNT: 0  
 BALANCE DUE: 0  
 COUNT OF VIOLATIONS: 2  
 PERMIT TYPE: Industrial  
 REGIONAL BOARD: 8  
 PLACE COUNTY: Riverside  
 PLACE TOTAL SIZE: 5  
 PLACE TOTAL SIZE UNIT: Acres  
 RECEIVING WATER NAME: Lake Elsinore

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
County-LUST-CA	Listed	0.37 miles SE	1275 ft (7 ft lower than site)	19		
SITE NAME		MAPS		ID		
Redman Property		<a href="#">1</a> , <a href="#">4</a>		94051-RSD		
ADDRESS		CITY		ZIP		
520 Riley St		Lake Elsinore				
DETAILS						
Note: The agency has notified ERS that the only status to trust within its database is the closed status. All other statuses should not be trusted and should be reviewed on Geotracker Site ID: 94051 Closed: R Employee: Malloy Status: Not Reported Case Type: Undefined						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
LUST-Closed-CA	COMPLETED - CASE CLOSED	0.37 miles SE	1275 ft (7 ft lower than site)	19		
SITE NAME		MAPS		ID		
REDMAN PROPERTY		<a href="#">1, 4</a>		T0606500134		
ADDRESS		CITY		ZIP		
520 N Riley St		Lake Elsinore		92530		
DETAILS						
Global ID: T0606500134 Site/Facility Type: LUST CLEANUP SITE County: RIVERSIDE Census Tract: 6065043006 EPA Region: 9 Case Type: LUST Cleanup Site Status Date: 3/10/2014 CUF Case: NO Lead Agency: SANTA ANA RWQCB (REGION 8) Local Agency: RIVERSIDE COUNTY LOP Regional Water Board Case Case Number: 083301248T Local Agency Case Number: 94051 Potential Contaminants of Concern: Gasoline Potential Media of Concern: Aquifer used for drinking water supply Site History: . Case Begin Date: 2/2/1994 Leak Reported Date: 2/2/1994 How Leak was Discovered: Tank Closure Discharge Source: Other Discharge Cause: Unknown No Further Action Date: 3/10/2014 CalWater Watershed Name: Santa Ana River - Lake Mathews - Terra Colta (801.35) DWR Groundwater Sub-Basin Name: Elsinore - Elsinore Valley (8-004.01) CalEnviroScreen 3 Percentile: 81-85% CalEnviroScreen 4 Percentile: 80-85% Is the site a Military or DOD site?: No Regional Board Office Region: SANTA ANA RWQCB (REGION 8)						
<a href="#">More Details Link</a>						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID		
County-LUST-Closed-CA	Closed	0.39 miles S	1274 ft (8 ft lower than site)	20		
<b>SITE NAME</b>		<b>MAPS</b>		<b>ID</b>		
City Yard		<a href="#">1, 4</a>		88062-RSD		
<b>ADDRESS</b>		<b>CITY</b>		<b>ZIP</b>		
521 N Langstaff St		Lake Elsinore				
<b>DETAILS</b>						
Site ID: 88062 Closed: Y Employee: Rogers Status: Closed/Action Completed Case Type: Soil only is impacted						

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
LUST-Closed-CA	COMPLETED - CASE CLOSED	0.39 miles S	1274 ft (8 ft lower than site)	20
<b>SITE NAME</b>		<b>MAPS</b>		<b>ID</b>
CITY YARD		<a href="#">1, 4</a>		T0606500084
<b>ADDRESS</b>		<b>CITY</b>		<b>ZIP</b>
521 N Langstaff St		Lake Elsinore		92530

## DETAILS

Global ID: T0606500084  
 Site/Facility Type: LUST CLEANUP SITE  
 County: RIVERSIDE  
 Census Tract: 6065043006  
 EPA Region: 9  
 Case Type: LUST Cleanup Site  
 Status Date: 10/30/1989  
 CUF Case: NO  
 Lead Agency: RIVERSIDE COUNTY LOP  
 Case Manager: RIV  
 Local Agency: RIVERSIDE COUNTY LOP  
 Regional Water Board Case Case Number: 083300791T  
 Local Agency Case Number: 88062  
 File Location: Local Agency Warehouse  
 Potential Contaminants of Concern: Diesel  
 Potential Media of Concern: Aquifer used for drinking water supply  
 Case Begin Date: 12/9/1987  
 Leak Reported Date: 1/5/1988  
 How Leak was Discovered: Tank Closure  
 Discharge Source: Other  
 Discharge Cause: Overfill  
 How Leak was Stopped: Close and Remove Tank, Remove Contents  
 No Further Action Date: 10/30/1989  
 CalWater Watershed Name: Santa Ana River - Lake Mathews - Terra Colta (801.35)  
 DWR Groundwater Sub-Basin Name: Elsinore - Elsinore Valley (8-004.01)  
 CalEnviroScreen 3 Percentile: 81-85%  
 CalEnviroScreen 4 Percentile: 80-85%

[More Details Link](#)

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
SWIS-CA	Listed	0.39 miles NW	1286 ft (4 ft higher than site)	21
SITE NAME			MAPS	ID
Elsinore Valley Cemetery Dist			<a href="#">1, 4</a>	2488
ADDRESS			CITY	ZIP
18170 Collier Ave			Lake Elsinore	92530

## DETAILS

Site ID: 2488  
 SWIS Number: 33-CR-0026  
 Site Name: Elsinore Valley Cemetery Dist  
 Point of Contact: Angela Gomez  
 Operational Status: To be Determined  
 Regulatory Status: TBD (Pending Investigation)  
 Site Type: Disposal Only  
 Operator: Akins J W  
 Owner: County Of Riverside Cemetery District  
 Owner Name:  
 Owner Phone: (909) 638-1840  
 Owner Address: 4414 14th St  
 Owner City: Riverside  
 Owner State: CA  
 Owner ZIP: 92501  
 Operator Contact Name: James W. Akins  
 Operator Phone: (909) 674-2418  
 Operator Address: 18170 Collier St.  
 Operator City: Elsinore  
 Is Archived: Yes  
 Is Closed Illegal Abandoned: No  
 Is Site Inert Debris Engineered Fill: No  
 Is Financial Assurances Responsible: No  
 County: Riverside  
 ARB District: South Coast  
 SWRCB Region: Santa Ana  
 Local Government: Lake Elsinore

[More Details Link](#)

DATABASE	STATUS	DISTANCE	ELEVATION	MAP ID
County-LUST-Closed-CA	Closed	0.49 miles SE	1277 ft (5 ft lower than site)	22
SITE NAME		MAPS		ID
Big Al Oil Co		<a href="#">1, 4</a>		91081-RSD
ADDRESS		CITY		ZIP
501 N Spring St		Lake Elsinore		

## DETAILS

Site ID: 91081  
Closed: Y  
Employee: Shurlow-LOP  
Status: Closed/Action Completed  
Case Type: An Aquifer used for Drinking Water Supply has been contaminated.

## RECORDS SOURCES SEARCHED

ABREVIATION	DATABASE FULLNAME	DATABASE CATEGORY	DATABASE DETAILS LINK	TOTAL LISTINGS
Air-CA	Air Permits with Emissions	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
AIR-DIST-CA	Air Pollution Control District	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	4
AST-CA	Aboveground Storage Tanks	State/Tribal UST	<a href="#">Click Here</a>	None Found
BF-MOA-CA	Brownfield MOA Sites (aka Considered Brownfield Sites, SWRCB MOA, Brownfield Memorandum of Agreement)	State/Tribal Brownfield	<a href="#">Click Here</a>	None Found
BF-Tribal-US	Tribal Brownfields	Federal Brownfield	<a href="#">Click Here</a>	None Found
BF-US	Brownfields Sites	Federal Brownfields	<a href="#">Click Here</a>	None Found
BioFuel-US	Bio Diesel Fuel	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
BZ-HazWaste-CA	Border Zone or Hazardous Waste Property	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	None Found
CAF-CA	Confined Animal Facilities	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
CDL-CA	Clandestine Drug Labs	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
CDL-US	National Clandestine Drug Lab Register	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
CERS-CA	California Environmental Reporting System (CERS)	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	1
CHMIRS-CA	California Hazardous Material Incident Report System	Emergency Release Reports	<a href="#">Click Here</a>	None Found
CHWF-CA	Commercial Offsite Hazardous Waste Facilities	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
City-AST-CA	Underground Storage Tanks	State/Tribal UST	<a href="#">Click Here</a>	None Found
City-CUPA-CA	Certified Unified Program Agency	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	None Found
City-Others-CA	Hazardous Material Facilities	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	None Found
City-UST-CA	City Agency Underground Storage Tanks	State/Tribal UST	<a href="#">Click Here</a>	None Found
Cleaners-CA	Cleaners	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Coal-Ash-Dams-US	Coal Ash Contaminated Sites and Hazard Dams	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Controls-CA	California sites with Deed Restrictions or other Controls	State/Tribal Inst/Eng Controls	<a href="#">Click Here</a>	None Found

ABREVIATION	DATABASE FULLNAME	DATABASE CATEGORY	DATABASE DETAILS LINK	TOTAL LISTINGS
Controls-RCRA-US	RCRA Institutional and Engineering Controls Summary (aka Federal RCRA with Controls)	Federal Institutional/Engineering Controls	<a href="#">Click Here</a>	None Found
Controls-US	US CERCLA Sites with Controls (aka US IC/EC, Institutional/Engineering List Controls, Land Use Controls)	Federal Institutional/Engineering Controls	<a href="#">Click Here</a>	None Found
CorAct-Closed-CA	Corrective Action Sites	State/Tribal ASTM Other Low	<a href="#">Click Here</a>	None Found
CorAct-Open-CA	Corrective Action Sites	State/Tribal ASTM Other High	<a href="#">Click Here</a>	None Found
CorAct-Other-CA	Corrective Action Sites	State/Tribal ASTM Other Low	<a href="#">Click Here</a>	None Found
CORTESE-CA	Cortese Hazardous Waste & Substances Sites List	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	None Found
County-AST-CA	Aboveground Storage Tanks	State/Tribal UST	<a href="#">Click Here</a>	None Found
County-BI-CA	Business Inventory	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
County-Hist-CA	Historic Environmental County Listings	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	None Found
County-LUST-CA	County Agency Leaking Underground Storage Tanks	State/Tribal LUST	<a href="#">Click Here</a>	1
County-LUST-Closed-CA	County Agency Leaking Underground Storage Tanks, Closed Cases	State/Tribal LUST	<a href="#">Click Here</a>	2
County-LUST-Open-CA	County Agency Leaking Underground Storage Tanks, Open Cases	State/Tribal LUST	<a href="#">Click Here</a>	None Found
County-Others-CA	Environmental Related Databases	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	9
County-SLIC-Closed-CA	County SLIC Sites	Emergency Release Reports	<a href="#">Click Here</a>	None Found
County-SLIC-Open-CA	County SLIC Sites	Emergency Release Reports	<a href="#">Click Here</a>	None Found
County-SML-CA	County Site Mitigation Unit List	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	None Found
County-SWF-CA	County Solid Waste Facilities	State/Tribal Landfill/Solid Waste	<a href="#">Click Here</a>	None Found
County-UST-CA	County Agency Underground Storage Tanks	State/Tribal UST	<a href="#">Click Here</a>	None Found
CRSP-CA	Cal EPA Regulated Site Portal	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	10

ABREVIATION	DATABASE FULLNAME	DATABASE CATEGORY	DATABASE DETAILS LINK	TOTAL LISTINGS
CUPA-CA	Certified Unified Program Agency	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	None Found
Dams-CA	California Dams	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Debris-Reg9-US	Debris Region 9 Torres Martinez Reservation Illegal dump Site Locations	Federal Solid Waste	<a href="#">Click Here</a>	None Found
Deed-CA	Deed Restrictions/Land Use Restrictions	State/Tribal Inst/Eng Controls	<a href="#">Click Here</a>	None Found
DPR-CA	Pesticide Regulation Licenses	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
DryCleaners-CA	Dry Cleaner Facilities	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
EGRID-US	Emissions & Generation Resource Facilities	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
ENF-CA	Enforcement Actions Data	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	1
ENF-SMARTS-CA	Storm Water Enforcement Actions	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	4
ENF-Wastewater-CA	Wastewater Enforcement Actions	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	4
EPA-Watch-List-US	Historical EPA Watch List	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
ERNS-US	Emergency Response Notification System	Federal ERNS	<a href="#">Click Here</a>	None Found
Eval-Hist-Active-CA	EnviroStor Evaluation History Sites	State/Tribal ASTM Other	<a href="#">Click Here</a>	None Found
Eval-Hist-NFA-CA	EnviroStor Database Evaluation History NFA Sites	State/Tribal ASTM Other	<a href="#">Click Here</a>	None Found
Eval-Hist-Other-CA	EnviroStor Database Evaluation History NFA Sites	State/Tribal ASTM Other	<a href="#">Click Here</a>	None Found
FA-HW-CA	Financial Assurance, Hazardous Waste	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
FA-HW-US	Financial Assurance, Hazardous Waste	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
FA-SWF-CA	Financial Assurance, Solid Waste Facilities	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
FRS-US	Facility Registry Index (FINDS)	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	2
FTTS-ENF-US	Historical FIFRA/TSCA Tracking System (FTTS) Enforcement Actions	Federal ASTM Other	<a href="#">Click Here</a>	None Found

ABREVIATION	DATABASE FULLNAME	DATABASE CATEGORY	DATABASE DETAILS LINK	TOTAL LISTINGS
FTTS-INSPI-US	Historical FIFRA/TSCA Tracking System (FTTS) Inspections	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
FUDS-US	Formerly Used Defense Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
FUSRAP-US	Formerly Utilized Sites Remedial Action Program Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Haulers-CA	Registered Waste Tire Haulers Listing	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
HazWaste-CA	Hazardous Waste Facilities	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	None Found
Hist-AFS2-US	Historical Air Facility System for Clean Air Act stationary sources	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-AFS-US	Historical Air Facility System for Clean Air Act stationary sources	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Agriculture	Historical Ranches/Farms, Livestock/Agriculture	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-AST2-CA	Historical Aboveground Storage Tanks	State/Tribal UST	<a href="#">Click Here</a>	None Found
Hist-AST-CA	Historical Aboveground Storage Tanks	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Auto Dealers	Historical Auto and Truck Dealers	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-Auto Repair	Historical Automotive Repair	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	1
Hist-AWS-CA	Historical Annual Workplan Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-CA	Previously Listed California Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-CalFID-CA	Historical Facility Inventory Database	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-CALSITES-CA	Historical Calsites Database	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-CERCLIS-NFRAP-US	Historical CERCLIS-NFRAP	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-CERCLIS-US	Historical CERCLIS Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Chemical Manufacturing	Historical Manufacturing and Distribution of Chemicals, Gases, and/or Solids	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-Chemical-Storage	Historical Chemical/Hazardous Use Storage	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found

ABREVIATION	DATABASE FULLNAME	DATABASE CATEGORY	DATABASE DETAILS LINK	TOTAL LISTINGS
Hist-City-UST-CA	Historical Underground Storage Tanks	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Cleaners	Historical Laundry, Cleaners, and Dry Cleaning Services	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-Controls-CA	Historical Restricted Use Sites	State/Tribal Inst/Eng Controls	<a href="#">Click Here</a>	None Found
Hist-Convenience	Historical Convenience Store with Possible Gas	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-Cort-CA	Historical Cortese list	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	None Found
Hist-Deed-CA	Historical Deed Restriction Properties	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Disposal-Recycle	Historical Hazardous Disposal/Recycle and Dumps/Waste	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-DTG-CA	Depth to Groundwater	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Dumps-US	Historical Dumps Inventory of 1985	Federal Solid Waste	<a href="#">Click Here</a>	None Found
Hist-ERNS-US	Historical Emergency Response Notification System (ERNS)	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-FEMA-UST-US	Historical FEMA Underground Storage Tanks	Federal UST	<a href="#">Click Here</a>	None Found
Hist-FIFRA-US	Historical Case Administration Data from National Compliance Database (Federal Insecticide, Fungicide, and Rodenticide Act)	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-FINDS-US	Historical Facility Index System	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Food-Processors	Historical Food Processing Manufacturers	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-Gun-Ranges	Historical Gun Ranges/Clubs	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-HWS-CA	Historical Cortese List-Hazardous Waste Substance Site List	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-LUSTIS-CA	Historical Lust Information System (LUSTIS)	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	2
Hist-Machine Shop	Historical Machine Shops, Welding, Machine Repair	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-Manufacturing	Historical Sources US: Manufacturing	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found

ABREVIATION	DATABASE FULLNAME	DATABASE CATEGORY	DATABASE DETAILS LINK	TOTAL LISTINGS
Hist-Metal Plating	Historical Metal Plating	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-Mining	Historical Mining Operations	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
HIST-MLTS-US	Historical Material Licensing Tracking System	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Mortuaries	Historical Crematories/Mortuaries	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
HIST-MTBE-CA	Historical Sites With MTBE (Methyl Tertiary-Butyl Ether) Contamination	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-NPL-US	Historical National Priority List	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Oil-Gas	Historical Oil and Gas Well Related Facilities	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-OilGas-Refiners	Historical Oil/Gas Refiners/Manufacturers/Plants	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-Orange-County-LF-CA	Historical Orange County Landfills	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Historical-CA	Historical Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Other	Historical Environmental Facilities	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-Paint-Stores	Historical Paint Stores	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-Petroleum	Historical Petroleum Refining/ Manufacturing/ Chemicals	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-Post-Offices	Historical Post Offices	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-Printers	Historical Printers and Publishers	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-Prop65-CA	Historical Prop 65 Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
HIST-R4-CA	Historical sites	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	None Found
Hist-RCRIS-US	Historical EPA's Resource Conservation and Recovery Act	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Regional-LUST-CA	Historical Leaking Underground Storage Tanks	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Regional-Other-CA	Historical Toxic Lists, Site Mitigation, and Groundwater Cleanup Program	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found

ABREVIATION	DATABASE FULLNAME	DATABASE CATEGORY	DATABASE DETAILS LINK	TOTAL LISTINGS
Hist-Regional-SLIC-CA	Historical Spills and Leak Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Regional-Spills-CA	Historical Industrial Cleanup Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Regional-SWLF-CA	Historical County Landfills and Transfer Stations	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Regional-UST-CA	Historical Underground Storage Tanks	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	2
Hist-Rental	Historical Rental Equipment & Yards	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-RV-Dealers	Historical Trailer and Recreational Vehicle Dealers	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-Salvage	Historical Vehicle Salvage Yards or Wreckers	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-SCL-CA	Historical California Cerclis Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Service Stations	Historical Service Stations/Vehicle Fueling	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
HIST-SLIC-CV-CLOSED-CA	Historical Central Valley Spills and Leak Sites	Emergency Release Reports	<a href="#">Click Here</a>	None Found
HIST-SLIC-CV-OPEN-CA	Historical Central Valley Spills and Leak Sites	Emergency Release Reports	<a href="#">Click Here</a>	None Found
Hist-Steel-Metals	Historical Steel Mills/Manufacturers/Foundries/Smelters	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-SWIS-CA	Historical Solid Waste Information System (SWIS)	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Textile	Historical Textile Mills/Manufacturers	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-ToxicPits-CA	Historical Toxic Pits Cleanup Facilities	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Transportation	Historical Transportation Facilities	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-TRIS-US	Historical Toxic Release Inventory System	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-Trucking	Historical Trucking, Shipping, Delivery, and/or Storage	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-US	Historical Previously Listed Federal Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found

ABREVIATION	DATABASE FULLNAME	DATABASE CATEGORY	DATABASE DETAILS LINK	TOTAL LISTINGS
Hist-US-EC	Historical Engineering Controls Sites (aka US EC, Engineering Controls, Land Use Controls)	Federal Institutional/Engineering Controls	<a href="#">Click Here</a>	None Found
Hist-USGS-WaterWells-CA	Historical Ground Water Site Inventory for California	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-US-IC	Historical Sites with Institutional Controls (aka US IC, Institutional Controls, Land Use Controls)	Federal Institutional/Engineering Controls	<a href="#">Click Here</a>	None Found
Hist-UST-CA	Historical Hazardous Substance Storage Information (aka Historical Underground Storage Tanks)	State/Tribal UST	<a href="#">Click Here</a>	4
Hist-UST-Cleanup-CA	Historic UST Cases Recommended for Closure under UST Cleanup Fund 5 Year Review (aka UST Cleanup Fund Cases)	State/Tribal LUST	<a href="#">Click Here</a>	None Found
Hist-USTReg-CA	Historical Underground Storage Tank Registrations Database	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	1
Hist-Vehicle-Parts	Historical Vehicle Parts	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-Vehicle-Washing	Historical Vehicle/Truck Washing Facilities	ERS Exclusive Historic Sources	<a href="#">Click Here</a>	None Found
Hist-WaterWells-US	Historical Public Community Water Supply/Well Head Protection Database	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Hist-WIP-Active-CA	Historical Well Investigation Program Case List, Active Sites (aka WIP)	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	None Found
Hist-WIP-Backlog-CA	Historical Well Investigation Program Case List, Backlog Sites (aka WIP)	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	None Found
Hist-WIP-Historical-CA	Historical Well Investigation Program Case List, Historical Sites (aka WIP)	State/Tribal ASTM Other Low	<a href="#">Click Here</a>	None Found
Hist-WMUDS-CA	Historical Waste Management Unit Database System	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
HMIS-US	Hazardous Materials Information System	Federal Emergency Release Reports	<a href="#">Click Here</a>	None Found
HWIS-CA	Hazardous Waste Information Summary	State/Tribal RCRA Equivalent	<a href="#">Click Here</a>	2
HWMP-Controls-CA	Hazardous Waste Management Program Facility Sites with Deed / Land Use Restriction	State/Tribal Inst/Eng Controls	<a href="#">Click Here</a>	None Found
HWT-CA	Hazardous Waste Transporters	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	1
ICE-CA	Inspection, Compliance, and Enforcement	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	None Found

ABREVIATION	DATABASE FULLNAME	DATABASE CATEGORY	DATABASE DETAILS LINK	TOTAL LISTINGS
ICIS-Air-US	Integrated Compliance Information System for Air	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
ICIS-FEC-US	Integrated Compliance Information System for Federal Enforcement Data	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
ICIS-NPDES-US	National Pollutant Discharge Elimination System (NPDES)	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
LA-LF-CA	Los Angeles County Landfills	State/Tribal Solid Waste	<a href="#">Click Here</a>	None Found
Land-Disposal-CA	Geotracker - Land Disposal Sites (aka Landfills, LDS)	State/Tribal Landfill/Solid Waste	<a href="#">Click Here</a>	None Found
LA-Waste-Haulers-CA	Waste Haulers	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Lead-Smelter-2-US	Historical Lead Smelter Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Lead-US	Lead Smelter Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Liens-CA	Environmental Liens	State/Tribal Inst/Eng Controls	<a href="#">Click Here</a>	None Found
LIENS-US	Superfund Liens	Federal Institutional/Engineering Controls	<a href="#">Click Here</a>	None Found
LMOP-US	Landfill Methane Outreach Program	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
LUST-Closed-CA	Geotracker - Leaking Underground Storage Tanks, Closed Cases	State/Tribal LUST	<a href="#">Click Here</a>	4
LUST-Open-CA	Geotracker - Leaking Underground Storage Tanks, Open Cases	State/Tribal LUST	<a href="#">Click Here</a>	None Found
Manifest2-RI	Hazardous Waste Manifest	State/Tribal RCRA Equivalent	<a href="#">Click Here</a>	None Found
MethaneLF-CA	Methane Producing Landfills	State/Tribal Other	<a href="#">Click Here</a>	None Found
Military-Active-CA	EnviroStor Database Military Active Sites (aka MCS)	State/Tribal Voluntary Cleanup Sites	<a href="#">Click Here</a>	None Found
Military-Bases-US	Military Base Boundaries	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Military-NFA-CA	EnviroStor Database Military Active Sites (aka MCS)	State/Tribal Voluntary Cleanup Sites	<a href="#">Click Here</a>	None Found
Military-Other-CA	EnviroStor Database Military Active Sites (aka MCS)	State/Tribal Voluntary Cleanup Sites	<a href="#">Click Here</a>	None Found
Military-UST-CA	Underground Storage Tanks	State/Tribal UST	<a href="#">Click Here</a>	None Found

ABREVIATION	DATABASE FULLNAME	DATABASE CATEGORY	DATABASE DETAILS LINK	TOTAL LISTINGS
Mines2-CA	California Mines	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Mines-CA	Historical Death Valley Mines	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Mines-CDMG-CA	California Division of Mines and Geology	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
MINES-US	Mines Master Index File	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
MLTS-US	Material Licensing Tracking System	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Mortgage-CA	Cal Mortgage Facilities	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
MRDS-US	Mineral Resources Data System (MRDS)	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
MWMP-CA	Medical Waste Management Program	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
NCI-CA	Non-Case Information	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
NEI-LF-CA	Historical NEI (National Emission Inventory) Landfill Point Sources	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
NPDES-CA	National Pollutant Discharge Elimination System	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
NPDES-SW-CA	Notice of Intent Data	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
NPL-Boundaries-US	NPL Boundaries	Federal NPL	<a href="#">Click Here</a>	None Found
NPL-Delisted-US	Delisted NPL Sites	Federal Delisted NPL	<a href="#">Click Here</a>	None Found
NPL-Proposed-US	Proposed NPL Sites	Federal NPL	<a href="#">Click Here</a>	None Found
NPL-US	National Priorities List	Federal NPL	<a href="#">Click Here</a>	None Found
OGM-CA	Oil and Gas Monitoring	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
OGW-CA	California Oil and Gas Wells	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
OSCF-CA	Orphan Site Cleanup Fund	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
PADS-US	PCB Registration Database System	Federal ASTM Other	<a href="#">Click Here</a>	None Found
PCB-US	PCB Transformers	Federal ASTM Other	<a href="#">Click Here</a>	None Found
PCS-US	Historical Permit Compliance System for Clean Water Act	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found

ABREVIATION	DATABASE FULLNAME	DATABASE CATEGORY	DATABASE DETAILS LINK	TOTAL LISTINGS
Perch1-CA	Perchlorate Confirmed Contaminant Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Perch2-CA	Perchlorate Confirmed Contaminant Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
PR-MOA-CA	Polanco Redevelopment MOA Sites	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	None Found
Project-CA	Project - Multipurpose Site Type	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
RADINFO-US	Radiation Information Database	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
RCRA-CESQG-US	Resource Conservation and Recovery Act, Conditionally Exempt Small Quantity Generators (aka RCRA CESQG)	Federal RCRA Generators	<a href="#">Click Here</a>	None Found
RCRA-COR-US	Resource Conservation and Recovery Act, - Corrective Actions (aka RCRA CORRACTS)	Federal RCRA CORRACTS	<a href="#">Click Here</a>	None Found
RCRA-LQG-US	Resource Conservation and Recovery Act, Large Quantity Generators (aka RCRA LQG)	Federal RCRA Generators	<a href="#">Click Here</a>	None Found
RCRA-NON-US	Resource Conservation and Recovery Act, Non-Hazardous Generators (aka RCRA Non-Haz, RCRA NonGen, RCRA No longer Regulated)	Federal RCRA Generators	<a href="#">Click Here</a>	7
RCRA-SQG-US	Resource Conservation and Recovery Act, Small Quantity Generators (aka RCRA SQG)	Federal RCRA Generators	<a href="#">Click Here</a>	2
RCRA-TSDF-US	Resource Conservation and Recovery Act -, Treatment, Storage, and Disposal Facilities (aka RCRA TSD, RCRA TSDF)	Federal RCRA non-CORRACTS TSD	<a href="#">Click Here</a>	None Found
Response-CA	State Response Sites and National Priorities List (NPL)	State/Tribal NPL	<a href="#">Click Here</a>	None Found
RFG-Lab-US	Reformulated Gasoline (RFG)	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
RMP-US	Risk Management Plans	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
ROD-US	Records of Decision	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
SAA-Agreements-US	Sites with Superfund Alternative Approach Agreements	Federal ASTM Other	<a href="#">Click Here</a>	None Found
School-Active-CA	EnviroStor Database School Active Sites (aka School Property Evaluation Program, SCH)	State/Tribal Voluntary Cleanup Sites	<a href="#">Click Here</a>	None Found

ABREVIATION	DATABASE FULLNAME	DATABASE CATEGORY	DATABASE DETAILS LINK	TOTAL LISTINGS
School-NFA-CA	EnviroStor Database School Active Sites (aka School Property Evaluation Program, SCH)	State/Tribal Voluntary Cleanup Sites	<a href="#">Click Here</a>	None Found
School-Other-CA	EnviroStor Database School Active Sites (aka School Property Evaluation Program, SCH)	State/Tribal Voluntary Cleanup Sites	<a href="#">Click Here</a>	None Found
SCP-Closed-CA	Site Cleanup Program, Closed Cases	Emergency Release Reports	<a href="#">Click Here</a>	None Found
SCP-Open-CA	Site Cleanup Program, Open Cases	Emergency Release Reports	<a href="#">Click Here</a>	None Found
SDWIS-US	Safe Drinking Water Information System	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
SEMS-Active-US	Comprehensive Environmental Response, Compensation, and Liability Information System	Federal CERCLIS	<a href="#">Click Here</a>	None Found
SEMS-Archived-US	CERCLIS sites that have been archived	Federal CERCLIS NFRAP	<a href="#">Click Here</a>	None Found
SGV-Deep-Plumes-CA	San Gabriel Valley Deep Plumes	State/Tribal Solid Waste	<a href="#">Click Here</a>	None Found
SGV-Shallow-Plumes-CA	San Gabriel Valley Shallow Plumes	State/Tribal Solid Waste	<a href="#">Click Here</a>	None Found
SGV-Shallow-Plumes-Puente-Valley-CA	Puente Valley Shallow Plumes	State/Tribal Solid Waste	<a href="#">Click Here</a>	None Found
SML-CA	Site Mitigation List	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	None Found
SP-CA	Sampling Points	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Spills-SSO-CA	Sanitary Sewer System	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
SSTS-US	Section 7 Tracking System	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
State-Response-Active-CA	EnviroStor State Response Active Sites	State/Tribal NPL	<a href="#">Click Here</a>	None Found
State-Response-NFA-CA	EnviroStor State Response NFA Sites	State/Tribal NPL	<a href="#">Click Here</a>	None Found
State-Response-Other-CA	EnviroStor State Response Other Sites	State/Tribal NPL	<a href="#">Click Here</a>	None Found

ABREVIATION	DATABASE FULLNAME	DATABASE CATEGORY	DATABASE DETAILS LINK	TOTAL LISTINGS
Superfund-Active-CA	Envirostor Superfund Active Sites (aka BEAP, CalSites, Brownfields and Environmental Restoration Program)	State/Tribal CERCLIS Equivalent	<a href="#">Click Here</a>	None Found
Superfund-NFA-CA	EnviroStor Superfund NFA Sites (aka BEAP, CalSites, Brownfields and Environmental Restoration Program)	State/Tribal CERCLIS Equivalent	<a href="#">Click Here</a>	None Found
Superfund-Other-CA	EnviroStor Superfund Sites (aka BEAP, CalSites, Brownfields and Environmental Restoration Program)	State/Tribal CERCLIS Equivalent	<a href="#">Click Here</a>	None Found
SWIS-CA	Solid Waste Information System	State/Tribal Landfill/Solid Waste	<a href="#">Click Here</a>	1
SWLF-US	Solid Waste Facilities	Federal Solid Waste	<a href="#">Click Here</a>	None Found
SWRCY-CA	Beverage Container Recycler Database	State/Tribal ASTM Other Med	<a href="#">Click Here</a>	None Found
TierPer-CA	Tiered Permits	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
TOMS-CA	Topographically Occurring Mine Symbols	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Tribal-Air-US	Tribal Air Permitted Facilities	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
Tribal-LUST-Closed-US	Tribal Leaking Underground Storage Tanks, Closed Cases	Federal LUST	<a href="#">Click Here</a>	None Found
Tribal-LUST-Open-US	Tribal Leaking Underground Storage Tanks, Open Cases	Federal LUST	<a href="#">Click Here</a>	None Found
Tribal-ODL-US	Tribal Open Dump Sites	Federal Solid Waste	<a href="#">Click Here</a>	None Found
Tribal-UST-US	Tribal Underground Storage Tanks	Federal UST	<a href="#">Click Here</a>	None Found
Tribal-VCP-US	Historical Tribal VCP	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
TRIS2000-US	Historical Toxics Release Inventory System	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
TRIS2010-US	Toxics Release Inventory System	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
TRIS80-US	Historical Toxics Release Inventory System	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
TRIS90-US	Historical Toxics Release Inventory System	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
TSCA-US	Toxics Substance Control Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
UIC2-CA	Injection Wells	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
UIC-CA	Underground Injection Control Wells	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found

ABREVIATION	DATABASE FULLNAME	DATABASE CATEGORY	DATABASE DETAILS LINK	TOTAL LISTINGS
UMTRA-US	Historical Uranium Mill Tailings Remedial Action Sites	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
USGS-Waterwells-US	Ground Water Site Inventory	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
UST-Abandoned-COMP-CA	Previously Abandoned Tanks Now in Compliance (aka Compliance UST)	State/Tribal UST	<a href="#">Click Here</a>	None Found
UST-Abandoned-NCOMP-CA	Abandoned UST Initiative (aka Inventory of Abandoned Tank Sites)	State/Tribal UST	<a href="#">Click Here</a>	None Found
UST-CA	Geotracker - Underground Storage Tanks	State/Tribal UST	<a href="#">Click Here</a>	None Found
UST-Closed-CA	UST Case Closure Review Denials and Approved Orders (aka Closure of Underground Storage Tank (UST) Cases)	State/Tribal UST	<a href="#">Click Here</a>	None Found
UST-Priority-CA	UST Cleanup Fund Priority List	State/Tribal UST	<a href="#">Click Here</a>	None Found
UST-Proposed-CA	Proposed Closure of UST Cases (aka UST Proposed for Closure)	State/Tribal UST	<a href="#">Click Here</a>	None Found
Vapor-Intrusions-US	Vapor Intrusion Database	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	None Found
VCP-Active-CA	EnviroStor VCP Active Sites	State/Tribal Voluntary Cleanup Sites	<a href="#">Click Here</a>	None Found
VCP-NFA-CA	EnviroStor Database VCP NFA Listing	State/Tribal Voluntary Cleanup Sites	<a href="#">Click Here</a>	None Found
VCP-Other-CA	EnviroStor VCP Other Sites	State/Tribal Voluntary Cleanup Sites	<a href="#">Click Here</a>	None Found
WDR-CA	Waste Discharge Requirements	ERS Supplemental Govt Sources	<a href="#">Click Here</a>	1

## **UN-MAPPABLE OCCURRENCES**

The following occurrences were not mapped primarily due to incomplete or inaccurate address information. All of the following occurrences were determined to share the same zip code as the area searched. General status information is given with each occurrence along with any address information entered by the agency responsible for the list.

<b>ID</b>	<b>Facility Name</b>	<b>Address</b>	<b>Database</b>	<b>Status</b>
No "un-mapped" sites requested.				

---

## **DISCLAIMER, LIMITS AND LIABILITIES**

All of the data presented in this report was garnered from public information maintained by governmental agencies. **Environmental Record Search (ERS)** cannot ensure that the data, which has been entered and maintained by others, is complete and/or accurate. Any, and all omissions, errors, negligence, accidentally or otherwise within the data received by **ERS** is assumed to be caused by others and **ERS** cannot and does not assume, take, or acknowledge any liability whatsoever for their respective data. The extrapolation of the mapped locations is based solely on the accuracy of the data provided by others. Prior to relying completely on any mapped location within this report, its accuracy should be verified using other means such as further documentation or a field visit. **ERS** makes no representation, warranty or guaranty, express or implied regarding the accuracy of the data entered and maintained by others or the suitability of the data received from others in this report for a certain task or interpretation.

The data presented in this report should only be interpreted by an experienced environmental professional, as per EPA definition, that completely understands the potential inaccuracy of the data derived from others, the possible existence of contaminated occurrences that have not been listed, and the possibility that the governmental database misrepresents the actual status of an occurrence or listing. Prior to relying completely on any of the data within this report, an environmental professional should verify the accuracy of the information presented unless one of ERS's Environmental Professionals has interpreted the data and/or report.

It is important that the reader and/or end user of this information realize that the data gathered has not been verified for its accuracy or completeness in any way by **ERS**. With billions of records, this is an impossible task for any Company. As much as possible, the data is presented unchanged and unaltered to represent the actual data produced by these agencies. This insures the integrity of the data for the end user.

**ERS** does however stand behind its representation of the data, any manually plotted occurrences, any risk determinations and all other items directly under its control. This report does comply (as far as the data is reasonably ascertainable as outlined in both the following standards) with section 8.2.2 of ASTM 1527-21 – Standard Environmental Record Sources and EPA's 40 CFR Part 312, All Appropriate Inquiries. **ERS** does ensure that the data is accurately reproduced from the original source. **ERS** backs the reporting of the data with \$3,000,000 of General and Environmental Professional Liability (errors and omissions) Insurance!

The **ERS** logo, name, report design, presentation, maps, tables, etc., are the exclusive property of **ERS** and its parent company and affiliates. Except as provided below, information or images contained in this report may not be reproduced or distributed in whole or in part by any means without the prior written permission from **ERS**. United States and international copyright laws protect any and all reports produced by **ERS**.

The person or entity that purchased this report may make up to five (5) copies of the entire report or any part of it for archival purposes or to include as part of another report. All copyright information must remain intact and not be modified in any way.

**Environmental Record Search (ERS)** and their respective products/reports (i.e. RecCheck, LenderCheck, Environmental Screen, etc.) as well as their respective business operations, are **NOT** associated in any way with nor related to, First American Commercial Real Estate, Inc. (FACRES) and/or the First American Family of Companies.

Maps throughout this report were created using ArcGIS® software by ESRI. ArcGIS® and ArcMap™ are the intellectual property of ESRI and are used herein under license. Copyright © ESRI. All rights reserved. For more information about ESRI® software, please visit [www.esri.com](http://www.esri.com). Topographic imagery used in maps throughout this report are Copyright © 2011 National Geographic Society. Street and aerial "hybrid" imagery used in maps throughout this report are Copyright © 2010 Microsoft Corporation and its data suppliers.